

G4 Multi Channel Weighing Instrument

Program version 1.7.0.0



Technical Manual

PM/DT/HE types

Contents

1. Introduction

| | |
|----------------------------|------|
| General | 1-1 |
| Functions | 1-2 |
| Maintenance | 1-4 |
| Safety information | 1-4 |
| Technical data | 1-5 |
| Ordering information | 1-12 |

2. Installation

| | |
|------------------------------------|------|
| Mechanical installation | 2-1 |
| Electrical installation | 2-2 |
| CPU unit | 2-3 |
| DC SUPPLY | 2-5 |
| AC SUPPLY | 2-6 |
| WF IN, WF IN2 and HS WF2 | 2-7 |
| AOUT1 and AOUT4 | 2-10 |
| DIO8 | 2-11 |
| Profibus-DP Fieldbus Adaptor | 2-12 |
| DeviceNet Fieldbus Adaptor | 2-14 |
| Front panel | 2-16 |

3. Set-up

| | |
|-------------------------------|------|
| General | 3-1 |
| Graphical touch display | 3-3 |
| Menu structure | 3-6 |
| Parameters | 3-9 |
| Program options | 3-46 |

4. Calibration

| | |
|------------------------------|-----|
| General | 4-1 |
| Common parameters | 4-2 |
| Data sheet calibration | 4-4 |
| Table calibration | 4-5 |
| Deadweight calibration | 4-5 |

5. Operation

| | |
|--|-----|
| General | 5-1 |
| Power supply | 5-1 |
| Power-up sequence | 5-1 |
| Display alt. by normal operation | 5-2 |
| Security locks | 5-4 |
| Taring | 5-5 |
| Gross/Net operation | 5-6 |
| Zero setting | 5-6 |
| Zero-track./Auto. zero setting | 5-7 |
| Motion | 5-7 |
| Weight printing | 5-8 |

| | |
|---------------------------------|------|
| Batch report printing | 5-9 |
| Main menu | 5-9 |
| Level supervision | 5-11 |
| Setpoint function | 5-12 |
| Use of inputs and outputs | 5-13 |
| Filter function | 5-13 |
| Flow rate | 5-15 |

6. Communication

| | |
|--------------------------|------|
| General | 6-1 |
| Serial interface | 6-1 |
| Modbus RTU Slave | 6-1 |
| Modbus TCP Slave | 6-2 |
| External I/O | 6-3 |
| Ftp Server | 6-4 |
| Modbus protocol | 6-4 |
| Fieldbus interface | 6-32 |
| Weight printing | 6-46 |

7. Remote Access

| | |
|--------------------------------------|------|
| General | 7-1 |
| Browser requirements | 7-1 |
| Using the Remote Access | 7-2 |
| Security | 7-2 |
| Remote Access Login and Logout | 7-3 |
| Remote / Local Access | 7-5 |
| Remote Set-up | 7-6 |
| Remote Access Maintenance | 7-10 |
| Instrument Restart | 7-18 |

8. Maintenance

| | |
|--------------------------|-----|
| General | 8-1 |
| Diagnostics | 8-1 |
| File handling | 8-6 |
| Create Backup | 8-6 |
| Restore Backup | 8-7 |
| Set Default | 8-7 |
| Program Upgrade | 8-7 |
| Instrument Restart | 8-8 |

9. Troubleshooting

| | |
|-------------------|-----|
| General | 9-1 |
| Error codes | 9-1 |

Appendix

| | |
|---------------------------------|-------|
| Declaration of Conformity | App.1 |
|---------------------------------|-------|

PRECAUTIONS

READ this manual BEFORE operating or servicing this instrument.

FOLLOW these instructions carefully.

SAVE this manual for future reference.



WARNING

Only permit qualified personnel to install and service this instrument. Exercise care when making checks, tests and adjustments that must be made with power on. Failing to observe these precautions can result in bodily harm.

DO NOT allow untrained personnel to operate, clean, inspect, maintain, service, or tamper with this instrument.

INTENDED USE

The G4 Instrument family are multi channel measuring and control devices intended for industrial systems. Its basic function is to convert the signals from transducers to useful information. Transducer excitation is included as well as parameter controlled signal processing, indication of output levels, error supervision and operation of optional external equipment.

The instrument supports several types of communication interfaces. The instruments are modular and can be equipped with different types of I/O units. There are transducer interface modules, digital and analog input/output modules.

1. Introduction

General

The G4 Instrument is a high performance multi channel weight indicator intended for industrial systems.

Its basic function is to convert the signals from strain gauge transducers to useful weight information. Transducer excitation is included as well as parameter controlled signal processing, indication of output levels, error supervision and operation of optional external equipment. The instrument can be equipped with up to 8 synchronized weighing channels.

The instrument is modular and can be equipped with different types of **I/O units** to match the demands in the specific applications. There are strain gauge transducer interface modules, a digital input/output module, and analog output modules. Internal solid-state outputs in the instrument can be used for output functions from level supervision, setpoints, etc. or 'In process' indication, reporting the operating status of the G4 Instrument.

The **CPU unit** in the instrument has several communication interfaces. It has two serial communication ports, an Ethernet port, an USB port and a fieldbus slot. Several G4 Instruments can be controlled from a master computer or PLC. Serial communication interfaces are RS-485 and RS-232 for communication with a computer/PLC (using Modbus RTU protocol) or for transmitting print out data to a connected printer. The Ethernet interface is using Modbus TCP and the optional fieldbus interface uses Profibus or DeviceNet.


It is possible to access the instrument, set-up and maintenance functions, remotely over the Ethernet connection using a Web Browser on a connected PC.

In the Weighing program there are two program options available, one is the Flow Rate program option and the other is the Scale Batching program option. By entering its option code a program option is enabled. The option code can be purchased from your supplier.

It is possible to load new software into the instrument using the USB port.

All functions in the G4 Instrument are controlled by set-up parameters. Setting of parameter values can be performed with **keys** and/or **graphical touch display** on the front panel.

24 V DC or 110/230 V AC powers the G4 Instrument. All input and output signals are galvanically isolated from the power supply by operational insulation.

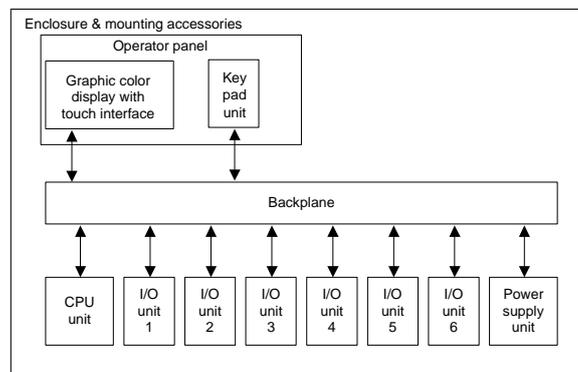

Block structure of a G4 Instrument

Functions

Measurement with strain gauge transducers.

Both excitation voltage and output signal are measured at the transducer to avoid influence from voltage drop in the connection cable. Excitation to the transducer, from the G4 Instrument is provided over separate wires. A shielded 6-wire cable must be used to connect a distant transducer to the instrument.

A/D conversion.

The analog signals from the transducer are converted to digital form and filtered to give an internal transducer signal with high resolution.

Calculation.

The transducer excitation and signal values are combined to form an internal transducer signal, representing the load on the transducer. Influenced by calibration data, this signal is converted to a digital measurement value, the weight value, which can be presented at the local display window and at external equipment.

Error supervision.

As long as the error supervision detects no error, the signal 'In process' is present but if an error is detected, 'In process' will be off and a specific error message will be displayed. 'In process' can be set to control any digital output. Note that there are weighing channel specific and instrument specific error detection.

Levels.

32 level comparators in the instrument can be set to switch at defined signal levels with any selected hystereses added, meaning that the switch level can be different for increasing and decreasing signal. Output signals from these comparators are available on the serial communication. The level comparator outputs can also be set to control digital outputs from the instrument.

Communication.

The G4 Instrument utilizes the serial interface, Ethernet and a fieldbus interface for communication with control computer. The serial interface consists of a RS-232 (COM1) connection and a RS-485/RS-422 (COM2) connection. COM2 can be used with 2- or 4-wire connection.

Weight values, level status, error status etc. can be collected and commands given through the communication interfaces. Modbus RTU protocol is used for the serial interfaces and Modbus TCP for the Ethernet connection. For the optional fieldbus interface Profibus or DeviceNet can be used.

The serial interfaces can also be used to connect a printer for printing of weight and/or flow rate values etc. If the Scale Batching Program Option is enabled it is possible to print batching reports.

Instrument modes.

In normal operation mode the G4 Instrument is presenting the measurement values on the front panel graphical display. One or more weighing channels can be shown simultaneously. The user can configure the display via set-up parameters. During parameter set-up the instrument will continue normal operation. However if hardware set-up parameters have been changed the instrument will be restarted. The operator will always be notified before the instrument is restarted.

Parameter setting.

In the instrument all operating functions are controlled by set-up parameters with numerical values, string values, or pre-selected values from a list of alternatives. Parameter set-up is performed by the keys at the front panel of the instrument and/or by using the buttons displayed on the touch display.

Presentation.

The instrument can present measured or calculated values, status of levels, parameter settings etc. at the front panel. An extensive system of menus gives the possibility to present various information about the instrument.

Measured or calculated values, status of levels and so on, can be transferred to external equipment via the different communication interfaces (some are optional).

Scale Batching program option.

There is a batching function within the instrument, which is enabled with an option code, which can be bought from the instrument supplier. The batching option gives the possibility to perform individual batching with each scale. See the separate 'Scale Batching Program Option' 'Technical Manual Supplement' available for the batching option.

Flow Rate program option.

With the Flow Rate program option enabled the instrument can calculate the flow rate based on the weight. The flow rate is calculated and set-up individually for each scale. Flow rate can be shown on the display, sent to (optional) analog outputs and read through any of the available communication alternatives in the instrument. An option code is required to enable this program option. See the description of the flow rate calculation in this manual.

Remote Access.

It is possible to access the instrument through the Ethernet connection. Using a Web Browser on the connected PC most set-up and maintenance functions are available on the PC. This possibility will simplify commissioning and service. It will make it possible to access instruments from outside the local network (internet) providing the network allow this.

Maintenance

The G4 instrument needs no maintenance, performed by the end-user. Any service or repair work must be performed by qualified personnel.

Contact your supplier.

Cleaning

Before cleaning the G4, break the power connection to the instrument.

Use a soft cloth to clean the exterior of the instrument. For cleaning the instrument front panel, a soft, damp, cloth may be used.

Safety information

Utilization.

Before connecting power to the instrument, check that all fixation screws at the modules are tightened so that the instruments functional grounding by the housing is maintained.

The instrument may only be utilized for the measurement and control functions, described in this Technical Manual. It is especially important to adhere to the load limits of the input/output connectors. We accept no responsibility for any damage arising from improper operation.

Any changes to the instrument, which causes any function changes, may only be carried out by the manufacturer, or after discussion with and permission by the manufacturer.

Meaning of symbols, used in this manual



Direct current.




Alternating current.




Caution, risk of danger. Documentation needs to be consulted.

Technical data


| Enclosure types | PM - Panel mount | DT – Desktop | HE – Harsh Environment |
|----------------------|---|--|---|
| |  |  |  |
| Enclosure design | Aluminium housing, plastic panel | Aluminium housing, plastic panel | Stainless steel housing, plastic panel |
| Dimensions | See figure Panel thickness: 2 – 25 mm | See figure | See figure |
| Strain relief | — | 6 pcs. for cable dia. 4.3 to 11.4 mm | 6 pcs. for cable dia. 4.3 to 11.4 mm |
| Display | Color TFT LCD screen with backlighting, 5.7" 320x240 pixels | | |
| Keyboard | Touch screen and 34 membrane keys | | |
| <u>Environmental</u> | | | |
| Temperature range | Rated performance: -10 to +50 °C Storage: -25 to +85 °C | | |
| Relative humidity | Max. 85% up to 40°C, decreasing linear to 50% at 50°C | | |
| Rated pollution | Pollution degree 2 | Pollution degree 3 | Pollution degree 3 |
| Protection | IP65 (panel), indoor use | IP65, indoor use. Rated for wet locations | IP65, indoor use. Rated for wet locations |
| Altitude | Up to 2000 m | | |
| EMC, RF | CE (Industrial), OIML | | |

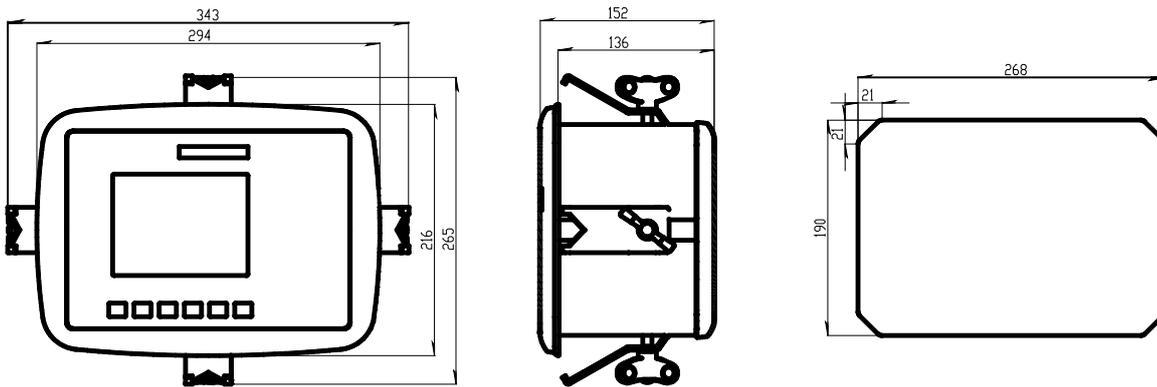

PM -Panel mount enclosure outlines and panel cutout.

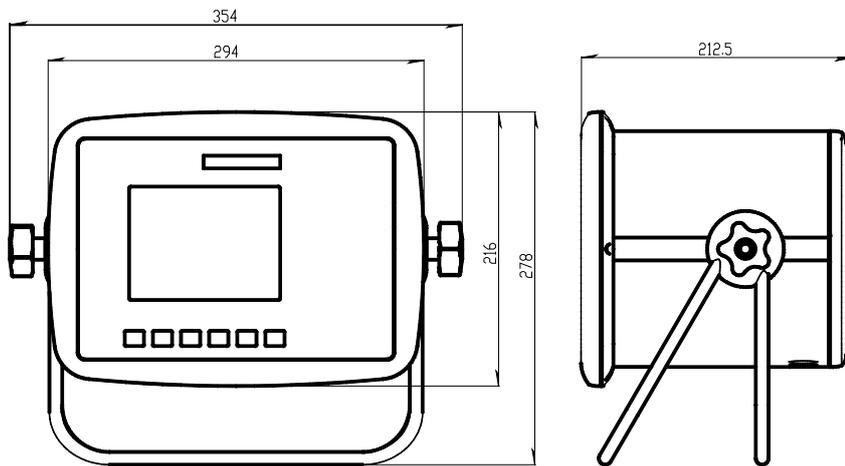

DT -Desktop enclosure outlines

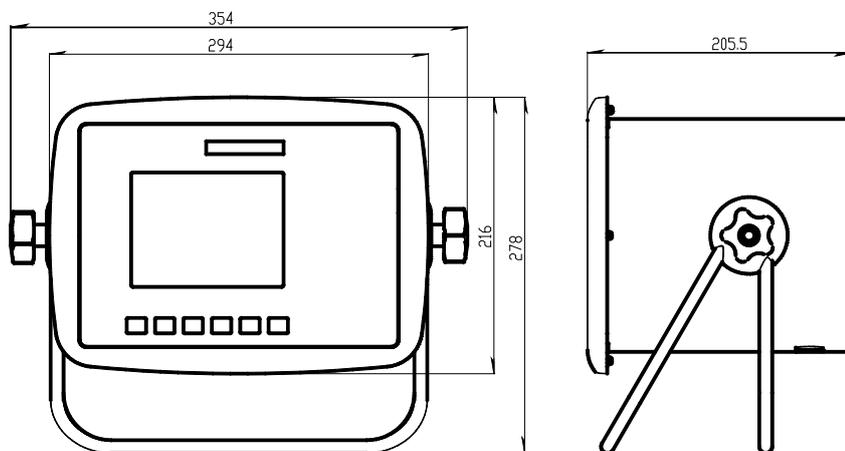

HE - Harsh environment enclosure outlines

| CPU | | | | |
|---|---|---|---|---|
|  | | | | |
| Module type | CPU module | | | |
| RTC backup battery | <table border="0"> <tr> <td>Lithium battery CR2032 3V</td> <td><u>Manufacturer</u> Panasonic-BSG GP Batteries Varta</td> <td><u>Type</u> CR2032 CR2032 CR2032 (V)</td> </tr> </table> | Lithium battery CR2032 3V | <u>Manufacturer</u> Panasonic-BSG GP Batteries Varta | <u>Type</u> CR2032 CR2032 CR2032 (V) |
| Lithium battery CR2032 3V | <u>Manufacturer</u> Panasonic-BSG GP Batteries Varta | <u>Type</u> CR2032 CR2032 CR2032 (V) | | |
| COM1 (RS232) and COM2 (RS485) | For process data and control or printout data to a connected printer. Isolated by operational insulation | | | |
| Protocol | Modbus RTU | | | |
| Baud rate | Up to 115 kbaud | | | |
| Fieldbus | For process data and control (optional) | | | |
| Types | Profibus or DeviceNet | | | |
| USB | Version 1 | | | |
| Keyboard | USB keyboard for PC | | | |
| USB Memory | USB type for PC For backup and restore of set-up parameters For change to a new program version | | | |
| Ethernet | 10/100BASE-T. For process data, control, file transfer and remote access. | | | |
| Protocol | Modbus TCP, ftp, http. | | | |

| DC SUPPLY | |
|---|---|
|  | |
| Module type | Power supply module |
| Input | 24 V _{DC} ±15% including fluctuations, 40W Impulse withstand (overvoltage) category I of IEC 60364-4-443 |
| Output | 24 V _{DC} output 0.1 A The same voltage as input voltage |

| AC SUPPLY | |
|---|--|
|  | |
| Module type | Power supply module |
| Input voltage | 110-240 V~ +10% -15% including fluctuations, 50/60 Hz, 40W Impulse withstand (overvoltage) category II of IEC 60364-4-443 |
| Output voltage | 24 V _{DC} output 0.1 A |

| WF IN / WF IN2 | |
|--|---|
|  | |
| Module type | Weight/Force input module |
| Max. # of transducers | 8 (350 ohm) per channel Maximum 48 transducers per instrument |
| Excitation voltage: | 5 VDC |
| A/D conversion: | 3.9 kHz, 16 000000 units (24 bits) |
| Input range | +/- 7 mV/V |
| Update rate: | 2.3 – 300 readings per second |
| No. of channels: | WF IN has 1 Weight/Force channel WF IN2 has 2 Weight/Force channels |
| Sensitivity: | 0.1 μ V |
| Zero drift: | <10 nV/V/K |
| Span drift: | <2 ppm/K |
| Digital I/O | 4 inputs, 24 V \pm 15%, 5 mA from external power supply, isolated by operational insulation and with common return 2 outputs, 24 V \pm 15%, max 100 mA from external power supply, isolated by operational insulation and with common return |

HS WF2



| | |
|-----------------------|---|
| Module type | High Speed Weight/Force input module |
| Max. # of transducers | 4 (350 ohm) per channel |
| Excitation voltage: | 10 VDC |
| A/D conversion: | 20 kHz, 16 000000 units (24 bits) |
| Input range | +/- 4.5 mV/V |
| Update rate: | 12.5 – 800 readings per second |
| No. of channels: | HS WF2 has 2 Weight/Force channels, separately isolated by operational insulation |
| Sensitivity: | 0.1 μ V |
| Zero drift: | <10 nV/V/K |
| Span drift: | <2 ppm/K |
| Digital I/O | 4 inputs, 24 V \pm 15%, 5 mA from external power supply, isolated by operational insulation and with common return 2 outputs, 24 V \pm 15%, max 100 mA from external power supply, isolated by operational insulation and with common return |

DIO8



| | |
|---------------------|---|
| Module type | Digital input/output module |
| Separate I/O module | 2 units can be used |
| Digital I/O | 8 inputs, 24 V \pm 15%, 5 mA from external power supply, isolated by operational insulation and with common return 8 outputs, 24 V \pm 15%, max 100 mA from external power supply, isolated by operational insulation and with common return |

AOUT1 / AOUT4



| | |
|--------------------|--|
| Module type | Analog output module |
| Number of channels | 1 or 4 channels, separately isolated by operational insulation |
| Resolution | 65000 units, 16 bits |
| Voltage output | 0 – 10 V, -10 – 10 V, > 1 kohm load |
| Current output | 4 – 20 mA, 0 – 20 mA, -12 – 20 mA, -20 – 20 mA, < 500 ohm load |
| Update rate | Scale update rate, adjustable smoothing filter |

Profibus-DP



| | |
|---------------|--|
| Module type | Profibus-DP fieldbus adaptor |
| Connector | Profibus 9-pin, female D-sub (DB9F) |
| Baudrate | Auto setting 9.6 kbps – 12 Mbps |
| Address | 1 – 125, set by parameter |
| Fieldbus data | 16 bytes from fieldbus to instrument. 32 – 244 bytes from instrument to fieldbus (may be limited by the master). See chapter 'Communication' section 'Fieldbus communication interface' for details on fieldbus data mapping. |
| Mounting | The fieldbus adaptor is mounted through the front of the CPU module with LED's and connector accessible through the CPU front panel. Remove the plastic cover from the fieldbus slot in the CPU module front panel. Insert the adaptor very carefully and make absolutely sure that the adaptor slides correctly into the guides in the connector on the CPU PCB. Tighten the two fastening screws at the adaptor front and check that the two securing hooks locks into the CPU PCB. |
| Settings | All fieldbus settings are done with setup parameters in the instrument. No settings are done on the module itself. |

DeviceNet



| | |
|--------------------|---|
| Module type | DeviceNet fieldbus adaptor |
| Connector | 5 pin male connector. |
| Baudrate | 125, 250, 500 kbps or Auto. Set by parameter. |
| Address | 0 – 63, set by parameter |
| Fieldbus data | <p>16 bytes from fieldbus to instrument.</p> <p>32 – 244 bytes from instrument to fieldbus (may be limited by the master).</p> <p>See chapter 'Communication' section 'Fieldbus communication interface' for details on fieldbus data mapping.</p> |
| Mounting | <p>The fieldbus adaptor is mounted through the front of the CPU module with LED's and connector accessible through the CPU front panel.</p> <p>Remove the plastic cover from the fieldbus slot in the CPU module front panel. Insert the adaptor very carefully and make absolutely sure that the adaptor slides correctly into the guides in the connector on the CPU PCB. Tighten the two fastening screws at the adaptor front and check that the two securing hooks locks into the CPU PCB.</p> |
| Settings | All fieldbus settings are done with setup parameters in the instrument. No settings are done on the module itself. |
| Bus Supply Voltage | According to the DeviceNet (Node) Specification: nominal 24 VDC, range 11 – 25 VDC. |

Ordering information

For Panel mount (PM), Desktop (DT) and Harsh environment (HE) instruments

G4-PM-FB-S1-S2-S3-S4-S5-S6-P-SW

| Instrument type | | | |
|-----------------|--------------------|---------------------------------|---|
| PM | Enclosure type | PM DT HE | Panel mount Desktop Harsh environment |
| FB | Fieldbus interface | 0 P D | None Profibus DeviceNet |
| Si | Slot 1 to 6 type | 0 2 3 4 6 7 8 | Blank HS WF2 High speed weight/force input module, 2 ch WF IN Weight/force input module, 1 channel WF IN2 Weight/force input module, 2 channels AOUT1 Analog Output module, 1 channel AOUT4 Analog Output module, 4 channels DIO8 Digital Input and Output module |
| P | Power supply | D A | DC power supply AC power supply (Not available at release of this manual) |
| SW | Software (note 1) | W F S | (No code specified) Standard Weighing Program Standard Weighing Program Standard Force Program Special Program (note 2) |

Example: G4-PM-0-4-8-0-0-0-0-0-D-W

- G4 instrument (G4)
- Panel mount (PM)
- No fieldbus (0)
- Slot 1 = WF IN2 (4)
- Slot 2 = DIO8 (8)
- Slot 3 = Blank (0)
- Slot 4 = Blank (0)
- Slot 5 = Blank (0)
- Slot 6 = Blank (0)
- Power =DC supply (D)
- Software = Weighing program (W)

Note 1: The Software (SW) code specifies the program function that should be installed in the instrument. If no code is specified the standard Weighing program will be supplied.

Note 2: If a special program option is desired, the designation of the special program must be specified when ordering.

Separate modules

| Spec.no | Module type | Module name |
|---------|-------------|---|
| 110 544 | CPU | CPU unit |
| 110 546 | HS WF2 | High speed dual Weight/Force input module |
| 110 547 | WF IN | Single Weight/Force input module |
| 110 548 | WF IN2 | Dual Weight/Force input module |
| 110 549 | AOUT1 | Single channel analog output module |
| 110 550 | AOUT4 | Four channel analog output module |
| 110 551 | DIO8 | Digital input/output module |
| 110 552 | BLANK | Blank panel |
| 110 553 | DC SUPPLY | DC supply unit |
| 110 630 | AC SUPPLY | AC supply unit |
| 110 559 | PROFIBUS-DP | Profibus DP fieldbus adaptor |
| 110 560 | DEVICENET | DeviceNet fieldbus adaptor |

Module selection rules

Every system needs 1 Power supply module and 1 CPU module (can be equipped with one fieldbus adaptor).

Limitations on number of I/O modules that can be used in one instrument:

- Maximum 6 modules.
- Maximum 4 WF IN / WF IN2 or 2 HS WF2 modules.
- HS WF2 and WF IN(2) cannot be mixed in the same system.
- Maximum 1 AOUT1 or 1 AOUT4 module.
- Maximum 2 DIO8 modules.

2. Installation

Mechanical installation

See chapter 'Introduction – Technical data' for references to PM, DT and HE mechanical measures: outer extents, body extents and panel cutout (PM).

PM type instrument:

Make sure the panel thickness meets the specification and that there is room enough behind the panel for the instrument and the connected cables (minimum 200 mm).

Cut a panel opening according to the specification on page 1-5.

Insert the instrument through the opening. Hold it in place while attaching brackets and wing-headed bolts to the four nuts, sliding in grooves of the housing.

Tighten the bolts and make sure the integrated gasket of the instrument is compressed against the mounting panel, giving a sealed attachment.

DT and HE type instrument:


Arrange enough space for cables and strain reliefs behind or below the instrument.

DT instrument housings have 6 plugged openings facing downwards, intended for the cable strain reliefs. As an alternative, knock-out openings in the back panel can be knocked open for strain reliefs facing backwards.

HE instrument housings have 12 plugged openings for the cable strain reliefs, facing downwards and backwards.

Enclosed with each instrument is a set of 6 strain reliefs. For each cable one strain relief should be mounted with a sealing washer on the exterior and a locknut inside the housing.

Mounting legs are fitted to the instrument housings by knob-headed bolts and threaded holes or nuts. Use the enclosed fixing brackets to attach the legs to the table or a wall.

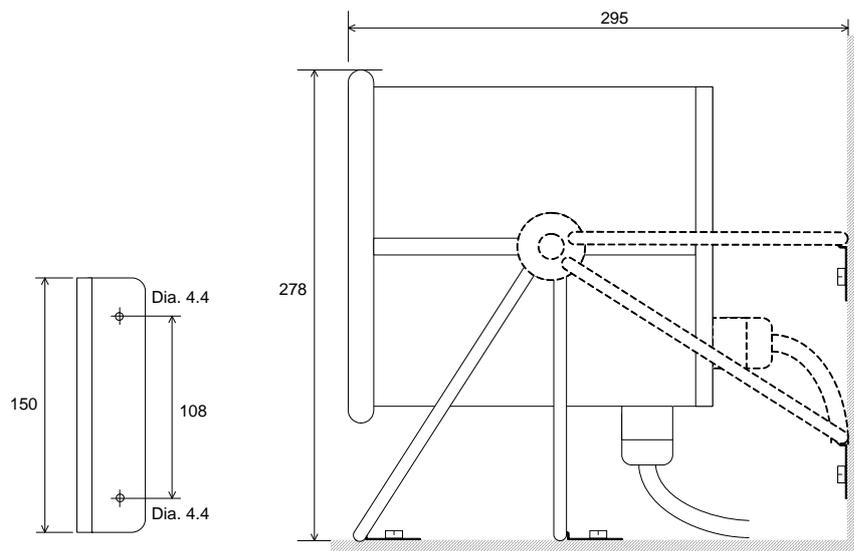

DT and HE instruments.

Fixing bracket, recommended distances to surrounding surfaces.

Electrical installation



The field wiring of the instrument shall be suitable to the environment (e.g. chemically) in the end-user application. Mains cables shall be separated and routed away from SELV or SELV-E field wiring.

For DT and HE instruments UL Listed and KAM cord type flexible cables shall be used. The cable diameters must be selected in accordance with the strain relief specification. See Technical Data.

Field wiring installation shall comply with any national regulations, hereunder National Electrical Code (NEC) for US and/or Canadian Electrical Code for Canada.

- A switch or circuit-breaker shall be included in the building installation.
- The switch shall be in close proximity to the equipment and within easy reach of the operator
- The switch shall be marked as the disconnecting device for the equipment.
- The equipment switch or circuit-breaker employed as disconnecting device shall comply with relevant requirements of IEC 60947-1 and IEC 60947-3.

The power supply for the instruments can be an external DC source and an internal DC SUPPLY unit or external AC mains and an internal AC SUPPLY unit.

For electrical installation with an internal DC SUPPLY unit, see page 2-5.

For electrical installation with an internal AC SUPPLY unit, see page 2-6.

WARNING

Make sure that the power to the instrument is turned off before:

- *any modules are removed from or inserted in the instrument.*
- *any connections are connected to or disconnected from the instrument.*

All modules should be regarded as ESD sensitive. Make sure that an ESD safe environment is maintained when inserting modules, removing modules and when handling modules separately from the instrument. Modules must be kept in metallised ESD bag when not mounted in the instrument.

CPU unit

External computing devices connected to the CPU communication interfaces of the instrument have to comply with the standard, UL 60950.

The internal battery in the CPU module is to be used only in the equipment where servicing of the battery circuit and replacement of the lithium battery will be done by a trained technician.




COM1

RS232 Serial communication.

This is a SELV/SELV-E circuit.

COM1 can be used for serial communication with computer/PLC (Modbus RTU) or a printer. Point to point communication, only one G4 unit connected to the computer/PLC.

Connections are made to terminals 7 – 9. Shielded cable must be used. Connect shield to terminal 10.

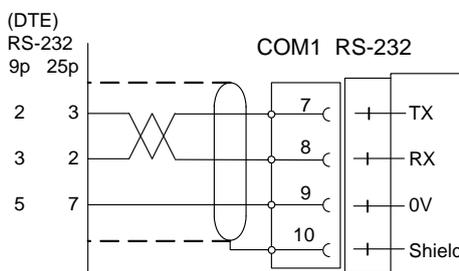

COM2

RS485 Serial communication for 2-wire or 4-wire with common 0 V.



This is a SELV/SELV-E circuit.

COM2 can be used for serial communication to computer/PLC (Modbus RTU) or a printer. Connections are made to terminals 1 – 5. Shielded cable must be used. Connect shield to terminal 6.

The communication lines must be terminated in both ends. If G4 is connected at the end of the communication line switches must be set as:

2-wire termination: Both T2 ON, both R2 OFF.

4-wire termination: Both T2 ON, both R2 ON.

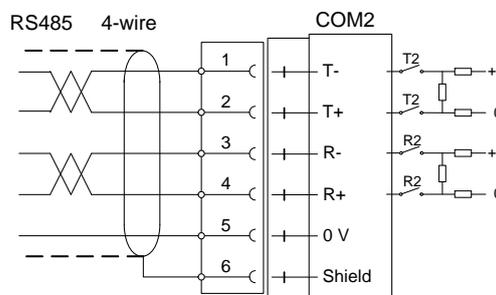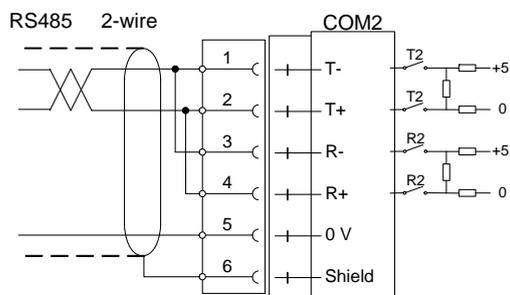

Field Bus

Slot for optional Fieldbus interface

Profibus DP-V1 and DeviceNet are available.

See section Profibus-DP Fieldbus Adaptor or DeviceNet Fieldbus Adaptor later in this chapter for details.

USB

Connector for USB device(s).

This port has no operational insulation and should be considered as a SELV/SELV-E circuit.

Allows connection of following devices:

- 1 - USB Memory
- 2 - USB Keyboard

An USB Hub can be used to allow connection of more than one device.

Ethernet

This is a SELV circuit. Uses crossover category 5 cable from RJ-45 Ethernet port on the CPU front panel to PC (point to point connection) or standard cable to connect to other equipment through a switch, hub or router which is isolating the circuit from the public network.

DC SUPPLY 24 V_{DC} Power supply unit

The output of the external DC source must be rated 24 V_{DC}, ±15% including fluctuations, min. 40 W. The DC source must provide Double Insulation between Mains parts and 24 V SELV or SELV-E Circuit, and a limited-energy circuit (maximum available current of 8 A).

For the US market this energy limit can be achieved with an ANSI/UL248-14 fuse rated 5A.

For other markets an IEC 60127 T type fuse rated 4A may also be used.



24 V_{DC} In

Terminals 1, 2 and 3.

The G4 instrument should be powered by 24 V_{DC}, connected according to the diagram below.

To achieve functional grounding, terminal 3 should be connected to ground.


See Technical data for input voltage ratings.

24 V_{DC} Out

Terminals 4 and 5 can be used to supply max. 100 mA to digital inputs and outputs.

Connection should be according to the diagram below.

See technical data for ratings.

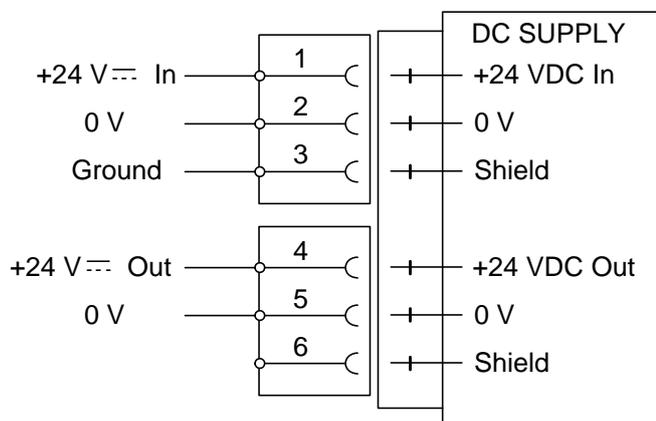

AC SUPPLY – 110-240 V~ Power supply unit



Mains supply cable shall be separated and routed away from SELV or SELV-E field wiring.

The branch circuit protection in the building installation must be rated maximum 16 A for the instrument, where AC SUPPLY module is mounted.

Remove power before removing the module from the instrument.

Make sure the fixation screws are well tightened during operation.



110-240 V~ In

Terminals 1, 2 and 3.

The AC SUPPLY gives the possibility to power the instrument from 110-240 VAC, connected according to the diagram below.

To achieve protective grounding, terminal 3 should be connected to protective earth.


See Technical data for input voltage ratings.

24 V_{DC} Out

Terminals 4 and 5 can be used to supply max. 100 mA to digital inputs and outputs.

Connection should be according to the diagram below.

See technical data for ratings.

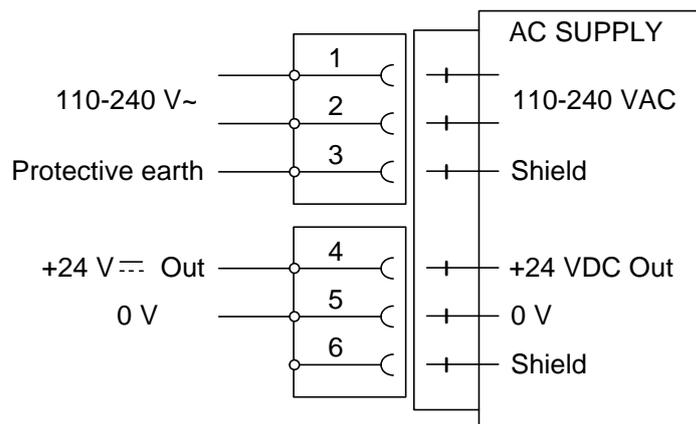

WF IN, WF IN2 and HS WF2

The voltage levels on connectors of I/O modules shall not exceed hazardous voltage levels of 30 Vrms, 42.4 Vpeak or 60 Vdc under normal conditions. In wet locations these voltage levels shall not exceed 16 Vrms, 22.6 Vpeak or 35 Vdc.



Transducer inputs

Terminals 17 – 23 (channel 1),
10 – 16 (channel 2).

Transducer connection should be handled with great care to achieve good measuring data. Transducer integrated cables may not be shortened.

NOTE! Transducer cables must be routed at least 200 mm away from 230/400 V, 50/60 Hz power cables. By cables with other frequencies or high power, an even wider distance is preferable.

4-wire connection can be used if the transducer integrated cable is long enough to be connected directly to a transducer input. At 4-wire connection, some terminals must be interconnected as shown in figure on next page.


6-wire connection should be used if the integrated cable must be lengthened or if several transducers should be connected to one transducer input.



The channel 1 cable shield must be connected to terminal 21 and the channel 2 cable shield must be connected to terminal 14.

In WF IN and WF IN2 the shield terminals are internally connected to the G4 housing, which is internally connected to earth via the power supply connector pin 3 (shield). The shield shall not be connected at any other point.

In HS WF2 the transducer input channels are separately insulated by operational insulation and the shields can be connected to the most convenient ground/earth point. This can be the junction box when using multiple transducers or at the barrier ground when using Ex zener barriers.

In the junction box SL-4 from Nobel Weighing Systems, see figure, all necessary terminals and interconnections are provided.

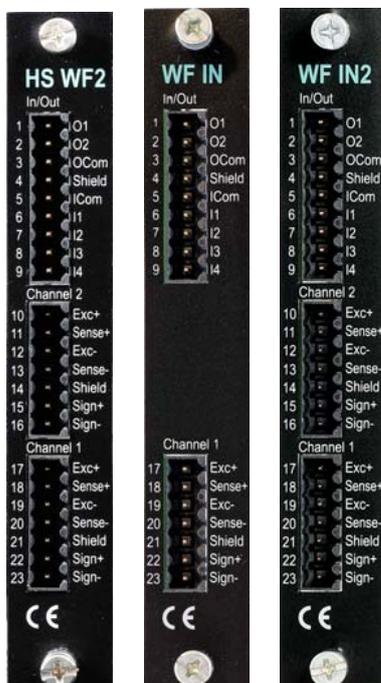

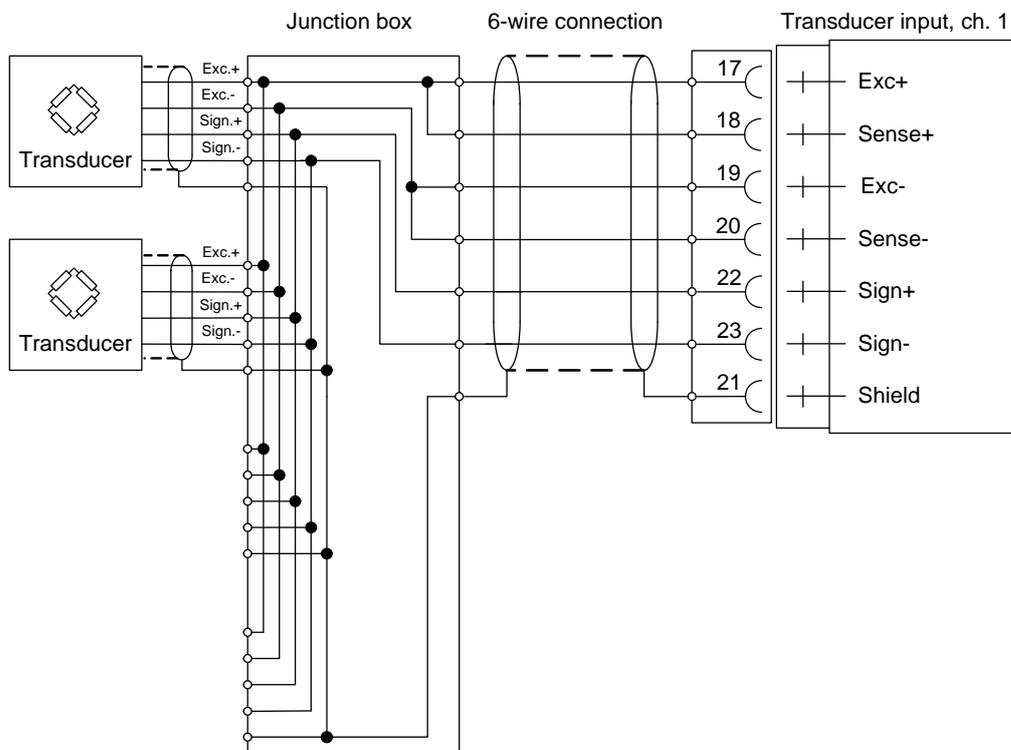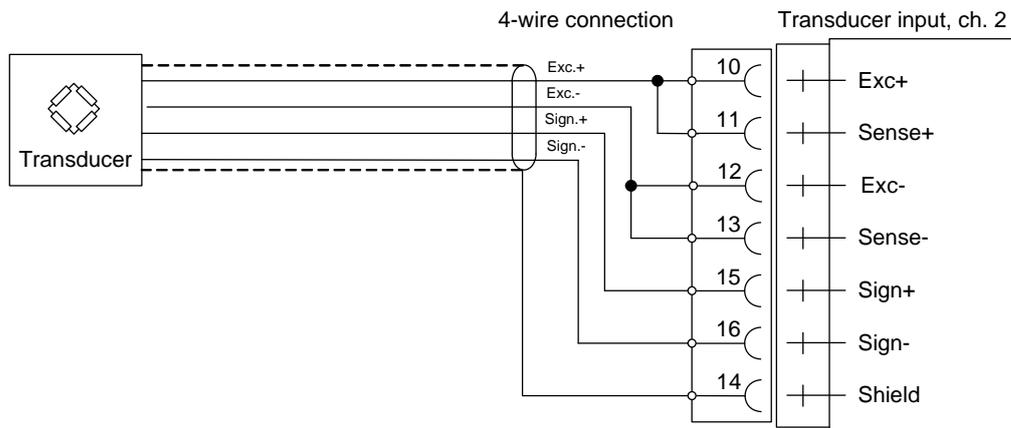

A transducer may be connected directly to terminals at the transducer input.

For several transducers or long distance, a junction box and lengthening cable is needed.

For a HS WF2 channel, the shield can be connected to ground/earth at any point

Digital inputs

Terminals 6 – 9 and terminal 5 (ICom) as a common connection.

Four digital inputs are provided, with functions that can be set in the G4 set-up. External sourcing (24 V $\overline{\text{---}}$) from the instrument power supply (max. 100 mA) or from a separate DC supply must be used. Note that either the positive or the negative pole of the voltage source (24 V $\overline{\text{---}}$) can be connected to ICom (5).


Shielded cable/cables must be used, with the shield connected to terminal 4.

Solid state relay outputs

Terminals 1 and 2 with terminal 3 (OCom) as a common connection.

Two digital (relay) outputs are provided with contact rating given in Technical data. External sourcing (24 V $\overline{\text{---}}$) from the instrument power supply (max. 100 mA) or from a separate DC supply should be used. Note that either the positive or the negative pole of the voltage source (24 V $\overline{\text{---}}$) can be connected to OCom (3).

Shielded cable/cables must be used, with the shield connected to terminal 4.

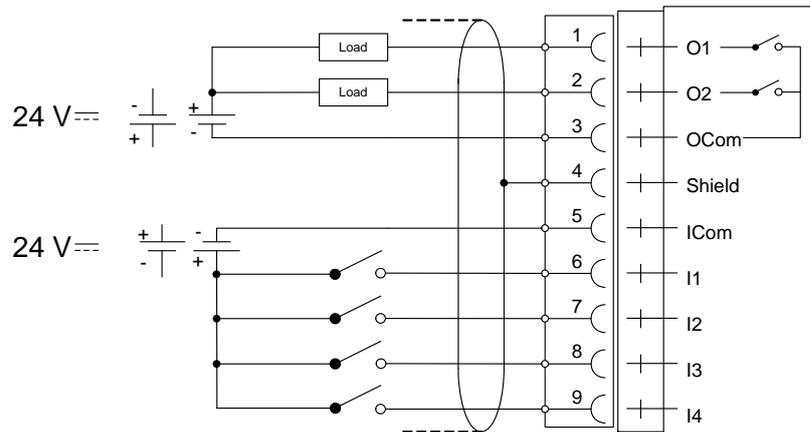

AOUT1 and AOUT4



The voltage levels on connectors of I/O modules shall not exceed hazardous voltage levels of 30 Vrms, 42.4 Vpeak or 60 Vdc under normal conditions. In wet locations these voltage levels shall not exceed 16 Vrms, 22.6 Vpeak or 35 Vdc.

Analog output unit







The AOUT4 unit has 4 analog output channels, independently isolated by operational insulation.

The AOUT1 has 1 output channel, isolated by operational insulation.

The analog output signal will be connected to terminals
 10, 11 (channel 1)
 7, 8 (channel 2)
 4, 5 (channel 3)
 1, 2 (channel 4).

Shielded cable/cables must be used and the shield(s) must be connected to the shield terminal(s) 12, 9, 6 and 3.

The shields can be connected to the most convenient ground/earth point

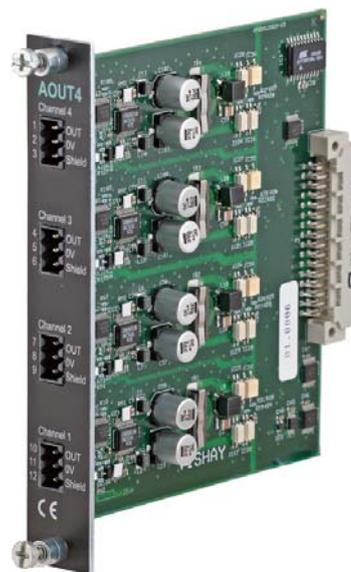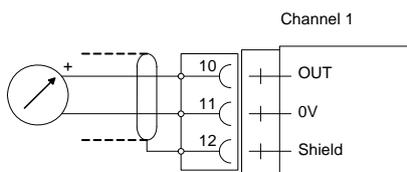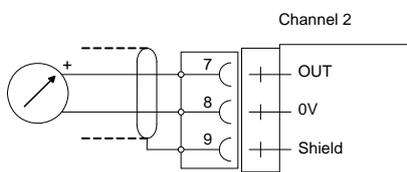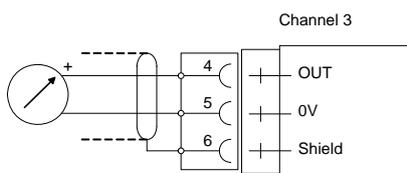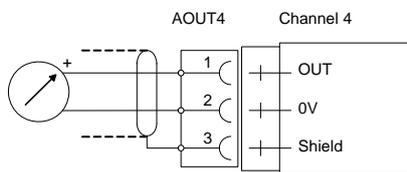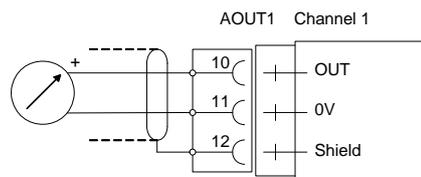

DIO8

The voltage levels on connectors of I/O modules shall not exceed hazardous voltage levels of 30 Vrms, 42.4 Vpeak or 60 Vdc under normal conditions. In wet locations these voltage levels shall not exceed 16 Vrms, 22.6 Vpeak or 35 Vdc.



Digital inputs


Terminals 11 – 18 and terminal 19 (ICom) as a common connection.

Eight digital inputs are provided, with functions that can be set in the G4 set-up.

External sourcing (24 V \equiv) from the instrument power supply (max. 100 mA) or from a separate DC supply must be used.

Note that either the positive or the negative pole of the voltage source (24 V \equiv) can be connected to ICom (19).

Shielded cable/cables must be used, with the shield connected to terminal 20.

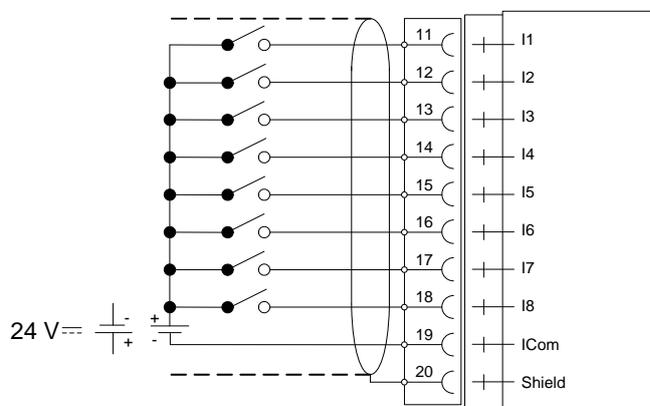


Solid state relay outputs

Terminals 1 - 8 with terminal 9 (OCom) as a common connection.

Eight digital (relay) outputs are provided with contact rating given in Technical data.

External sourcing (24 V \equiv) from the instrument power supply (max. 100 mA) or from a separate DC supply should be used. Note that either the positive or the negative pole of the voltage source (24 V \equiv) can be connected to OCom (9).


Shielded cable/cables must be used, with the shield connected to terminal 10.

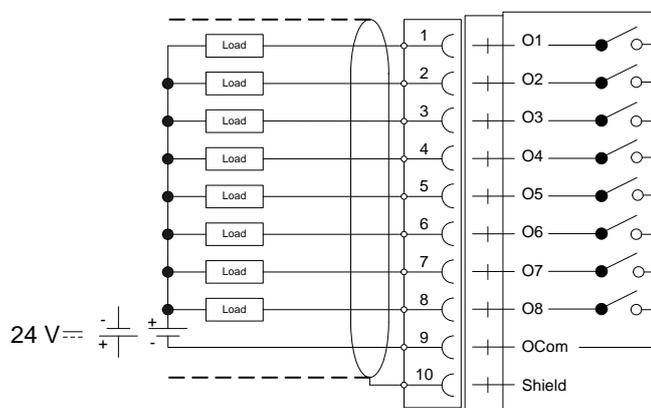

Profibus-DP Fieldbus Adaptor

Profibus module front view

- (1) Operation mode LED.
- (2) Status LED.
- (3) Profibus connector.

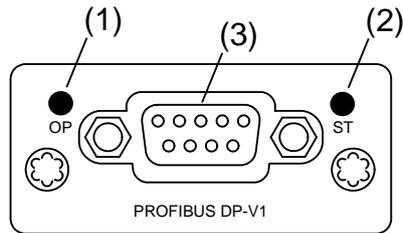

Operation mode LED

| State | Indication |
|--------------------------|------------------------------|
| Off | Not online / No power |
| Green | On-line, data exchange |
| Flashing Green | On-line, clear |
| Flashing Red (1 flash) | Parameterization error |
| Flashing Red (2 flashes) | Profibus configuration error |


Status LED

| State | Indication |
|----------------|--|
| Off | No power or not initialised |
| Green | Initialised |
| Flashing Green | Initialised, diagnostic event(s) present |
| Red | Exception error |

Profibus connector (DB9F)

| Pin | Signal | Description |
|---------|-----------------|--|
| 1 | - | - |
| 2 | - | - |
| 3 | B line | Positive RxD/TxD, RS485 level |
| 4 | RTS | Request to send |
| 5 | GND Bus | Ground (isolated) |
| 6 | + 5V Bus Output | +5V termination power (isolated) |
| 7 | - | - |
| 8 | A line | Negative RxD/TxD, RS485 level |
| 9 | - | - |
| Housing | Cable shield | Internally connected to the Anybus protective earth via cable shield filters according to the Profibus standard. |

For connection of the adaptor to the Profibus master, use a Profibus standard cable and connector according to the diagram below.

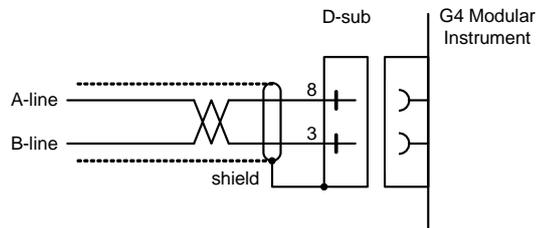


For reliable fieldbus function, line termination must be arranged in both ends of the transmission line. For a G4 instrument, at the end of the cable, a connector with line termination should be used. For all other G4 Instruments connection without line termination should be used.

For configuration of the adaptor, a GSD file (VISH0AB3.GSD) is available and should be installed in the master.

DeviceNet Fieldbus Adaptor

DeviceNet module front view

- (1) Network Status LED.
- (2) Module Status LED.
- (3) DeviceNet connector.

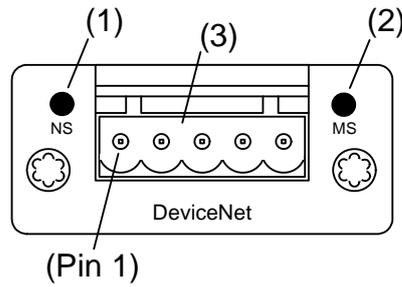

Network Status LED

| State | Indication |
|-----------------------|--|
| Off | Not online / No power |
| Green | On-line, one or more connections are established |
| Flashing Green (1 Hz) | On-line, no connections established |
| Red | Critical link failure |
| Flashing Red (1 Hz) | One or more connections time out |
| Alternating Red/Green | Self test |


Module Status LED

| State | Indication |
|-----------------------|-------------------------------------|
| Off | No power |
| Green | Operating in normal condition |
| Flashing Green (1 Hz) | Missing or incomplete configuration |
| Red | Unrecoverable fault(s) |
| Flashing Red (1 Hz) | Recoverable fault(s) |
| Alternating Red/Green | Self test |

DeviceNet connector

| Pin | Signal | Description |
|-----|--------|-----------------------------|
| 1 | V- | Negative bus supply voltage |
| 2 | CAN L | CAN low bus line |
| 3 | Shield | Cable shield |
| 4 | CAN H | CAN high bus line |
| 5 | V+ | Positive bus supply voltage |

For connection of the adaptor to the DeviceNet master, use a standard cable for DeviceNet, or similar shielded cable with twisted pairs and a connector according to the diagram below.

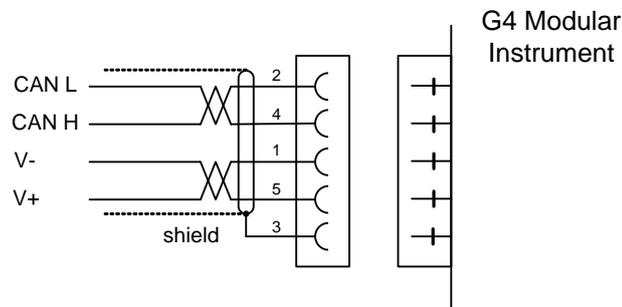

For reliable fieldbus function, line termination must be arranged in both ends of the transmission line. For a G4 Instrument placed at the end of the line, terminate line by placing a 121-ohm resistor between CAN L (pin 2) and CAN H (pin 4).

For configuration of the adaptor an EDS file is supplied with the instrument that should be installed in the master. Note that the EDS file is a generic type supplied by the module manufacturer. The file doesn't contain any reference to the G4 Instrument or to Nobel Weighing Systems.

Front panel

Display

At normal operation the instrument displays weight value(s) and, in some cases, the gross weight as a graphic bar.

Presentation, together with the weight value, of preset tare, status for the level supervision can also be selected in Parameter Set-Up.

If an instrument error occurs, the weighing function is stopped and the instrument switches over to Error mode, indicating a code for the error at the display window.

If there is a scale error this is indicated with error information that replace the weight information on the screen for that specific scale only, other scales are not affected.

The instrument can also display a Main menu with sub menus for display of actual data and entry of new data.

Function keys

 
 
Just below the display there are five function keys, F1 to F5, and with the actual key functions indicated at the lower line of the display. When there is no text above a key, that key has no function. To select a function, press the membrane panel button (F1 to F5) below the display or the button symbol on the touch display.

Symbol keys

At the bottom of the front panel there are four keys, marked with the weighing symbols for taring, gross/net, printing and zeroing plus two keys marked start and stop. A brief description of these keys is given in the table below.



Front panel of the G4 instrument with color touch display, five function keys below the display, six application specific keys, numerical keypad, joystick keypad (arrow keys), Esc, Alt, Backspace, Delete, Tab and ENTER keys. In addition there is an Info key that is used to access the instruments menu system.

| Key | Name | Function |
|---|-----------|--|
|  | TARE | Taring, i.e. entry of the gross weight as auto tare value and display of net weight zero. Depending on actual setting taring may be prevented if 'Motion' is displayed. Note that a specific scale must be selected since the instrument can have multiple scales connected. |
|  | GROSS/NET | Toggling between display of gross weight and net weight. Net weight can be displayed only if a tare weight has been entered. Note that a specific scale must be selected. |
|  | PRINT | Printing of the displayed weight value on a connected printer according to parameter settings. Note that a specific scale must be selected. |
|  | ZERO | Setting the gross weight value to zero (provided the value is in the zeroing range: -1 % to +3 % of the capacity) and setting the auto tare value to zero. Note that a specific scale must be selected. |
| | START | Starting batch activities. |
| | STOP | Stopping batch activities. |

Digit keys

The digit keys, including keys with minus sign and decimal point, are used for entry and editing of numerical parameter values.

Miscellaneous keys

An ENTER key on the panel is used to open a selected menu, finish the entry of a value, etc.

The four arrow keys are used to navigate in the menu system and to toggle between selections.

The Esc, Alt, Del, Backspace and Tab keys are used for editing values, toggling between selections and so on.

The 'Info' key is used to enter the instrument menu system. Note that this key can only be used when the weight display is shown.

3. Set-up

General

All operating functions in the G4 Instrument are controlled by parameters. The parameter values are permanently stored in the instrument and will not be lost when the unit is switched off. At delivery the parameters are factory-set to default values, giving the instrument an initial standard function.

The actual setting of the parameter values can be read and edited during normal measuring operation in sub menu 'Parameter Set-up'. When Scale Batching (a program option) is active, on any scale, it will not be possible to edit parameters except for a limited number of batching parameters that still can be edited.

Editing of parameter values can be performed using the color touch display and keys on the front panel of the instrument. After editing hardware parameters the instrument will be restarted.

In the instrument there are two levels of security locks provided to protect from unauthorized access to instrument functions and editing of parameters and values. The locks are opened by four-digit codes.

Warning: *Changes done during editing of set-up parameters will affect the behavior of the instrument immediately. The user must take all necessary precautions to prevent any undesired effects in the process monitored or controlled by the G4 instrument or a connected control system.*

It is strongly recommended to activate the set-up lock in the instrument to prevent any unauthorized changes of set-up parameters.

It's a good practice to make a backup of the set-up after changes have been done. See chapter 'Maintenance' for more information on backup and restore.

When the G4 Instrument is first taken into service, setting of a few parameters will quickly adapt the instrument to the transducers and give desired weighing function. The 'Quick Set-up' is described in a separate publication:

**G4 Multi Channel Weighing Instrument
Operating instructions, Quick installation
PM/DT/HE Types**

If the Scale Batching Program Option is used please refer to the separate batching manual for details on function and set-up:

**G4 Multi Channel Weighing Instrument
Scale Batching Program Option
Technical Manual Supplement
PM/DT/HE/RM Types**

The 'Parameter Set-up' menu contain the following sub menus:

General: This parameter group controls the general functionality of the instrument. Such as display language, display mode, security, key functions and so on.

Hardware Configuration: Parameters used for configuring the instrument hardware. Note that when the instrument is starting up it will check that the installed hardware is compatible with the settings. If not an alarm will be issued.

Calibration: Parameters that affect the behavior of the eight possible weighing channels (scales) in the instrument. There are parameters for calibration type, calibration values, no of transducers, filter settings, motion detection, zero handling and so on. All weighing channels are individually settable.

Communication: Sub menus are Serial Com, Ethernet and Fieldbus. Serial Com sub menu content are parameters used to set-up COM1 (RS232) and COM2 (RS485) on the CPU module. Parameters are among others: com. port mode, baud rate and data format. Ethernet sub menu content is parameters for Modbus TCP Slave and External I/O configuration. Fieldbus sub menu content is configuration parameters related to fieldbus communication such as address, baud rate and transmitted data setup.

Level Supervision: The instrument has 32 level supervisors that are configured from this sub menu. Settings for each level are which scale (measuring channel) that the individual level is to monitor, which signal that shall be monitored from the selected scale. Signals that can be monitored are gross weight, net weight, flow rate and so on. The output function e.g. if the output shall be active above or below the set level is configured here. The fourth parameter for each level is the hystereses setting.

Setpoints: The G4 instrument contains 16 setpoints that are individually configurable regarding which scale it shall be connected to and which signal it shall monitor.

Inputs: The use of the instruments digital inputs is set in this menu. Note that the inputs are numbered 11 to 68. Inputs 11 to 18 corresponds to inputs on slot 1 I/O module, 21 to 28 correspond to inputs on slot 2 I/O and so on. Note that the actual number of inputs depends on what type of I/O-module that is installed in the respective slots. A DIO8 module has 8 inputs a WF IN2 module has 4 inputs while an AOUT1 or AOUT4 has no inputs. Possible usage for an input is tare command, zero command, gross/net toggling and so on. Certain commands like taring is scale oriented and a second parameter for each input is used to set which scale it shall work with.

Outputs: The outputs menu contains the settings controlling the function of each output. Numbering is 11 to 68 for the I/O module outputs. See section 'Inputs' above on how individual output numbers correspond to each I/O slot. Each output can be assigned an output function: Level output status, setpoint output status, net mode, good zero, stable weight, flow rate displayed or In process status. All functions needs a second parameter that sets which level, setpoint or scale the output is supposed to work with.

Analog Outputs: This menu controls the behavior of an AOUT4 or an AOUT1 Analog output module. The output signal source (scale no and signal type) can be selected. Also output type and range high/low is settable. The Analog Outputs menu is only shown if there is an AOUT1 or AOUT4 used in the system.

Batching Parameters: This menu is only shown if the batching option is enabled. It contains batching settings for all scales. See the separate 'Scale Batching Program Option' 'Technical Manual Supplement' for details.


Program Options: This menu contains the options that can be used. Program options are enabled using a purchased option code. Contact your supplier for more information.

Graphical touch display

To reach the main menu, press the 'Info' button (when the weight display is shown) on the instrument front panel.

Navigating in a menu is done with arrow keys or by tapping (touching) on the display on specific choices e.g. 'Parameter Set-up'.

To open a sub menu, e.g. Parameter Set-up, select the desired sub menu with arrow keys. The selected sub menu is highlighted. Then press 'Enter' to open the selected sub menu or just tap on the desired sub-menu to open it.

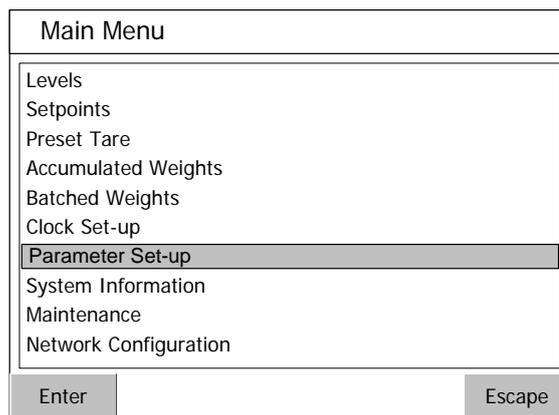


Main menu

Parameter Set-up menu

To enter Parameter Set-up, select this sub menu with up/down arrow keys. The selected sub menu is then highlighted. Press 'Enter' to open the selected sub menu or just tap on the desired sub-menu to open it.

If there isn't room for all parameters on screen, it is possible to scroll through the list with the scroll bar at the right of the screen or by using up/down keys.

Press the 'Esc' key to return to the main menu. The 'Esc' key is always used to cancel editing or moving backwards in the menu structure.

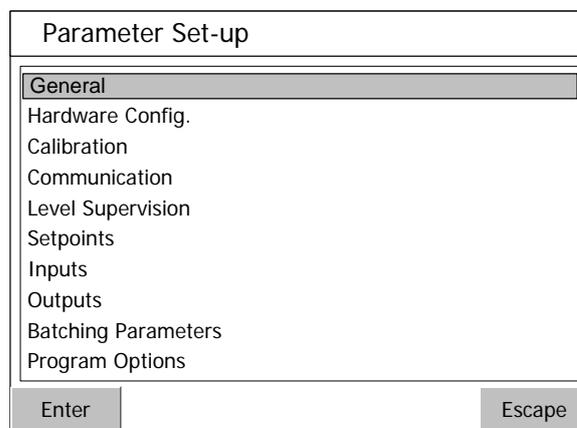

Parameter set-up menu.

Parameter editing

This example shows the 'General' parameter menu but editing is done similar throughout the menu system.

To edit a parameter, select it with the arrow keys to highlight it and then press the 'Enter' key on the screen or on the front panel keyboard. Alternatively tap on the desired parameter on the screen to begin editing.

If all items in the menu don't fit on the screen, it is possible to scroll through the list of parameters using the scroll bar at the right of the screen or by using the up/down keys. Press the 'Esc' key to return to the Parameter set-up menu.

| General | |
|------------------|------------------|
| Language | English |
| Instrument Name | |
| Start Mode | Auto |
| Display Mode | 1 & 2 & 4 Scales |
| Info Line 1 Mode | Batching Status |
| Info Line 2 Mode | Not In Use |
| Date Format | YYYY-MM-DD |
| Time Format | 24 h |
| Gross/Net Key | On |
| Tare Key | On |

General parameters menu

When editing a choice parameter e.g. language as in the figure, a list of available choices is shown on screen with the current selection highlighted. To change the selection the up/down arrow keys can be used. It is also possible to directly make a choice by tapping on the desired selection.

To confirm the new selection press the 'Enter' key.

To abort editing and keep the previous setting, press the 'Esc' key.

Editing a choice parameter. Note that the languages mentioned are examples, not the actual implementation.

When editing a numerical parameter e.g. a level hystereses setting as in the figure, the new value should be typed with the numerical keys.

To confirm the new value press the 'Enter' key.

To abort editing and keep the previous setting, press the 'Esc' key.

Editing a value parameter



Menu structure

| |
|------------------------|
| Main Menu |
| *Levels |
| *Setpoints |
| *Preset Tare |
| *Accumulated Weights |
| *Batched Weights |
| *Clock Set-up |
| *Parameter Set-up |
| *System Information |
| *Maintenance |
| *Network Configuration |


Note that Batching and Flow rate are optional. The respective parameters and menus are only shown when the program option is enabled.

*menu

(Next page)

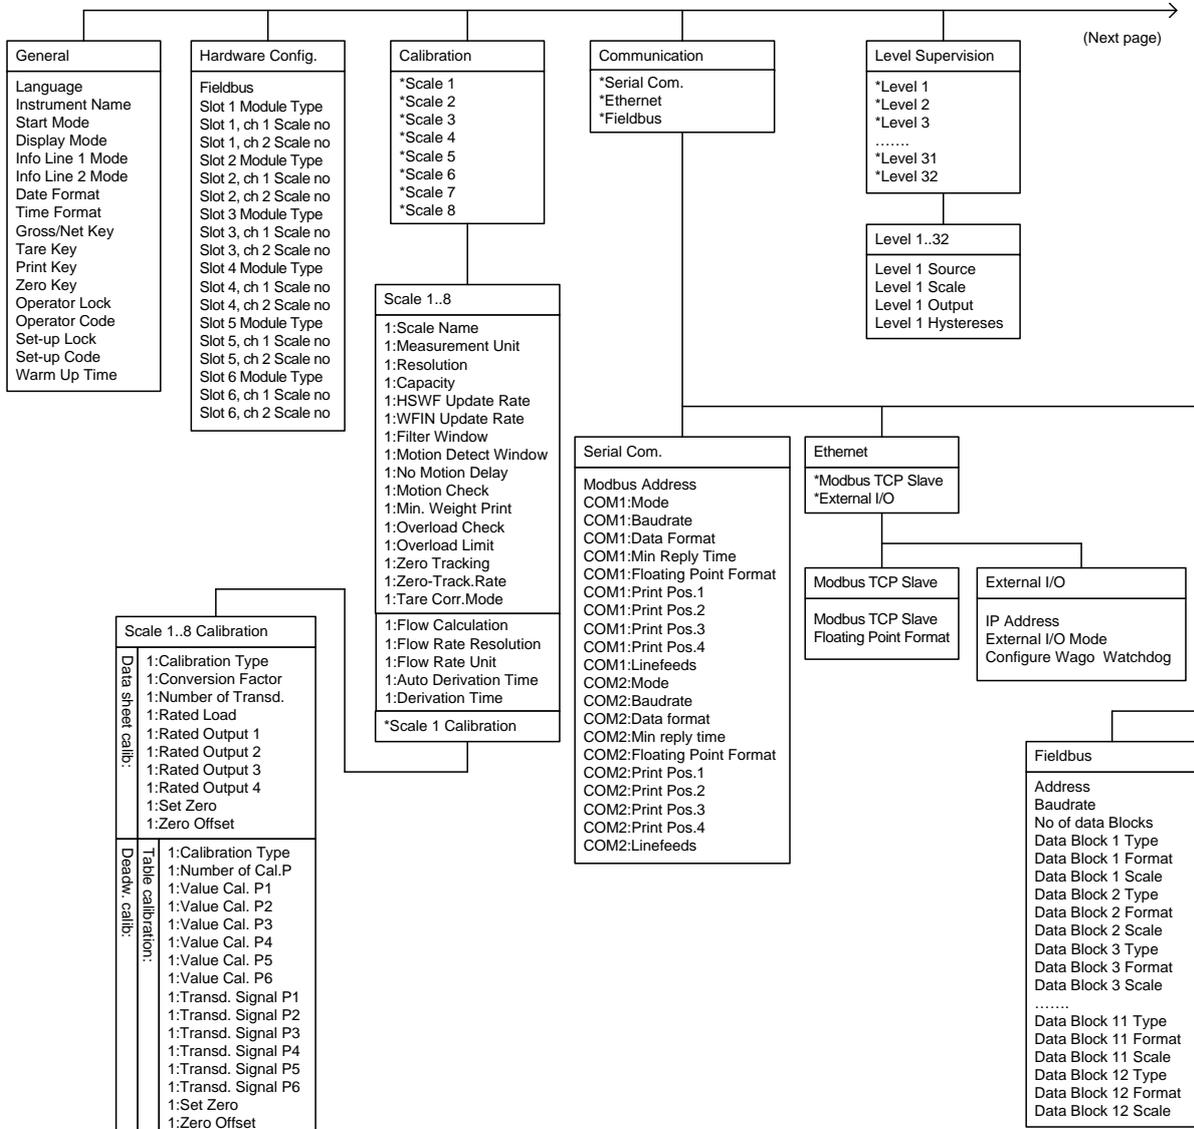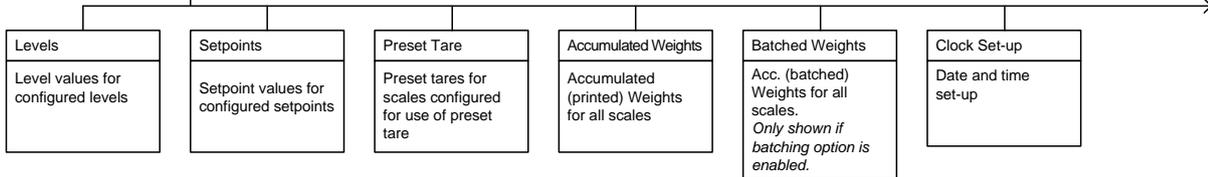


Menu structure (continued)

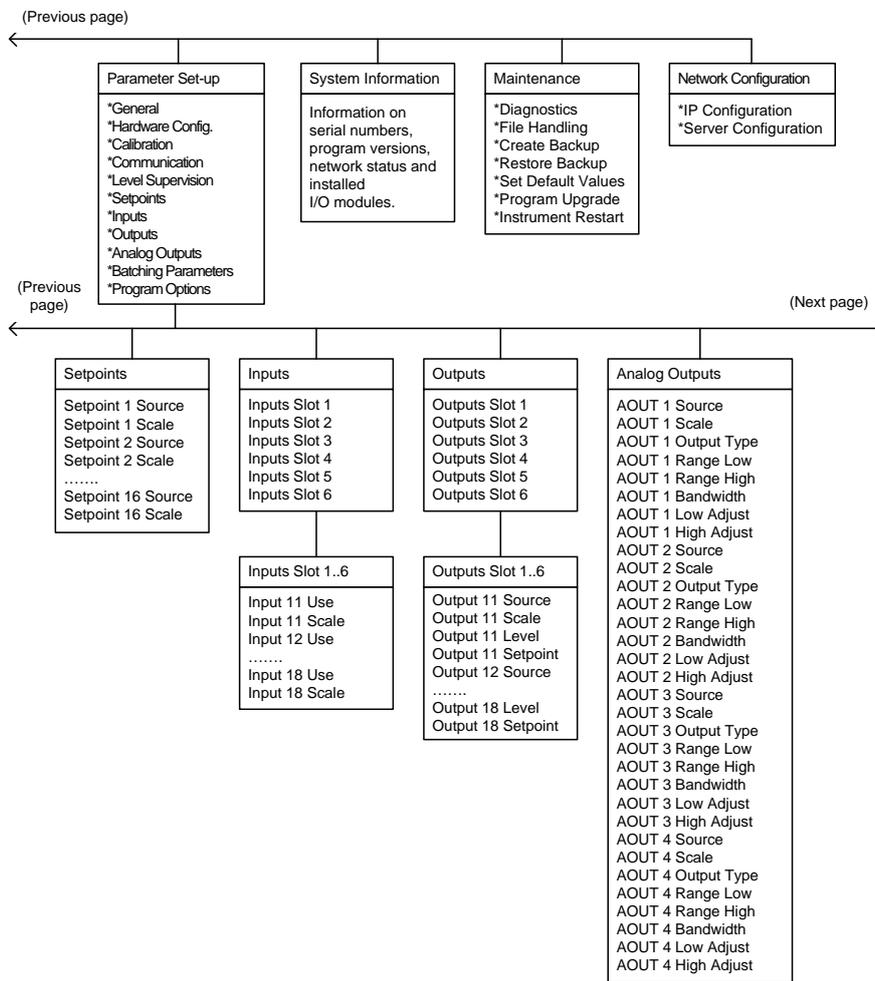

Menu structure (continued)


(Previous page)

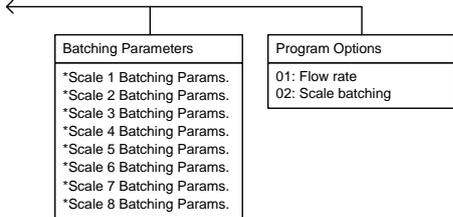

- Scale 1 Batching Params.
- S1:Display no of Batches
 - S1:Display Batch Size
 - S1:Batch Printout
 - S1:File Log
 - S1:Batch End Mode
 - *S1A1:**
 - *S1A2:**
 - *S1A3:**
 - *S1A4:**
 - *S1A5:**
 - *S1A6:**
 - *S1A7:**
 - *S1A8:**
 - *S1A9:**
 - *S1A10:**
 - *S1A11:**
 - *S1A12:**

** Activity name or, if no name entered, Activity Type.

Below is shown the parameter set for each type of batching activity

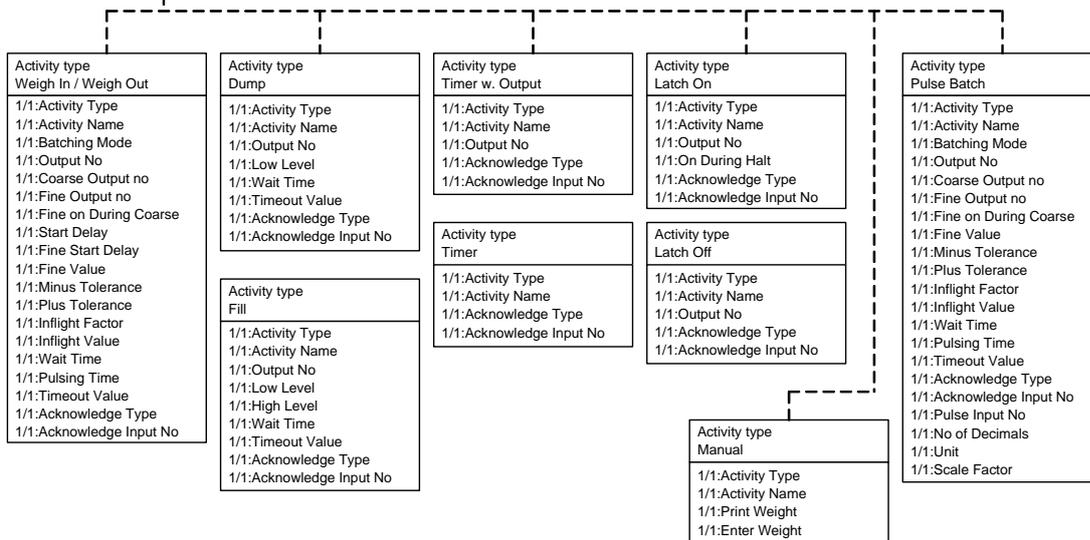

Menu structure (continued)

Parameters

On the following pages a survey of all parameters is presented. The parameters are divided in groups following the menu they belong to. For choice parameters the available choices are given. For numerical parameters, a value range is given.

At the end of the table, the default value is given in < >.

To the right there is a short parameter explanation and, *in italic*, the results for the different alternatives.

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Menu 'General'

Language

| | |
|-----------|--|
| English | Defines the language to be used in menus and messages. |
| Svenska | |
| <English> | |

Instrument Name

| | |
|----|--|
| <> | A 16-character string that is used at printing in reports and so on. |
|----|--|

Start Mode

| | |
|---------|--|
| Command | Defines the start mode after power-on or reset. |
| Auto | Command: A 'start operation' command from control computer or panel key is required for start up. |
| <Auto> | Auto: Automatic start up. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Display Mode

| | |
|---------------------|--|
| 1 Scale | Defines the different weight display screens that can be displayed on the graphical display. |
| 2 Scales | |
| 4 Scales | 1 Scale: Only the 1 Scale display is shown. Operator can select which scale to display. |
| 1 & 2 Scales | |
| 1 & 4 Scales | 2 Scales: Only the 2 Scales display is shown. Operator can select which scales (consecutive) to display. |
| 2 & 4 Scales | |
| 1 & 2 & 4 Scales | 4 Scales: Only the 4 Scales display is shown. Operator can select which scales (consecutive) to display. |
| <1 & 2 & 4 Scales > | 1 & 2 Scales: The operator can select between 1 and 2 Scales screens. Operator can select also which scale(s) to display. 1 & 4 Scales: The operator can select between 1 and 4 Scales screens. Operator can select also which scale(s) to display. 2 & 4 Scales: The operator can select between 2 and 4 Scales screens. Operator can select also which scale(s) to display. 1 & 2 & 4 Scales: The operator can select between all three different weight display screens. Operator can select also which scale(s) to display. |

Info Line 1 Mode

| | |
|---------------------|---|
| Not in use | Defines the mode of the first information line on the 1 scale screen on the graphical display. |
| Acc. Weight | Not in use: Info line 1 is not used. |
| Preset Tare | |
| Scale Name | Acc. Weight: The accumulated weight for the shown scale is presented on the first info. line. |
| Batching Status | |
| < Batching Status > | Preset Tare: The preset tare of the shown scale is presented on the first info. line. Scale Name: The text entered in parameter Scale Name under Scale x Parameters menu of the shown scale is presented on the first info. line. Batching Status: The batching status for the shown scale is presented on the first info. line. |

Info Line 2 Mode

| | |
|-----------------|---|
| Not in use | Defines the mode of the second information line on the 1 scale screen on the graphical display. |
| Acc. Weight | |
| Preset Tare | See parameter 'Info Line 1 Mode' for details |
| Scale Name | |
| Batching Status | |
| < Not in use > | |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
| Date Format | |
| YYYY-MM-DD | Defines the date format. |
| YYYY-DD-MM | YYYY: = year. MM: = month. DD: = day. |
| DD-MM-YYYY | |
| MM/DD/YYYY | |
| <YYYY-MM-DD> | |
| Time Format | |
| 12 h | Defines the time format. |
| 24 h | 12 h: 12 hour time format. |
| <24h> | 24 h: 24 hour time format. |
| Gross/Net key | |
| Off | Disables/enables front panel key Gross/Net |
| On | Off: The Gross/Net key is disabled. |
| <On> | On: The Gross/Net key is enabled |
| Tare key | |
| Off | Disables/enables front panel key Tare |
| On | Off: The Tare key is disabled. |
| <On> | On: The Tare key is enabled. |
| Print key | |
| Off | Disables/enables front panel key Print |
| On | Off: The Print key is disabled. |
| <On> | On: The Print key is enabled. |
| Zero key | |
| Off | Disables/enables front panel key Zero |
| On | Off: The Zero key is disabled. |
| <On> | On: The Zero key is enabled. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|---|
| Operator Lock | |
| Off | Off: Operator lock is not activated. |
| On | On: Operator lock is activated, preventing unauthorized access to the instrument. |
| <Off> | See chapter 'Operation – Security locks'. |
| Operator Code | |
| Range: 1 - 9999 <1937> | Defines the valid code for Operator lock. If 'Set-up lock' (see below) is 'On' this code will not give access to 'Parameter Set-up'. Note: this parameter is only shown if 'Operator Lock' is set to 'On' |
| Set-up Lock | |
| Off | Off: Set-up lock is not activated. |
| On | On: Set-up lock is activated, preventing unauthorized access to the instrument. |
| <Off> | See chapter 'Operation – Security locks'. |
| Set-up Code | |
| Range: 1 - 9999 <1937> | Defines the valid code for Set-up lock. If 'Operator lock' (see above) is 'On' this code will still give access to all menus in the Main menu. Note: this parameter is only shown if 'Set-up Lock' is set to 'On' |
| Warm Up Time | |
| Range: 0 - 200 Unit: min <0> | Defines the delay time in minutes from power up until the weight presentation has full accuracy. Indicated in the display with the text 'Warming up!'. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Menu 'Hardware config.'

Fieldbus

| | |
|--------------|--|
| Not In Use | This parameter defines what type of fieldbus that will be used in the CPU. |
| Profibus | |
| DeviceNet | |
| <Not In Use> | <p>Not In Use: The fieldbus is not used regardless of any installed module.</p> <p>Profibus: A Profibus type of fieldbus module is used.</p> <p>DeviceNet: A DeviceNet type of fieldbus module is used.</p> |

Slot 1 Module Type

| | |
|-----------|---|
| No module | This parameter defines what type of I/O-module that will be used in slot 1. |
| HSWF2 | |
| WFIN | |
| WFIN2 | |
| AOUT1 | |
| AOUT4 | |
| DIO8 | |
| <WFIN2> | <p>No module: No module is used in this slot.</p> <p>HSWF2: A 2 channel high speed weight/force module.</p> <p>WFIN: A 1 channel, weight/force measuring module.</p> <p>WFIN2: A 2 channel, weight/force measuring module.</p> <p>AOUT1: A 1 channel analog output module.</p> <p>AOUT4: A 4 channel analog output module.</p> <p>DIO8: A 8/8 digital input/output module.</p> |

Slot 1, ch 1 Scale no

| | |
|------------|---|
| Not in use | This parameter defines which scale (1 – 8) that channel 1 in slot 1 will be connected to. Each scale may only be assigned once. |
| 1 | |
| 2 | |
| 3 | |
| 4 | 1: This slot and channel is assigned to scale no 1. |
| 5 | 2: This slot and channel is assigned to scale no 2. |
| 6 | |
| 7 | 8: This slot and channel is assigned to scale no 8. |
| 8 | Not in use: This slot and channel is not assigned to any scale. |
| <1> | |

Note: this parameter is only shown if 'Slot 1 Module type' is set to 'WFIN', 'WFIN2' or 'HSWF2'.

Slot 1, ch 2 Scale no

| | |
|-----|---|
| <2> | This parameter defines which scale (1 – 8) that channel 2 in slot 1 will be connected to. Each scale may only be assigned once. |
|-----|---|

Note: this parameter is only shown if 'Slot 1 Module type' is set to 'WFIN2' or 'HSWF2'.

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Slot 2 Module Type

< No module > This parameter defines what type of I/O- module is installed in slot 2. See 'Slot 1 Module type' for details on parameter values.

Slot 2, ch 1 Scale no

<Not in use> This parameter defines which scale (1 – 8) that channel 1 in slot 2 will be connected to. Each scale may only be assigned once.
Note: this parameter is only shown if 'Slot 2 Module type' is set to 'WFIN', 'WFIN2' or 'HSWF2'.

Slot 2, ch 2 Scale no

<Not in use> This parameter defines which scale (1 – 8) that channel 2 in slot 2 will be connected to. Each scale may only be assigned once.
Note: this parameter is only shown if 'Slot 2 Module type' is set to 'WFIN2' or 'HSWF2'.

Slot 3 Module Type

< No module > This parameter defines what type of I/O- module is installed in slot 3. See 'Slot 1 Module type' for details on parameter values.

Slot 3, ch 1 Scale no

<Not in use> This parameter defines which scale (1 – 8) that channel 1 in slot 3 will be connected to. Each scale may only be assigned once.
Note: this parameter is only shown if 'Slot 3 Module type' is set to 'WFIN', 'WFIN2' or 'HSWF2'.

Slot 3, ch 2 Scale no

<Not in use> This parameter defines which scale (1 – 8) that channel 2 in slot 3 will be connected to. Each scale may only be assigned once.
Note: this parameter is only shown if 'Slot 3 Module type' is set to 'WFIN2' or 'HSWF2'.

Slot 4 Module Type

< No module > This parameter defines what type of I/O- module is installed in slot 4. See 'Slot 1 Module type' for details on parameter values.

Slot 4, ch 1 Scale no

<Not in use> This parameter defines which scale (1 – 8) that channel 1 in slot 4 will be connected to. Each scale may only be assigned once.
Note: this parameter is only shown if 'Slot 4 Module type' is set to 'WFIN', 'WFIN2' or 'HSWF2'.

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|---|
| Slot 4, ch 2 Scale no | |
| <Not in use> | This parameter defines which scale (1 – 8) that channel 2 in slot 4 will be connected to. Each scale may only be assigned once. Note: this parameter is only shown if 'Slot 4 Module type' is set to 'WFIN2' or 'HSWF2' |
| Slot 5 Module Type | |
| < No module > | This parameter defines what type of I/O- module is installed in slot 5. See 'Slot 1 Module type' for details on parameter values. |
| Slot 5, ch 1 Scale no | |
| <Not in use> | This parameter defines which scale (1 – 8) that channel 1 in slot 5 will be connected to. Each scale may only be assigned once. Note: this parameter is only shown if 'Slot 5 Module type' is set to 'WFIN', 'WFIN2' or 'HSWF2'. |
| Slot 5, ch 2 Scale no | |
| <Not in use> | This parameter defines which scale (1 – 8) that channel 2 in slot 5 will be connected to. Each scale may only be assigned once. Note: this parameter is only shown if 'Slot 5 Module type' is set to 'WFIN2' or 'HSWF2'. |
| Slot 6 Module Type | |
| < No module > | This parameter defines what type of I/O- module is installed in slot 6. See 'Slot 1 Module type' for details on parameter values. |
| Slot 6, ch 1 Scale no | |
| <Not in use> | This parameter defines which scale (1 – 8) that channel 1 in slot 6 will be connected to. Each scale may only be assigned once. Note: this parameter is only shown if 'Slot 6 Module type' is set to 'WFIN', 'WFIN2' or 'HSWF2'. |
| Slot 6, ch 2 Scale no | |
| <Not in use> | This parameter defines which scale (1 – 8) that channel 2 in slot 6 will be connected to. Each scale may only be assigned once. Note: this parameter is only shown if 'Slot 6 Module type' is set to 'WFIN2' or 'HSWF2'. |

| | |
|---------------------------------------|--|
| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|

Menu 'Scale 1'

The Calibration menu contains up to 8 sub menus, one for each installed/used scale. The parameters are the same for all 8 scale menus. Here only scale 1 parameters are shown.

Note that the scale number is shown as a prefix to the parameter name, here '1:'

1:Scale Name

| | |
|----|--|
| <> | A 16-character string that is used at printing in reports and so on. |
|----|--|

1:Measurement Unit

| | |
|--|--|
| NONE g kg t lb oz N daN kN psi kPa MPa bar lbf kgf Nm N/m kN/m PLI l mV/V pls <kg> | Defines the engineering unit that should be used for the measured value and for related set-up parameters. |
|--|--|

1:Resolution

| | |
|--|---|
| 0.001 0.002 0.005 0.01 0.02 0.05 0.1 0.2 0.5 1 2 5 10 20 50 <0.1> | Defines the decimal point position and resolution format for the displayed value. All set-up parameters using the measurement unit will be written with the decimal point position selected in this menu. If the last digits of the weight value are not stable, a more coarse resolution can be selected to get a stable reading. |
|--|---|

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
| 1:Capacity | |
| Range: 0.5 to 999999 | Nominal range of scale. Capacity / Resolution = Number of divisions. |
| Unit: Measurem. unit <500> | |
| 1:HSWF Update Rate | |
| 12.5 Hz | Defines the update rate for the measuring channel belonging to scale 1 if the weight conversion module is of HS WF 2 type. Note: this parameter is only shown if the weight conversion module belonging to scale 1 is of HS WF2 type. |
| 25 Hz | |
| 50 Hz | |
| 100 Hz | |
| 200 Hz | |
| 400 Hz | |
| 800 Hz | |
| <50 Hz> | |
| 1:WFIN Update Rate | |
| 2.3 Hz | Defines the update rate for the measuring channel belonging to scale 1 if the weight conversion module is of WF IN or WF IN2 type. Note: this parameter is only shown if the weight conversion module belonging to scale 1 is of WF IN or WF IN2 type. |
| 4.6 Hz | |
| 9.3 Hz | |
| 19 Hz | |
| 37 Hz | |
| 75 Hz | |
| 150 Hz | |
| 300 Hz | |
| <37 Hz> | |
| 1:Filter Window | |
| Range: 0 to 999999 | The instrument produces unfiltered and filtered weight internally. If the difference between the filtered an unfiltered weight is less than 'Filter window' the filtered weight is used. This parameter value has one decimal more than parameter Resolution, to allow 'Filter window' to be smaller than the resolution. |
| Unit: | |
| Measurem. unit <10 * Resolution> | |
| 1:Motion Detect Window | |
| Range: 0 to 999999 | Motion status is 'on' when the weight value is not stable. It goes off when the weight has been stable for the 'No motion delay time'. Motion condition exists if the weight change during a certain measuring period is greater than the window 'Motion Detect Window'. The measuring period is one conversion time (Update Rate) or at least 200 ms. This parameter value has one decimal more than parameter Resolution, to allow 'Motion detect w.' to be smaller than the resolution. |
| Unit: | |
| Measurem. unit <1 * Resolution> | |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|--|---|
| 1:No Motion Delay | |
| Range: 0 to 10.0 Unit: s <1.0> | Delay in seconds from detection of stable weight until the Motion status goes off. |
| 1:Motion Check | |
| Off On <Off> | Off: Only zero adjustment is inhibited during motion. On: Inhibits zero adjustment, taring, and printing during motion. |
| 1:Min. Weight Print | |
| Range: 0 to 999999 Unit: Measurem. unit <0.0> | Defines the smallest allowed weight value to be printed. 0 gives no restrictions. |
| 1:Overload Check | |
| Off Unipolar Bipolar <Off> | Check of overload is performed according to this set-up. Off: No check is performed. Weight will be reported up to the limits of the AD converter. Unipolar: Overload status will be set if 'Overload limit' is exceeded. Underload status will be set if the gross weight is below minus (-)9 * Resolution. Bipolar: Overload status will be set if Overload limit is exceeded. Underload status will be set if the gross weight is below minus (-) Overload limit. |
| 1:Overload Limit | |
| Range: 0.5 to 999999 Unit: Measurem. unit <Capacity + 9 * Resolution> | Should be set to the max gross weight that the weight indicator is allowed to report. This parameter is always set to default value when changing Resolution or Capacity. If 'Bipolar' overload check is selected the weight will be reported up to the Overload limit and down to the minus (-) Overload limit. Note: this parameter is only shown if parameter '1: Overload Check' is set to 'Unipolar' or 'Bipolar'. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|--|---|
| 1:Zero Tracking | |
| Off On On+AutoZero <Off> | With this parameter automatic zero-tracking can be selected, or a combination of automatic zero-tracking and automatic zero setting. Off: No zero tracking. On: Zero tracking active. On+AutoZero: Zero tracking and auto zeroing active. |
| 1:Zero-Track.Rate | |
| Range: 0 to 1500 Unit: /min <1> | Maximum weight change speed for zero-tracking to be performed. 'Zero-track.rate' must be less than (30 * Resolution). Unit for the Zero-track rate is: Measurem. unit/min, expressed as '/min' to save space. Note: this parameter is only shown if parameter '1: Zero tracking' is set to 'On' or 'On+AutoZero'. |
| 1:Tare Corr.Mode | |
| Auto Preset Auto+Preset <Auto> | The tare value can be calculated in three different ways: Net weight = Gross weight – Tare value Auto: Auto tare value is used. Preset: Tare value is entered through the serial communication or keypad. Auto+preset: Tare value is the sum of the preset tare value and auto tare value. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

1:Flow Calculation

| | |
|-------|---|
| On | Used to turn on and off the flow rate calculations. |
| Off | On: Flow rate calculations are performed. |
| <Off> | Off: Flow rate calculations are not performed. |

Note: the flow rate calculation is a program option and flow rate parameters are only shown if the Flow rate program option code is entered. Also see section 'Program Options' at the end of this chapter.

1:Flow Rate Resolution

| | |
|--------|---|
| 0.001 | Defines the decimal point position and resolution format for the flow rate value. All set-up parameters using the flow rate unit will be written with the decimal point position selected in this menu. If the last digits of the flow rate value are not stable, a more coarse resolution can be selected to get a stable reading. |
| 0.002 | |
| 0.005 | |
| 0.01 | |
| 0.02 | |
| 0.05 | |
| 0.1 | |
| 0.2 | |
| 0.5 | |
| 1 | |
| 2 | Note: this parameter is only shown if parameter '1:Flow calculation' is set to 'On'. |
| 5 | |
| 10 | |
| 20 | |
| 50 | |
| <0.02> | |

1:Flow Rate Unit

| | |
|-------------|---|
| Unit/s | Defines the engineering unit that should be used for the flow rate value and for related set-up parameters. |
| Unit/min | |
| Unit/h | |
| Unit*1000/m | |
| Unit*1000/h | |
| <Unit/s> | |

Unit/s: Measurement unit per second.
Unit/min: Measurement unit per minute.
Unit/h: Measurement unit per hour.
Unit*1000/m: Measurement unit * 1000 per minute.
Unit*1000/h: Measurement unit * 1000 per hour.

If the flow rate unit exceeds 4 characters then it will be represented as "/s", "/min", "/h", "*/mi" or "*/h" in the set-up menus. In the case of "Unit*1000/m" or "Unit*1000/h" then some flow rate units will be preceded by a "k" and some will be converted, for example "kg" to "t".

Note: this parameter is only shown if parameter '1:Flow calculation' is set to 'On'.

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

1:Auto Derivation Time

Off
On

The derivation time can be entered manually or calculated automatically by the instrument.

<On>

Off: *Manual entering of derivation time.*

On: *Automatic calculation of derivation time.*

Note: this parameter is only shown if parameter '1:Flow calculation' is set to 'On'.

1:Derivation Time

Range:
0.10 – 3600.00

Unit: s

The flow rate is the weight change over the latest elapsed "Derivation time" divided by this time.

At calibration the derivation time is always adjusted by the instrument to the nearest possible value (depending on the filter time).

Note: this parameter is only shown if parameter '1:Flow calculation' is set to 'On'.

Note: This parameter is read only if '1:Auto derivation time' is set to 'On'.

| | |
|---------------------------------------|--|
| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|

Menu 'Scale 1 Calibration'

The Scale 1 Calibration menu is found after the last parameter in menu Scale. Here only scale 1 menu is shown. Note that the scale number is shown as a prefix to the parameter name, here '1:'

1:Calibration Type

| | |
|---------------------|---|
| Data Sheet | Defines the type of calibration to be performed. |
| Deadweight Table | A new calibration is initiated as a 'Calibration type' is selected. |
| <Data Sheet> | Data Sheet: <i>Data sheet calibration is easy to use and doesn't demand any reference equipment, except data from the transducer data sheets.</i> Deadweight: <i>Deadweight calibration is normally the most accurate calibration type. It requires known weights to at least 2/3 of the wanted measuring range.</i> Table: <i>Table calibration is used to enter recorded values from a previous calibration into a replacement instrument.</i> |

Data sheet calibration related parameters

1:Conversion Factor

| | |
|------------------------------------|--|
| Range: 0.01 to 100 <9.80665> | Defines the relationship between a measured value expressed in data sheet unit and expressed in the selected measurement unit. |
|------------------------------------|--|

1:Number of Transducers

| | |
|-------------------------|---|
| Range: 1 to 4 <3> | Defines the number of transducers and fixed support points in the scale installation. All transducers must have equal rated load. If the total number is over 4: enter 1 here! |
|-------------------------|---|

1:Rated Load

| | |
|---------------------------------------|--|
| Range: 1 to 999999 | Defines the rated load for one transducer, expressed in the data sheet unit. The value is specified in the transducer data sheet. |
| Unit: Data sheet unit <2000.00> | NOTE! If the data sheet value is 5 kN, the parameter should be set to 5000 (N). If the total number of transducers and fixed supports is over 4: multiply that number with the rated load for one transducer and enter the result here! |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---|--|
| 1:Rated Output 1 | |
| Range: 0 to 9.99999 Unit: mV/V <2.03900> | Defines the rated output signal for transducer 1. The value is specified in the transducer data sheet for transducer 1. If the total number of transducers and fixed supports is over 4: add up all rated output values, divide by the <u>number of transducers</u> , and enter the result here! |
| 1:Rated Output 2 | |
| Range: 0 to 9.99999 Unit: mV/V <2.03900> | Defines the rated output signal for transducer 2. The value is specified in the transducer data sheet for transducer 2. |
| 1:Rated Output 3 | |
| Range: 0 to 9.99999 Unit: mV/V <2.03900> | Defines the rated output signal for transducer 3. The value is specified in the transducer data sheet for transducer 3. |
| 1:Rated Output 4 | |
| Range: 0 to 9.99999 Unit: mV/V <2.03900> | Defines the rated output signal for transducer 4. The value is specified in the transducer data sheet for transducer 4. |
| 1:Set Zero | |
| Range: +/-999999 Unit: Measur. unit <'Live'> | Live weight is displayed at the bottom of the screen. Enter wanted value for the actual load, usually '0', i.e. unloaded scale. NOTE! This parameter should be used for zeroing of the instrument. |
| 1:Zero Offset | |
| Range: +/-999999 Unit: Measur. unit <0> | This menu shows the offset value acquired by zeroing in 'Set zero'. If this parameter is edited, the zeroing will be influenced. |

| | |
|---------------------------------------|--|
| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|

Deadweight calibration related parameters

Used when the scale is calibrated with weights. The instrument automatically reads the corresponding transducer signals.

1:No of Calibration Points

Range: Number of calibration points.
2 to 6
<2>

1:Value Cal. P1

Range: +/-999999 This parameter defines the load on the scale in the
Unit: lowest calibration point, normally 0.
Measurem. unit
<0>

1:Value Cal. P2

Range: +/-999999 This parameter defines the load on the scale in the
Unit: second calibration point.
Measurem. unit
<500>

1:Value Cal. P3

Range: +/-999999 This parameter defines the load on the scale in the third
Unit: calibration point.
Measurem. unit
<0>

1:Value Cal. P4

Range: +/-999999 This parameter defines the load on the scale in the
Unit: fourth calibration point.
Measurem. unit
<0>

1:Value Cal. P5

Range: +/-999999 This parameter defines the load on the scale in the fifth
Unit: calibration point.
Measurem. unit
<0>

1:Value Cal. P6

Range: +/-999999 This parameter defines the load on the scale in the sixth
Unit: calibration point.
Measurem. unit
<0>

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|--|--|
| 1:Transd. Signal P1 | |
| Range: +/-9.99999 Unit: mV/V <0.00000> | In this parameter, the transducer signal in the lowest calibration point is displayed, but the value cannot be edited. |
| 1:Transd. Signal P2 | |
| Range: +/-9.99999 Unit: mV/V <1.66631> | In this parameter, the transducer signal in the second calibration point is displayed, but the value cannot be edited. |
| 1:Transd. Signal P3 | |
| Range: +/-9.99999 Unit: mV/V <2.03900> | In this parameter, the transducer signal in the third calibration point is displayed, but the value cannot be edited. |
| 1:Transd. Signal P4 | |
| Range: +/-9.99999 Unit: mV/V <2.03900> | In this parameter, the transducer signal in the fourth calibration point is displayed, but the value cannot be edited. |
| 1:Transd. Signal P5 | |
| Range: +/-9.99999 Unit: mV/V <2.03900> | In this parameter, the transducer signal in the fifth calibration point is displayed, but the value cannot be edited. |
| 1:Transd. Signal P6 | |
| Range: +/-9.99999 Unit: mV/V <2.03900> | In this parameter, the transducer signal in the sixth calibration point is displayed, but the value cannot be edited. |
| 1:Set Zero | |
| | See '1:Set zero ' under section 'Data sheet calibration related parameters' for explanation of the parameter. |
| 1:Zero Offset | |
| | See '1:Zero offset ' under section 'Data sheet calibration related parameters' for explanation of the parameter. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Table calibration related parameters

Used when the scale is calibrated with recorded values from a previous calibration, normally a deadweight calibration.

1:No of Calibration Points

Range: 2 to 6
Unit: Number of calibration points.
Measurement unit: <2>

1:Value Cal. P1

Range: +/-999999
Unit: In this parameter, enter the recorded value for the load in the first calibration point.
Measurement unit: <0>

1:Value Cal. P2

Range: +/-999999
Unit: In this parameter, enter the recorded value for the load in the second calibration point.
Measurement unit: <500>

1:Value Cal. P3

Range: +/-999999
Unit: In this parameter, enter the recorded value for the load in the third calibration point.
Measurement unit: <0>

1:Value Cal. P4

Range: +/-999999
Unit: In this parameter, enter the recorded value for the load in the fourth calibration point.
Measurement unit: <0>

1:Value Cal. P5

Range: +/-999999
Unit: In this parameter, enter the recorded value for the load in the fifth calibration point.
Measurement unit: <0>

1:Value Cal. P6

Range: +/-999999
Unit: In this parameter, enter the recorded value for the load in the sixth calibration point.
Measurement unit: <0>

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|--|--|
| 1:Transd. Signal P1 | |
| Range: +/-9.99999 Unit: mV/V <0.00000> | In this parameter, enter the recorded value for the transducer signal in the first calibration point. |
| 1:Transd. Signal P2 | |
| Range: +/-9.99999 Unit: mV/V <1.66631> | In this parameter, enter the recorded value for the transducer signal in the second calibration point. |
| 1:Transd. Signal P3 | |
| Range: +/-9.99999 Unit: mV/V <2.03900> | In this parameter, enter the recorded value for the transducer signal in the third calibration point. |
| 1:Transd. Signal P4 | |
| Range: +/-9.99999 Unit: mV/V <2.03900> | In this parameter, enter the recorded value for the transducer signal in the fourth calibration point. |
| 1:Transd. Signal P5 | |
| Range: +/-9.99999 Unit: mV/V <2.03900> | In this parameter, enter the recorded value for the transducer signal in the fifth calibration point. |
| 1:Transd. Signal P6 | |
| Range: +/-9.99999 Unit: mV/V <2.03900> | In this parameter, enter the recorded value for the transducer signal in the sixth calibration point. |
| 1:Set Zero | |
| | See '1:Set zero ' under section 'Data sheet calibration related parameters' for explanation of the parameter. |
| 1:Zero Offset | |
| | See '1:Zero offset ' under section 'Data sheet calibration related parameters' for explanation of the parameter. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Menu 'Serial Com.'

Modbus Address

Range: 1 to 247
<1> Defines the instrument Modbus address.

COM1:Mode

Not in use Defines use of serial port Com 1.
Modbus Slave **Not in use:** *The port is not used.*
Printer **Modbus Slave:** *The port is used for control unit communication.*
<Not in use> **Printer:** *The port is used for a printer.*

COM1:Baudrate

300 Defines the baudrate for the serial communication.
600 The parameter must be set to the baudrate of
1200 the external equipment.
2400 Note: This parameter is not shown if 'Not in use' is selected in
4800 'COM1:Mode'.
9600
19200
38400
57600
115200
<9600>

COM1:Data Format

7-none-2 Defines the bit configuration for the serial communication.
7-even-1 The parameter must be set to the same configuration as for the
7-even-2 external equipment.
7-odd-1 Note: This parameter is not shown if 'Not in use' is selected in
7-odd-2 'COM1:Mode'.
8-none-1
8-none-2
8-even-1
8-odd-1
< 8-none-1 >

COM1:Min Reply Time

Range: 0 to 1000 Adds a delay before the response to a command is sent. Used if
Unit: ms the instrument sends its response to fast for the master.
<0> Note: This parameter is only shown if 'Modbus Slave' is selected
in 'COM1:Mode'.

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

COM1:Floating Point Format

| | |
|-------------------|--|
| Modicon Float | Sets how the Modbus slave should handle floating point values. |
| Float | Modicon Float: <i>Modicon floating point format.</i> |
| < Modicon Float > | Float: <i>IEEE 32 bit floating point format</i> |
| | See chapter 'Communication' for details on floating point values. |
| | Note: This parameter is only shown if 'Modbus Slave' is selected in 'COM1:Mode'. |

COM1:Print Pos. 1

| | |
|--------------------|--|
| Not in use | Specifies the information that should be printed in printer position 1 (upper left field). This parameter controls weight printing but not batching printouts. |
| Display Weight | |
| Preset Tare | |
| Date/Time | |
| Scale Name | |
| Instrument Name | |
| < Display Weight > | <p>Not in use: <i>Printer position 1 is left empty. If both 'COM1:Print Pos. 1' and 'COM1:Print Pos. 2' are set to 'Not in use' the upper line is not printed.</i></p> <p>Display Weight: <i>The displayed weight/flow rate is printed including the text Gross/Net/Flow and the unit.</i></p> <p>Preset Tare: <i>The value of the preset tare is printed.</i></p> <p>Date/Time: <i>The date and time is printed.</i></p> <p>Scale Name: <i>The scale name is printed.</i></p> <p>Instrument Name: <i>The instrument name is printed.</i></p> <p>Note: This parameter is only shown if 'Printer' is selected in 'COM1:Mode'.</p> |

COM1:Print Pos. 2

| | |
|-----------------|--|
| Not in use | Specifies the information that should be printed in printer position 2 (upper right field). This parameter controls weight printing but not batching printouts. |
| Display Weight | |
| Preset Tare | |
| Date/Time | |
| Scale Name | |
| Instrument Name | |
| < Not in use > | <p>Not in use: <i>Printer position 2 is left empty. If both 'COM1:Print Pos. 1' and 'COM1:Print Pos. 2' are set to 'Not in use' the upper line is not printed.</i></p> <p>Display Weight: <i>The displayed weight/flow rate is printed including the text Gross/Net/Flow and the unit.</i></p> <p>Preset Tare: <i>The value of the preset tare is printed.</i></p> <p>Date/Time: <i>The date and time is printed.</i></p> <p>Scale Name: <i>The scale name is printed.</i></p> <p>Instrument Name: <i>The instrument name is printed.</i></p> <p>Note: This parameter is only shown if 'Printer' is selected in 'COM1:Mode'.</p> |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

COM1:Print Pos. 3

| | |
|-----------------|--|
| Not in use | Specifies the information that should be printed in printer position 3 (lower left field). This parameter controls weight printing but not batching printouts. |
| Display Weight | |
| Preset Tare | |
| Date/Time | |
| Scale Name | |
| Instrument Name | |
| < Not in use > | <p>Not in use: Printer position 3 is left empty. If both 'COM1:Print Pos. 3' and 'COM1:Print Pos. 4' are set to 'Not in use' the lower line is not printed.</p> <p>Display Weight: The displayed weight/flow rate is printed including the text Gross/Net/Flow and the unit.</p> <p>Preset Tare: The value of the preset tare is printed.</p> <p>Date/Time: The date and time is printed.</p> <p>Scale Name: The scale name is printed.</p> <p>Instrument Name: The instrument name is printed.</p> <p>Note: This parameter is only shown if 'Printer' is selected in 'COM1:Mode'.</p> |

COM1:Print Pos. 4

| | |
|-----------------|--|
| Not in use | Specifies the information that should be printed in printer position 4 (lower right field). This parameter controls weight printing but not batching printouts. |
| Display Weight | |
| Preset Tare | |
| Date/Time | |
| Scale Name | |
| Instrument Name | |
| < Not in use > | <p>Not in use: Printer position 4 is left empty. If both 'COM1:Print Pos. 3' and 'COM1:Print Pos. 4' are set to 'Not in use' the lower line is not printed.</p> <p>Display Weight: The displayed weight/flow rate is printed including the text Gross/Net/Flow and the unit.</p> <p>Preset Tare: The value of the preset tare is printed.</p> <p>Date/Time: The date and time is printed.</p> <p>Scale Name: The scale name is printed.</p> <p>Instrument Name: The instrument name is printed.</p> <p>Note: This parameter is only shown if 'Printer' is selected in 'COM1:Mode'.</p> |

COM1:Linefeeds

| | |
|-----|--|
| 0 | Specifies the number of linefeeds (empty lines) that should be output after each printout. This parameter controls weight printing but not batching printouts. |
| 1 | |
| 2 | |
| 3 | |
| 4 | Note that if all four print positions above are set to 'Not in use' no printout and no linefeeds will be printed. |
| 5 | |
| 6 | Note: This parameter is only shown if 'Printer' is selected in 'COM1:Mode'. |
| 7 | |
| 8 | |
| 9 | |
| 10 | |
| <0> | |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
| COM2:Mode | |
| Not in use | Defines use of serial port Com 2. |
| Modbus Slave | Not in use: <i>The port is not used.</i> |
| Printer | Modbus Slave: <i>The port is used for control unit communication.</i> |
| <Not in use> | Printer: <i>The port is used for a printer.</i> |
| COM2:Baudrate | |
| 300 | Defines the baudrate for the serial communication. |
| 600 | The parameter must be set to the baudrate of |
| 1200 | the external equipment. |
| 2400 | |
| 4800 | Note: This parameter is not shown if 'Not in use' is selected in |
| 9600 | 'COM2:Mode'. |
| 19200 | |
| 38400 | |
| 57600 | |
| 115200 | |
| <9600> | |
| COM2:Data Format | |
| 7-none-2 | Defines the bit configuration for the serial communication. |
| 7-even-1 | The parameter must be set to the same configuration |
| 7-even-2 | as for the external equipment. |
| 7-odd-1 | |
| 7-odd-2 | Note: This parameter is not shown if 'Not in use' is selected in |
| 8-none-1 | 'COM2:Mode'. |
| 8-none-2 | |
| 8-even-1 | |
| 8-odd-1 | |
| < 8-none-1 > | |
| COM2:Min Reply Time | |
| Range: 0 to 1000 | Adds a delay before the response to a Modbus command is |
| Unit: ms | sent. Used if the instrument sends its response to fast for the |
| <0> | Modbus master. |
| | Note: This parameter is only shown if 'Modbus Slave' is selected |
| | in 'COM2:Mode'. |
| COM2:Floating Point Format | |
| Modicon Float | Sets how the Modbus Slave should handle floating point values. |
| Float | Modicon Float: <i>Modicon floating point format.</i> |
| < Modicon Float > | Float: <i>IEEE 32 bit floating point format.</i> |
| | See chapter 'Communication' for details on floating point values. |
| | Note: This parameter is only shown if 'Modbus Slave' is selected |
| | in 'COM2:Mode'. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

COM2:Print Pos. 1

| | |
|--------------------|--|
| Not in use | Specifies the information that should be printed in printer position 1 (upper left field). This parameter controls weight printing but not batching printouts. |
| Display Weight | |
| Preset Tare | |
| Date/Time | |
| Scale Name | |
| Instrument Name | |
| < Display Weight > | <p>Not in use: Printer position 1 is left empty. If both 'COM2:Print Pos. 1' and 'COM2:Print Pos. 2' are set to 'Not in use' the upper line is not printed.</p> <p>Display Weight: The displayed weight/flow rate is printed including the text Gross/Net/Flow and the unit.</p> <p>Preset Tare: The value of the preset tare is printed.</p> <p>Date/Time: The date and time is printed.</p> <p>Scale Name: The scale name is printed.</p> <p>Instrument Name: The instrument name is printed.</p> <p>Note: This parameter is only shown if 'Printer' is selected in 'COM2:Mode'.</p> |

COM2:Print Pos. 2

| | |
|-----------------|--|
| Not in use | Specifies the information that should be printed in printer position 2 (upper right field). This parameter controls weight printing but not batching printouts. |
| Display Weight | |
| Preset Tare | |
| Date/Time | |
| Scale Name | |
| Instrument Name | |
| < Not in use > | <p>Not in use: Printer position 2 is left empty. If both 'COM2:Print Pos. 1' and 'COM2:Print Pos. 2' are set to 'Not in use' the upper line is not printed.</p> <p>Display Weight: The displayed weight/flow rate is printed including the text Gross/Net/Flow and the unit.</p> <p>Preset Tare: The value of the preset tare is printed.</p> <p>Date/Time: The date and time is printed.</p> <p>Scale Name: The scale name is printed.</p> <p>Instrument Name: The instrument name is printed.</p> <p>Note: This parameter is only shown if 'Printer' is selected in 'COM2:Mode'.</p> |

COM2:Print Pos. 3

| | |
|-----------------|--|
| Not in use | Specifies the information that should be printed in printer position 3 (lower left field). This parameter controls weight printing but not batching printouts. |
| Display Weight | |
| Preset Tare | |
| Date/Time | |
| Scale Name | |
| Instrument Name | |
| < Not in use > | <p>Not in use: Printer position 3 is left empty. If both 'COM2:Print Pos. 3' and 'COM2:Print Pos. 4' are set to 'Not in use' the lower line is not printed.</p> <p>Display Weight: The displayed weight/flow rate is printed including the text Gross/Net/Flow and the unit.</p> <p>Preset Tare: The value of the preset tare is printed.</p> <p>Date/Time: The date and time is printed.</p> <p>Scale Name: The scale name is printed.</p> <p>Instrument Name: The instrument name is printed.</p> <p>Note: This parameter is only shown if 'Printer' is selected in 'COM2:Mode'.</p> |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

COM2:Print Pos. 4

Not in use
Display Weight
Preset Tare

Specifies the information that should be printed in printer position 4 (lower right field). This parameter controls weight printing but not batching printouts.

Date/Time

Scale Name

Instrument Name

< Not in use >

Not in use: Printer position 4 is left empty. If both 'COM2:Print Pos. 3' and 'COM2:Print Pos. 4' are set to 'Not in use' the lower line is not printed.

Display Weight: The displayed weight/flow rate is printed including the text Gross/Net/Flow and the unit.

Preset Tare: The value of the preset tare is printed.

Date/Time: The date and time is printed.

Scale Name: The scale name is printed.

Instrument Name: The instrument name is printed.

Note: This parameter is only shown if 'Printer' is selected in 'COM2:Mode'.

COM2:Linefeeds

0

1

2

3

4

5

6

7

8

9

10

<0>

Defines the number of linefeeds (empty lines) that should be output after each printout. This parameter controls weight printing but not batching printouts.

Note that if all four print positions above are set to 'Not in use' no printout and no linefeeds will be printed.

Note: This parameter is only shown if 'Printer' is selected in 'COM2:Mode'.

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Menu 'Modbus TCP Slave'

Modbus TCP Slave

| | |
|-------|---|
| On | Enables/disables the Modbus TCP Slave. |
| Off | On: <i>Modbus TCP Slave enabled.</i> |
| <Off> | Off: <i>Modbus TCP Slave disabled.</i> |

Floating Point Format

| | |
|---|--|
| Modicon Float Float < Modicon Float > | Sets how the Modbus TCP Slave should handle floating point values. Modicon Float: <i>Modicon floating point format.</i> Float: <i>IEEE 32 bit floating point format.</i> |
| | See chapter 'Communication' for details on floating point values. |
| | Note: This parameter is not shown if parameter 'Modbus TCP Slave' is set to 'Off'. |

Menu 'External I/O'

External I/O is used for expanding digital I/O for the Scale Batching Program Option. See the 'Scale Batching Program Option' 'Technical Manual Supplement'. It may be also be used in special programs in which case it will be described in the separate special program description.

Also see chapter 'Communication' section 'External I/O' for more details on the setup and function of the External I/O.

IP Address

| | |
|-----------|--|
| <0.0.0.0> | The IP address of the external I/O system. |
|-----------|--|

External I/O mode

| | |
|-------|---|
| Off | Selects the type of external I/O system. |
| WAGO | Off: <i>I/O system not connected.</i> |
| <Off> | WAGO: <i>A WAGO I/O system is connected.</i> |

Configure Wago Watchdog

| | |
|---------|---|
| No | Sets how the Wago I/O system watchdog shall be handled. |
| Yes | No: <i>Do not configure the watchdog.</i> |
| < Yes > | Yes: <i>Configure and use the watchdog.</i> |

Note: This parameter is only shown if parameter 'External I/O Mode' is set to 'WAGO'.

| | |
|---------------------------------------|--|
| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|

Menu 'Fieldbus'

Note: The Fieldbus menu is not shown if parameter 'Fieldbus' (in Hardware Config menu) is set to 'Not In Use'. See chapter 'Communication – Fieldbus interface' for more details on fieldbus configuration and usage.

Address

Range 1 - 125 Profibus address setting.

< 126 >

Note: This parameter is only shown if parameter 'Fieldbus' (in Hardware Config menu) is set to 'Profibus'.

Address

Range 0 - 63 DeviceNet address setting

< 63 >

Note: This parameter is only shown if parameter 'Fieldbus' (in Hardware Config menu) is set to 'DeviceNet'.

Baudrate

125 kbps

250 kbps

500 kbps

Auto

< Auto >

Sets the baudrate for a DeviceNet type of module. Must be selected to suite the master.

125 kbps: Fixed baudrate 125 kbits/s.

250 kbps: Fixed baudrate 250 kbits/s.

500 kbps: Fixed baudrate 500 kbits/s.

Auto: Auto setting 125 – 500 kbits/s.

Note: This parameter is only shown if parameter 'Fieldbus' (in Hardware Config menu) is set to 'DeviceNet'.

No of Data Blocks

Range 0 - 12

< 0 >

Sets the no of Data Blocks that should be mapped to the memory available from the fieldbus. Each Data Block is configurable.

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Data Block 1 Type

| | |
|------------------|---|
| Not In Use | Sets the data source for Data Block 1. |
| Gross Weight | Not In Use: The memory area corresponding to this data block is not updated. |
| Net Weight | Gross Weight: The gross weight for the selected scale is transmitted in this Data Block. Floating point or Integer format. |
| Disp. Weight | Net Weight: The net weight for the selected scale is transmitted in this Data Block. Floating point or Integer format. |
| Flow Rate | Disp. Weight: The displayed weight (gross or net) for the selected scale is transmitted in this Data Block. Floating point or Integer format. |
| Input Signal | Flow Rate: The Flow Rate for the selected scale is transmitted in this Data Block. Floating point or Integer format. |
| Level Status | Input Signal: The input signal from the transducer (the mV/V signal) for the selected scale is transmitted in this Data Block. Floating point or Integer format. |
| Setp. Status | Level Status: The status of all 32 levels in the instrument is transmitted in this Data Block. Floating-point format. |
| Input Status | Setp. Status: The status of all 16 setpoints in the instrument is transmitted in this Data Block. Floating-point format. |
| Output Status | Input Status: The status of all inputs in the instrument is transmitted in this Data Block. Floating-point format. |
| Inp./Outp Status | Output Status: The status of all outputs in the instrument is transmitted in this Data Block. Floating-point format. |
| Lev./Setp Status | Inp./Outp Status: The status of all inputs and all outputs in the instrument is transmitted in this Data Block. Integer format. |
| AOUT1-4 Value | Lev./Setp Status: The status of all 32 levels and the status of all 16 setpoints in the instrument are transmitted in this Data Block. Integer format. |
| AOUT1-2 Value | AOUT1-4 Value: The values of analog outputs 1 to 4 are transmitted in this Data Block. Floating-point format. |
| AOUT3-4 Value | AOUT1-2 Value: The values of analog outputs 1 and 2 are transmitted in this Data Block. Integer format. |
| < Not In Use > | AOUT3-4 Value: The values of analog outputs 3 and 4 are transmitted in this Data Block. Integer format. |

Note: This parameter is only shown if parameter 'No Of Data Blocks' is set to 1 or greater.

Data Block 1 Format

| | |
|--------------------|--|
| Floating Point | Sets the Data Block 1 Format. |
| Integer | Floating Point: The Data Block data format is floating point. |
| < Floating Point > | Integer: The Data Block format is integer. |

Note: This parameter is only shown if parameter 'No Of Data Blocks' is set to 1 or greater and parameter 'Data Block 1 Type' is set to 'Gross Weight', 'Net Weight', 'Disp. Weight', 'Flow Rate' or 'Input Signal'.

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Data Block 1 Scale

| | |
|-------|---|
| 1 | Selects the source scale for Data Block 1. |
| 2 | <i>1: The Data Block uses data from scale no 1.</i> |
| 3 | <i>2: The Data Block uses data from scale no 2.</i> |
| 4 | |
| 5 | |
| 6 | <i>8: The Data Block uses data from scale no 8.</i> |
| 7 | Note: This parameter is only shown if parameter |
| 8 | 'No Of Data Blocks' is set to 1 or greater and parameter 'Data |
| < 1 > | Block 1 Type' is set to 'Gross Weight', 'Net Weight', 'Disp. Weight', 'Flow Rate' or 'Input Signal'. |

Data Block 2 Type

Sets the data source for Data Block 2.

Note: This parameter is only shown if parameter 'No Of Data Blocks' is set to 2 or greater.

See 'Data Block 1 Type' for an explanation of the parameter.

Data Block 2 Format

Sets the Data Block 2 Format.

Note: This parameter is only shown if parameter 'No Of Data Blocks' is set to 2 or greater.

See 'Data Block 1 Format' for an explanation of the parameter.

Data Block 2 Scale

Selects the source scale for Data Block 2.

Note: This parameter is only shown if parameter 'No Of Data Blocks' is set to 2 or greater.

See 'Data Block 1 Scale' for an explanation of the parameter.

For explanation on parameters for Data Blocks 3 to 12 see 'Data Block 1 Type', 'Data Block 1 Format' and 'Data Block 1 Scale'. Note that the parameters are shown only if 'No Of Data Blocks' is set equal to or greater than the Data Block number.

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Menus 'Level 1' – 'Level 32'

NOTE: There are 32 levels each with the following four parameters described below.

Level 1 Source (- Level 32 Source)

| | |
|------------------|---|
| Not in use | Defines the signal to be supervised by the level. |
| Net Weight | Not in use: <i>The level is not used, any outputs set to work with this level will be off.</i> |
| Gross Weight | Net Weight: <i>The level operates on the net weight.</i> |
| Display Weight | Gross Weight: <i>The level operates on the gross weight</i> |
| Flow Rate | Display Weight: <i>The level operates on gross weight or net weight, even if the flow rate is displayed.</i> |
| Abs.Net Weight | Flow Rate: <i>The level operates on the flow rate.</i> |
| Abs.Gross Weight | Abs.: <i>Stands for Absolute,</i> |
| Abs.Disp.Weight | <i>the level operates on the absolute value of net weight,</i> |
| Abs.Flow Rate | <i>gross weight, displayed weight, or flow rate.</i> |
| < Not in use > | |

Level 1 Scale (- Level 32 Scale)

| | |
|-----|---|
| 1 | Defines which scale that will be supervised by the level. |
| 2 | 1: <i>The level is supervising scale number 1.</i> |
| 3 | 2: <i>The level is supervising scale number 2.</i> |
| 4 | |
| 5 | |
| 6 | |
| 7 | 8: <i>The level is supervising scale number 8.</i> |
| 8 | Note: This parameter is only shown if 'Level 1 Source' is |
| <1> | not set to 'Not in use'. |

Level 1 Output (- Level 32 Output)

| | |
|------------------|--|
| Active Above | This parameter defines the conditions for control of a possible used output. |
| Active Below | |
| < Active Above > | Active Above: <i>The used output is activated as the supervised signal level is above the set level.</i> Active Below: <i>The used output is activated as the supervised signal level is below the set level.</i> |
| | Note: This parameter is only shown if 'Level 1 Source' is not set to 'Not in use'. |

Level 1 Hystereses (- Level 32 Hystereses)

| | |
|---------------------------------|--|
| Range: | Defines the hystereses range for the level. |
| +/-999999 | Positive value gives a hystereses range above the switch level, negative value gives a range below the switch level. |
| Unit: | |
| Measurem. unit or flow unit. | |
| < 0.2 > | Note: This parameter is only shown if 'Level 1 Source' is not set to 'Not in use'. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Menu 'Setpoints'

NOTE: There are 16 setpoints each with the following two parameters described below.

Setpoint 1 Source (- Setpoint 16 Source)

| | |
|------------------|--|
| Not in use | Defines the signal to be supervised by the setpoint. |
| Net Weight | Not in use: The setpoint is not used, any outputs set to work with this setpoint will be off. |
| Gross Weight | Net Weight: The Setpoint operates on the net weight. |
| Display Weight | Gross Weight: The Setpoint operates on the gross weight |
| Flow Rate | Display Weight: The Setpoint operates on gross weight or net weight, even if the flow rate is displayed. |
| Abs.Net Weight | Flow Rate: The Setpoint operates on the flow rate. |
| Abs.Gross Weight | Abs.: Stands for Absolute, the Setpoint operates on the absolute value of net weight, gross weight, displayed weight, or flow rate. |
| Abs.Disp.Weight | |
| Abs.Flow Rate | |
| < Not in use > | |

Setpoint 1 Scale (- Setpoint 16 Scale)

| | |
|-----|---|
| 1 | 1: The setpoint is supervising scale number 1. |
| 2 | 2: The setpoint is supervising scale number 2. |
| 3 | |
| 4 | |
| 5 | 8: The setpoint is supervising scale number 8. |
| 6 | |
| 7 | Note: This parameter is only shown if 'Setpoint 1 Source' is not set to 'Not in use'. |
| 8 | |
| <1> | |

| | |
|---------------------------------------|--|
| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|

Menus 'Inputs Slot 1' - 'Inputs Slot 6'

NOTE: There are six possible sub menus, one for each slot. In each slot sub menu there are up to 8 possible inputs named 11 to 18 for slot 1, 21 to 28 for slot 2 and so on. Each input has the parameters described below. Note that input numbering below only show inputs belonging to slot 1. The 'Inputs Slot X' is only shown if there is a module with inputs selected for slot X. The number of displayed inputs is the number of inputs of the specific module selected in menu 'Hardware Configuration'.

Input 11 Use (- Input 18 Use)

| | |
|---------------------|---|
| Not in use | Defines the use of the internal digital inputs in the instrument. |
| Tare | Not in use: <i>The input is not used.</i> |
| Gross/Net | Tare: <i>Input used for taring command.</i> |
| Gross | Gross/Net: <i>Input used for gross/net toggling.</i> |
| Net | Gross: <i>Input used to switch to gross mode.</i> |
| Zero | Net: <i>Input used to switch to net mode.</i> |
| Flow/Weight | Zero: <i>Input used for zero command.</i> |
| Flow Rate | Flow/Weight: <i>Input used for flow rate/weight toggling.</i> |
| Weight | Flow Rate: <i>Input used to switch to flow rate mode.</i> |
| Print | Weight: <i>Input used to switch to weight mode.</i> |
| Start Batching | Print: <i>Input used for print command.</i> |
| Stop Batching | Start Batching: <i>Input used to start batching.</i> |
| Reset Batching | Stop Batching: <i>Input used to stop batching.</i> |
| Restart Batching | Reset Batching: <i>Input used to terminate a halted batching.</i> |
| Reset B. Alarm | Restart Batching: <i>Input used to continue a halted batching.</i> |
| Skip Activity | Reset B. Alarm: <i>Input used to reset a batching alarm.</i> |
| Finish Batching | Skip Activity: <i>Input used to skip the rest of a halted batching activity.</i> |
| Batch. Activity | Finish Batching: <i>Input used to continue batching until the actual batch is finished.</i> |
| < Batch. Activity > | Batch. Activity: <i>Input used in batching activities for acknowledgment signal or pulse batching.</i> |

The default setting 'Batch Activity' will give the same result, as setting the input to 'Not in use' unless the input is used in batching.

Input 11 Scale (- Input 18 Scale)

| | |
|-----|---|
| 1 | 1: <i>Scale number 1 uses the input.</i> |
| 2 | 2: <i>Scale number 2 uses the input.</i> |
| 3 | |
| 4 | |
| 5 | 8: <i>Scale number 8 uses the input.</i> |
| 6 | Note: this parameter is not shown if parameter |
| 7 | 'Input 11 Source' is 'Not in use' or 'Batch. Activity'. |
| 8 | |
| <1> | |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Menus 'Outputs Slot 1' - 'Outputs Slot 6'

NOTE: There are six possible sub menus, one for each slot. In each slot sub menu there are up to 8 possible outputs named 11 to 18 for slot 1, 21 to 28 for slot 2 and so on. Each output has the parameters described below. Note that output numbering below only show outputs belonging to slot 1. The 'Outputs Slot X' is only shown if there is a module, with outputs, selected for slot X. The number of displayed outputs is the number of outputs of the specific module selected in menu 'Hardware Configuration'.

Output 11 Source (- Output 18 Source)

| | |
|---------------------|--|
| Not in use | Defines the use of the internal digital outputs |
| In Process | in the instrument. |
| Level | Not in use: <i>The output is not used.</i> |
| Setpoint | In Process: <i>Active output means active 'In process'.</i> |
| Net Mode | Level: <i>Output activated by the Level.</i> |
| Good Zero | Setpoint: <i>Output activated by the Setpoint.</i> |
| Stable Weight | Net Mode: <i>Output active in net mode.</i> |
| Flow R.Disp | Good Zero: <i>Output active by 'good zero'.</i> |
| B. in Progress | Stable Weight: <i>Output active by stable weight.</i> |
| Batching Stopped | Flow R.Disp: <i>Output active by flow rate display.</i> |
| Batching Alarm | B. in Progress: <i>Output active as batching is in progress (also when 'halted').</i> |
| Batch. Activity | Batching Stopped: <i>Output active as batching is halted.</i> |
| < Batch. Activity > | Batching Alarm: <i>Output active as a batching alarm is present and has not yet been reset.</i> |
| | Batch. Activity: <i>Output used in a batching activity.</i> |
| | The default setting 'Batch Activity' will give the same result, as setting the 'Output 11 Source' to 'Not in use' unless the output is used in batching. |

Output 11 Scale (- Output 18 Scale)

| | |
|-----|--|
| 1 | 1: <i>Scale number 1 uses the output.</i> |
| 2 | 2: <i>Scale number 2 uses the output.</i> |
| 3 | |
| 4 | |
| 5 | 8: <i>Scale number 8 uses the output.</i> |
| 6 | Note: this parameter is only shown if parameter |
| 7 | 'Output 11 Source' is 'Net mode', 'Good zero', 'Stable Weight' |
| 8 | 'Flow R.disp', 'B. in Progress', 'Batching Stopped' or |
| <1> | 'Batching Alarm'. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Output 11 Level (- Output 18 Level)

| | |
|------|--|
| 1 | 1: Level number 1 uses the output. |
| 2 | 2: Level number 2 uses the output. |
| 3 | 3: Level number 3 uses the output. |
| | |
| 30 | 30: Level number 30 uses the output. |
| 31 | 31: Level number 31 uses the output. |
| 32 | 32: Level number 32 uses the output. |
| <1> | Note: this parameter is only shown if parameter 'Output 11 Source' is 'Level'. |

Output 11 Setpoint (- Output 18 Setpoint)

| | |
|-------|---|
| 1 | 1: Setpoint number 1 uses the output. |
| 2 | 2: Setpoint number 2 uses the output. |
| 3 | 3: Setpoint number 3 uses the output. |
| | |
| 14 | 14: Setpoint number 14 uses the output. |
| 15 | 15: Setpoint number 15 uses the output. |
| 16 | 16: Setpoint number 16 uses the output. |
| < 1 > | Note: this parameter is only shown if parameter 'Output 11 Source' is 'Setpoint'. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Menu 'Analog Outputs'

NOTE: There are 4 possible analog outputs each with the 8 parameters described below. If the selected analog output module is AOUT4 there will be parameters for four analog outputs displayed, if the AOUT1 is selected only the parameters for the first analog output (shown below) will be shown. If no AOUT module at all is selected the menu 'Analog Outputs' will not be shown.

AOUT 1 Source (- AOUT 4 Source)

| | |
|----------------|--|
| Not in use | Defines the value to represent on analog output 1. |
| Gross Weight | Not in use: <i>The analog output is not used.</i> |
| Net Weight | Gross Weight: <i>The output represents gross weight.</i> |
| Disp. Weight | Net Weight: <i>The output represents net weight.</i> |
| Flow Rate | Disp. Weight: <i>The output represents gross or net weight, even if flow rate is displayed.</i> |
| < Not in use > | Flow Rate: <i>The output represents flow rate.</i> |

AOUT 1 Scale (- AOUT 4 Scale)

| | |
|-------|--|
| 1 | 1: <i>Scale number 1 uses this analog output.</i> |
| 2 | 2: <i>Scale number 2 uses this analog output.</i> |
| 3 | |
| 4 | |
| 5 | 8: <i>Scale number 8 uses this analog output.</i> |
| 6 | |
| 7 | Note: this parameter is not shown if parameter |
| 8 | 'AOUT 1 Source' is 'Not in use'. |
| < 1 > | |

AOUT 1 Output Type (- AOUT 4 Output Type)

| | |
|-------------|--|
| +/- 20 mA | Defines the type of signal, used to represent |
| -12 – 20 mA | the weight/flow rate value at this Analog output. |
| 0-20 mA | +/-20mA, -12 - 20mA: <i>bipolar current output.</i> |
| 4-20 mA | 0-20mA, 4-20mA: <i>monopolar current output.</i> |
| +/-10 V | +/-10V: <i>bipolar voltage output.</i> |
| 0-10 V | 0-10V: <i>monopolar voltage output.</i> |
| <4-20 mA> | Note: this parameter is not shown if parameter |
| | 'AOUT 1 Source' is 'Not in use'. |
| | Note that in most cases some over range is available. |
| | +/-20 mA and -12 – 20 mA ranges are limited |
| | at -22 and +22 mA. |
| | 4 -20 mA range is limited at +4 and +22 mA. |
| | 0 -20 mA is limited at 0 and +22 mA. |
| | +/-10 V is limited at -11 and +11V. |
| | 0-10 V is limited at 0 and +11V. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

AOUT 1 Range Low (- AOUT 4 Range Low)

| | |
|---------------------------------------|---|
| Range: +/-999999 | Defines the weight/flow rate value that should give the lowest output (0 V / 0 mA / 4 mA) at this |
| Unit: | Analog output. |
| Measurem. unit or flow unit <0> | Note: this parameter is not shown if parameter 'AOUT 1 Source' is 'Not in use'. |

AOUT 1 Range High (- AOUT 4 Range High)

| | |
|---|---|
| Range: +/-999999 | Defines the weight/flow rate value that should give the highest output (10 V / 20 mA) at this |
| Unit: | Analog output. |
| Measurem. unit or flow unit <500> | Note: this parameter is not shown if parameter 'AOUT 1 Source' is 'Not in use'. |

AOUT 1 Bandwidth (- AOUT 4 Bandwidth)

| | |
|----------|--|
| 1.6 Hz | Sets the analog output bandwidth. |
| 3 Hz | Note: this parameter is not shown if parameter |
| 6 Hz | 'AOUT 1 Source' is 'Not in use'. |
| 12 Hz | |
| 25 Hz | |
| 50 Hz | |
| 100 Hz | |
| <100 Hz> | |

AOUT 1 Low Adjust (- AOUT 4 Low Adjust)

| | |
|--------------------|--|
| Range: +/-2.000 | Gives a possibility to adjust the offset of the analog output. This allows for the reading of an external instrument connected to the analog output to be fine-tuned. Full adjustment range corresponds to approximately +/-2% of maximum analog output. |
| Unit: % <0.000> | The parameter value will be set to zero each time 'AOUT 1 Output Type' is changed. |
| | Note: this parameter is not shown if parameter 'AOUT 1 Source' is 'Not in use'. |

AOUT 1 High Adjust (- AOUT 4 High Adjust)

| | |
|--------------------|---|
| Range: +/-2.000 | Gives a possibility to adjust the gain of the analog output signal. This allows for the reading of an external instrument connected to the analog output to be fine-tuned. Full adjustment range corresponds to approximately +/-2% of maximum analog output. |
| Unit: % <0.000> | The parameter value will be set to zero each time 'AOUT 1 Output Type' is changed. |
| | Note: this parameter is not shown if parameter 'AOUT 1 Source' is 'Not in use'. |

| Range/Alternatives <default value> | Explanation and result of alternatives. |
|---------------------------------------|--|
|---------------------------------------|--|

Menu 'Batching Parameters'

Batching parameters will only be shown if the Scale Batching Program Option is enabled. See the 'Scale Batching Program Option' 'Technical Manual Supplement' for a description of the Batching functionality and parameters.

Menu 'Program Options'

This sub menu shows all available program options. In the standard program described in this manual, Flow Rate calculation and Scale Batching are program options. Program options must be activated with an option code to be functional. The option code can be purchased from your instrument supplier.

01: Flow rate

< - >

The option code necessary to activate the Flow Rate program option always consists of 10 digits.

To temporarily use the program option, enter the string 'Demo' (irrespective of upper/lower case). This will allow to use the option for 14 days e.g. for try out.

Enter a '-' to turn off the program option.

The program option can be used for several short periods but after a total use of 14 days it will be permanently turned off until a valid code is entered.

02: Scale batching

< - >

The option code necessary to activate the Scale Batching program option always consists of 10 digits.

To temporarily use the program option, enter the string 'Demo' (irrespective of upper/lower case). This will allow to use the option for 14 days e.g. for try out.

Enter a '-' to turn off the program option.

The program option can be used for several short periods but after a total use of 14 days it will be permanently turned off until a valid code is entered.

Program options

A program option is a program functionality that must be purchased separately. It is not available until a valid option code is entered. An option code can be purchased at the same time as the instrument or separately at a later occasion. The program option code is directly related to the individual S/N of the CPU module. When ordering an option code it must be defined which CPU S/N it should apply to.

There is a possibility to use a program option for a limited time without an option code. This can be of use e.g. if the user would like to try out a program option, if a CPU is replaced and a new option code has not yet been acquired, etc.

Entering the text 'Demo' as the option code will give the user access to the program option during 14 days. After this period has expired a valid option code must be entered if the program option should be used. It is possible to disable demo mode if it is not used continuously. Entering a '-' instead of option code or 'Demo' will disable the program option. The 14-day period is only counted when demo mode is enabled. If the 14-day period has expired the text 'Demo Expired' is shown which indicates that the demo mode is no longer available.

In the sub menu 'Program Options' are all available program options shown.

In the standard weighing program described in this manual is the Flow rate and Scale Batching available as a program options.

In other standard programs and special program there might be other program options available.

If a program option is enabled in demo mode there will be an indication in the weight display. See below.

| | | | |
|--|--|-----------------------------|-----------------------------|
| *DEMO* | | 2006-09-24 19:07 | |
| 1: Baking powder | | Gross | |
| 103.2 kg | | | |
|  | | | |
| Levels | 4: <input checked="" type="checkbox"/> | 5: <input type="checkbox"/> | 6: <input type="checkbox"/> |
| | | 7: <input type="checkbox"/> | |
| Preset Tare: | ----- | | |
| Batch | ----- | P.Tare | Levels |
| | | | ----- |

Demo mode indication

4. Calibration

General

When measuring with G4 Instrument, the transducer output signal, corresponding to the transducer load, is converted to a weight value. The conversion is controlled by several parameters with values defined during calibration of the instrument.

Some calibration types for the instrument can be performed without any transducers connected.

The G4 Instrument supports three calibration types:

- **Data sheet calibration** - entry of values from transducer data sheet(s).
- **Table calibration** - entry of recorded values from a previous calibration.
- **Deadweight calibration** - storing of measured transducer signals for known weights.

Calibration can only be performed in menu:

'Parameter set-up/Calibration/Scale n.'

A 'Set-up code' may be demanded. Note that the weighing result for the calibrated scale may be temporarily incorrect during calibration.

Calibration starts as one calibration type is selected.

To ensure the best possible weighing results, the mechanical installation must be carried out with great care. Fixed mechanical connections to the scale should be avoided, or made as flexible as possible and perpendicular to the measuring direction. If the scale has several transducers connected in parallel, they must have the same rated load and impedance. If transducers and fixed supports are combined, the load must be evenly distributed on all supports.

It is recommended to start with a data sheet calibration, which is easy to perform and gives a fairly good accuracy so the installation can be tested.

| DATA AND CALIBRATION SHEET | | | | ArtNo: 1130480 |
|--|----------------------------|-------|--|------------------------------|
| LOAD CELL | | KIS-3 | S/N 322471 | |
| RATED LOAD (R.L.) | 10 kN | ! | EXCITATION VOLTAGE, RECOMMENDED 10 V AC OR DC | |
| OVERLOAD, SAFE | 100 % R.L. | ! | EXCITATION VOLTAGE, MAXIMUM 18 V AC OR DC | |
| OVERLOAD, ULTIMATE | 200 % R.L. | ! | INPUT RESISTANCE 350 +/- 3 OHMS INCL. STANDARD CABLE | |
| SIDE LOAD, SAFE | 100 % R.L. | ! | OUTPUT RESISTANCE 350.1 OHMS INCL. STANDARD CABLE | |
| SIDE LOAD, ULTIMATE | 200 % R.L. | ! | TEMPERATURE RANGE -40 TO +80 DEGREES C | |
| ELECTRICAL CONNECTION | SHIELDED 4-CONDUCTOR CABLE | ! | TEMPERATURE EFFECT (-10 TO +50 DEGREES C) | |
| EXCITATION POSITIVE: | RED | ! | | |
| EXCITATION NEGATIVE: | BLACK | ! | ON OUTPUT | 0.001 % OF OUTPUT PER DEG. C |
| SIGNAL POSITIVE: | GREEN | ! | | |
| SIGNAL NEGATIVE: | WHITE | ! | ON ZERO BALANCE | 0.001 % OF R.O. PER DEG. C |
| ----- | | | | |
| RATED OUTPUT (R.O.) (TOLERANCE 0.1 %) | | | 2.0394 mV/V | |
| NONLINEARITY (BEST FIT THROUGH ZERO) | | | +/- 0.010 % R.O. | |
| ZERO BALANCE | | | +0.0 % R.O. | |
| CREEP 5 MINUTES | | | +0.001 % R.O. | |
| CALIBRATION VALUES (TOLERANCE 0.1 %) SHUNT RESISTOR CONNECTED BETWEEN 'EXCITATION NEGATIVE' AND 'SIGNAL NEGATIVE' | | | | |
| 40 KOHMS CORRESPOND TO | | | 9.9111 kN | |
| 80 KOHMS CORRESPOND TO | | | 4.9683 kN | |
| THE VALUES INDICATED FOR OUTPUT VOLTAGE AND CALIBRATION VALUES ARE APPLICABLE AT OPEN CIRCUIT WITHOUT EXTERNAL BALANCING RESISTORS AND WITH A CONNECTING CABLE OF STANDARD LENGTH. | | | | |
| Vishay Nobel AB S-691 27 KARLSKOGA | | | KARLSKOGA 03-04-30 | |

Each transducer from Nobel Weighing Systems is delivered with a detailed data and calibration sheet.

If the weight indicator must be replaced, a table calibration of the replacement unit can be performed, with recorded values from an earlier calibration.

To get the best accuracy, a deadweight calibration with known weights to at least 2/3 of the measuring capacity, should be performed.

All calibration parameters are found in the menus under 'Scale X' and 'Scale X Calibration'. The parameters are described in chapter 'Set-up'.

Note that calibration must be done separately for each scale in the instrument.

Actual gross weight and transducer signal is displayed when in menu 'Scale X' or 'Scale X Calibration'.

Common parameters

For all calibration types, measurement unit and resolution for the weight value, and the capacity for the scale must be specified. These parameters, among others, are found in menu 'Scale X', see chapter 'Set-up'. This section deals only with the calibration parameters.

Measurement unit

This parameter defines the engineering unit used for the weight value.

The same engineering unit will also be used for example in the parameter values 'Resolution', 'Capacity', 'Level', and 'Setpoint'.

Resolution

This parameter defines decimal point position and resolution in weight display.

The decimal point position selected here will be used in setting up, in the displayed weight value and in the weight value sent to a printer or computer.

Resolution is understood to mean the smallest weight change presented.

Capacity

This parameter defines the nominal range of the scale. This is the capacity of the scale and should be set to the maximum weight with which the scale is to be loaded. Even if the scale (transducers) have larger capacity, this value should nevertheless be set so that the weighing vessel does not become over full if the scale is loaded up to this value. This parameter is used to calculate certain default values in the set-up and in checking the maximum zero value (with ZERO key and zero-tracking).

Number of scale divisions

The number of scale divisions (div.) for a scale = 'Capacity' / 'Resolution'.
To get correct and stable weight display, parameter 'Resolution' should be set so that the number of scale divisions with the selected 'Capacity' is less than 6 000 (10 000).

The number of scale divisions is also limited by the performance of the transducers and by how large a portion of the transducer capacity that is actually utilised.

To ensure a stable weight display, the input signal to the instrument should exceed 0.2 μV /scale division.

Example:

- Three transducers, each of 20 000 N (approx. 2 000 kg), are to support a tank which, without contents, weighs 3 500 kg. The amount of material in the tank varies from 0 – 1 000 kg.
- Transducer capacity = 6 118 kg
(3 x 20 000 N / 9.80665).
- Transducer sensitivity = 2.039 mV/V.
- Supply voltage to transducers = 5 V.
- Signal from transducers at full load (6 118 kg) = 10.2 mV
(2.039 mV/V x 5 V).
- Signal change in response to an applied load of 1 000 kg = 1.66 mV
(10.2 mV x 1 000 / 6 118).
- Set 'Capacity' to 1 000 kg.
 1. Set 'Resolution' to 0.1.
Number of scale divisions = 1 000 / 0.1 = 10 000
Signal/scale division = 1.66 mV / 10 000 div. = 0.17 μV /div.
 2. Set 'Resolution' to 0.2.
Number of scale divisions = 1 000 / 0.2 = 5 000
Signal/scale division = 1.66 mV / 5 000 div. = 0.33 μV /div.

It is best to select Case 2, since both the number of scale divisions and signal/div. are on the borderline in Case 1. In some special cases the resolution may obviously be driven higher, but the transducer characteristics must always be observed.

Data sheet calibration

Data sheet calibration is recommended as first-time calibration for a new installation. In data sheet calibration, values from the transducer data sheets are entered as parameter values, the scale need not be loaded and an accuracy of 0.1 % can be obtained. The accuracy of the G4 Instrument itself is 0.005 % (1-2 years calibration period). It is essential that no external forces influence the scale installation. If fixed support points are included in the scale, the load must be evenly distributed on transducers and fixed supports.

Conversion factor

In transducer data sheets, loads are normally not expressed in the measurement unit, selected for the scale. This parameter defines a constant by which a weight value, expressed in the measurement unit, should be multiplied to be expressed in the data sheet unit.

When using a transducer, calibrated in Newton, in a scale displaying weight values in kg, the 'Conv. factor' shall be the local gravitation constant in m/s^2 .

The default value, 9.80665, is an international mean value for the gravitation constant (world-wide range 9.78 – 9.83).

If the data sheet unit is the same as the measurement unit, the conversion factor parameter should be set to 1.0000.

Number of transducers

In weighing applications the load on the scale may be supported by several transducers or fixed supports. This parameter defines the total number of transducers and fixed supports in the scale, up to maximum 4.

If the scale has more than 4 support points, this parameter should be set to '1' and the parameter value for 'Rated load' and 'Rated output' must be calculated.

Rated load

Rated load for a transducer is indicated in the data sheet and should be entered as a parameter value, expressed in the unit of the data sheet.

NOTE! If the data sheet value is 5 kN, this parameter should be set to 5000 (N).

If several transducers are used in a scale, they must all have the same rated load.

If the scale has more than 4 support points, 'Number of transd' should be set to '1' and the value of this parameter should be calculated as:

rated load for one transducer, multiplied by the total number of support points.

Rated Output 1 (2, 3, 4)

Rated output is given in the data sheet for every transducer. Parameters will be available for the number of support points specified in 'Number of transd'.

For fixed support points the rated output value is 0.00000 (mV/V).

If the scale has more than 4 support points, 'Number of transd' should be set to '1' and the parameter value for 'Rated output 1' should be calculated as:

the mean value of rated output for all active transducers.

Set zero

Set zero is useful only when the scale installation is finished. By the digit keys this value can be set to zero, for unloaded scale, or to the weight of the known load, for a scale that is loaded.

Zero offset

For an installed scale this parameter shows the zero offset after zeroing, a value that should not be edited.

For a scale that is not installed it is possible to enter the known weight of fixed equipment on the scale.

Table calibration

Table calibration can be used to copy recorded values from a previous deadweight calibration of the weighing equipment into a replacement instrument. This is performed by entry of recorded weight values and corresponding transducer signal values into the instrument. Calibration can be performed for up to 6 points.

The accuracy of the copying procedure is 0.005 %.

No of Calibration Points

Only parameters for the selected number of calibration points will be displayed in the menu. The number of calibration points can be changed during the calibration.

Value Cal. P1, Value Cal. P2 etc.

These parameters are used for entry of recorded weight values, expressed in the measurement unit, from a previous deadweight calibration.

Transd.Signal P1, Transd.Signal P2 etc.

These parameters are used for entry of recorded transducer signal values for corresponding calibration points.

Set Zero

Set zero is useful only when the scale installation is finished. By the digit keys this value can be set to zero, for unloaded scale, or to the weight of the known load, for a scale that is loaded.

Zero Offset

This parameter is used for entry of the recorded zero offset value from a previous deadweight calibration.

If a zeroing has been performed with parameter 'Set zero' above, the value of parameter 'Zero offset' need not be changed.

Deadweight calibration

This is normally the most accurate calibration type. The transducer signals are measured and automatically stored when the scale is loaded with known weights. Calibration can be performed in up to six calibration points, starting with the lowest, the highest point, or any other order.

Calibration of the lowest point is normally performed with the scale unloaded.

If calibration in two points is used, the second point should be placed as high as possible, the scale should be loaded with at least 2/3 of the 'Capacity'.

By calibration in more than two points, the highest calibration point should be placed at, or higher than, the highest load for which the scale is to be used, and the calibration points should be evenly distributed in the measuring range.

No of Calibration Points

This parameter defines the number of calibration points. Up to six points can be selected, and parameters for load value and transducer signal will be displayed only for the selected number of points.

It is possible to change the number of points during the calibration.

Value Cal. P1,

This parameter defines the load for the lowest calibration point. Normally the scale should be unloaded and the parameter value set to 0 (zero). This weight value and the corresponding transducer signal value are automatically stored in the instrument.

Value Cal. P2, Value Cal. P3 etc.

The scale should be loaded with known weights. These parameters show the load according to the previous calibration and the parameter values should be changed to the value of the known weights. As a parameter value is stored, the instrument will also store the corresponding transducer signal value for that calibration point.

Transd. Signal P1, Transd. Signal P2 etc.

These parameters contain the automatically stored transducer signal values for the calibration points. The values cannot be edited.

Set Zero

Set zero is useful only when the scale installation is finished. By the digit keys this value can be set to zero, for unloaded scale, or to the weight of the known load, for a scale that is loaded.

Zero Offset

For an installed scale this parameter shows the zero offset after zeroing, a value that should not be edited.

Calibration indication

When a new deadweight calibration is started an asterisk character will be shown at the end of 'Value Cal. P1', 'Value Cal. P2' etc. This indicates that this value is not entered. The asterisk will disappear when the user has entered a value. If the user leaves the calibration menu, i.e. calibration is interrupted, the remaining asterisks will be removed. It will still be possible to continue the calibration later on but without any calibration indications (asterisks).

Note that as long as there are asterisks visible it will not be possible to edit the 'Set Zero' or 'Zero Offset' parameters. First must the deadweight calibration be finished (no asterisks visible) then should the zero be set.

5. Operation

General

G4 instrument with strain gauge transducers is designed mainly for weighing and batching purposes. The measurement values are displayed at the front panel, and can also be transmitted to a master computer/PLC.

The measurement values can also be presented as the output signal from an analog output module.

Some functions in the instrument can be controlled by digital input signals, and digital outputs from the instrument can be used to indicate actual status of instrument, scales, levels and so on. The number of inputs and outputs may be expanded by connection of additional I/O modules.

Power supply

The instrument is powered by 24 VDC or 110/230 VAC and should not be turned off during weekends and over-night. Continuous power supply to electronics and transducers prevents moisture condensation in the units.

Power-up sequence

As the G4 instrument is started it enters the Starting up state.

If any error is detected during power-up, the sequence stops and an error code will be displayed. If the error is not fatal it will be possible to enter the menu system to correct possible set-up errors.

If the detected error is fatal, it will only be possible to select restart unless the error is a database file problem. If the start-up error is a database file error it will be possible to select between deleting the database file, entering program upgrade or restart. Deleting the database or upgrading the program (also upgrading to the present program version) will result in a new database to be created which may make the instrument usable again. Note that settings will be default after creating a new database. If the fatal error persists please contact your supplier.

If no errors are detected, the instrument can enter normal operation (automatic start-up), displaying actual weight values, possibly together with other instrument information.

If 'Manual start-up' is selected, the instrument enters the 'Wait for start' state, displaying a message 'Waiting for start command. Press START to continue!'. When the operator presses the 'START' button on the screen, the instrument will switch over to normal operation unless a warm up time is set and there is still a remaining warm up time. In this case the 'Warming up' message will be displayed. See below.

If a warm up time has been set the message 'Warming up.' will be displayed together with the remaining time. When the warm up time has expired the instrument will switch over to normal operation automatically.

Display alternatives by normal operation

In the weight display it is possible to view weight information from one or more scales. It is also possible to select which scales that shall be displayed on the color touch display. With parameter 'Display modes' it is possible to select what combinations of the three weight display modes that can be selected by the operator. The display modes are single scale display, two scales display and four scales display.


Dedicated keys on the front panel are used to zero and tare the scale, to toggle between gross and net weight display and to print weighing results for the selected scale.

Keys on the front panel like 'ZERO', 'TARE', 'GROSS/NET', 'PRINT' etc. and soft keys (F1 - F5) are mostly dedicated to the selected scale. In general, when the expression 'selected scale' is used in this manual, it means the scale shown on a single scale weight display or the scale marked with a yellow background on a two or four scale operating display.

Note that information displayed varies between the weight display modes and that the information displayed may be different depending on actual settings.

If a name has been entered in parameter 'X:Scale Name' it will be shown instead of the text 'Scale: X' in the weight display. In the example screens below the parameter '1:Scale Name' is set to "Baking powder". Note that the character size may vary depending on the length of the scale name entered. A scale name may be truncated if it doesn't fit in the available space.

If a program option is enabled in demo mode there will be an indication (*DEMO*) in the upper left corner of the weight displays as shown in the one scale screen below.

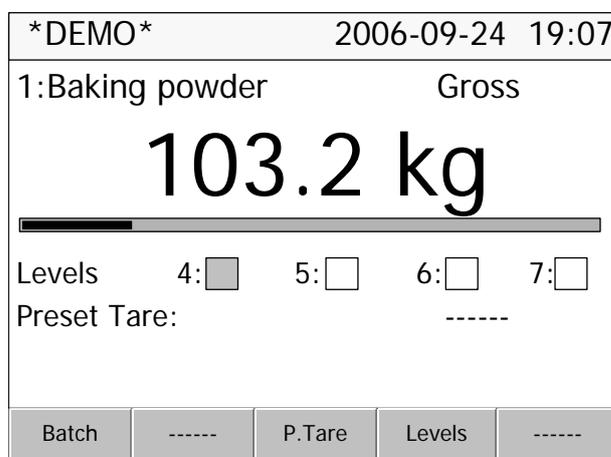

Single scale weight display mode (with demo mode indication).

| | | | | |
|------------------|-------|--------|--------|--------|
| 2006-09-24 19:07 | | | | |
| 1: Baking powder | | Gross | | |
| 103.2 kg | | | | |
| ----- | | | | |
| Scale: 2 | | Net | | Motion |
| 003.4 kg | | | | |
| ----- | | | | |
| Batch | ----- | P.Tare | Levels | ----- |

Two scales weight display mode.

| | | | | |
|------------------|-------|----------|--------|-------|
| 2006-09-24 19:07 | | | | |
| 1: Baking powder | | 102.1 kg | | |
| Gross | Zero | | | |
| Scale: 2 | | 000.0 kg | | |
| Net | Zero | | | |
| Scale: 3 | | 000.0 kg | | |
| Net | Zero | | | |
| Scale: 4 | | 004.9 kg | | |
| Gross | | | | |
| Batch | ----- | P.Tare | Levels | ----- |

Four scales weight display mode.

Using the right/left arrow keys will scroll through the three different weight display modes unless limitations are set with parameter 'Display modes'. To scroll between the available scales the up/down arrows on the instrument front panel are used.

From the weight display it is possible to directly reach functions related to individual scales by pressing one of the soft function keys on the touch display.

These functions are:

P. Tare: Showing and setting the (manual) preset tare for the selected scale.

Levels: Setting the level of the level supervisors for the selected scale. Note that the parameters for the level supervisors, such as scale, source, hystereses range, and so on are accessed through the 'Parameter Set-up' menu.

If the operator lock is on the user is required to enter the operator lock code before any changes of 'P. Tare' or 'Levels' values can be made.

Batch: The F1 key will bring up the Batching display provided that the Scale Batching Program Option is enabled and the selected scale is configured for batching. The key text is only shown if the option is enabled.

Shortcuts

Following commands will take you directly to wanted scale indication.

- **Enter** Takes you directly to single scale weight display with selected scale active
- Entry of **digit 1-8** Selection of scale no corresponding to the digit.

Security locks

In the G4 instrument two security locks are included to prevent unauthorized access to the instrument via the panel keys. The locks can be activated by parameters in menu 'Main menu/Parameter set-up/General'.

The following requires a login password if the corresponding lock is on.

| | |
|--|---------------------------------|
| Changing instrument clock: | Operator lock. |
| Changing Preset Tare: | Operator lock. |
| Changing Levels: | Operator lock. |
| Changing Accumulated Weights | Operator lock. |
| Changing Batched Weights | Operator lock (program option). |
| Changing Batch Data | Operator lock (program option). |
| Changing set-up parameters: | Set-up lock (Operator lock). |
| Entering/using Backup Menu: | Set-up lock (Operator lock). |
| Entering/using Restore Menu: | Set-up lock (Operator lock). |
| Entering/using Default Menu: | Set-up lock (Operator lock). |
| Entering/using Program Upgrade Menu: | Set-up lock (Operator lock). |
| Entering/using File handling Menu: | Set-up lock (Operator lock). |
| Changing Network Config: | Set-up lock (Operator lock). |
| Changing output status in diagnostics: | Set-up lock (Operator lock). |

Entering set-up code gives access also to operator locked functions. If only operator lock is on, the operator code is required where set-up lock is specified above.

Unlocking of "P.Tare" and "Levels" editing from the main picture, is valid until you return to the main picture.

Unlocking of any function under the Main Menu is valid until you leave the Main Menu.

There is also a protection from local and remote users both changing parameters. See chapter 'Remote Access' section 'Remote / Local Access' for more information.

Codes for the security locks

When a security lock is activated the operator must enter a four digit code to get access to the protected area. By default the valid code for both locks is '1 9 3 7', but the locks are not activated.

In menu 'Parameter Set-up', sub menu 'General', parameters are available to activate the locks and to change the default code to any four-digit code.

The code for the Operator lock can only open the Operator lock.

The code for the Set-up lock will open both Set-up lock and Operator lock.

Taring

Taring means storing of a tare value and that the G4 instrument switches over to display of net weight. The net weight being the gross weight minus the tare value. In the instrument two tare values can be stored, Auto tare and Preset tare.

'Auto' tare value is the actual gross weight, stored as tare value when the TARE key is pressed.

'Preset' tare is a tare value that can be entered only if the instrument is set to use Preset tare. The value of Preset tares, for any of the 'configured' scales, can be entered in sub menu 'Preset tare' under the instrument Main menu. Preset tare for the selected (shown) scale can be set in sub menu 'Preset tare' reached with button F3 / 'P. Tare' directly on the operations menu. 'Preset tare' can also be entered from a master unit by communication.

Calibration parameter 'Tare Corr.Mode' defines the use of 'Auto', 'Preset', or the sum 'Auto+Preset' by taring.

- Auto: Only 'Auto tare' is used. 'Preset tare' value cannot be entered or edited.
- Preset: Only 'Preset tare' is used.
- Auto+Preset: The sum of the 'Auto tare' and 'Preset tare' values is used. When the TARE key is pressed, the actual gross weight is stored as Auto tare value and the instrument will display net weight = '– Preset tare'.

With default setting, taring can be performed, even if the weight is not stable. But if parameter 'Motion check' in 'Parameter Set-up / Calibration' for the scale is set to 'On', taring will be allowed only when the weight value is stable.

If Calibration parameter 'Overload Check' is set to 'Unipolar', taring is not allowed at negative gross weight.

Taring example:

A combination of Preset tare and Auto tare is useful in weighing operations when it is inconvenient or impossible to separate a packing and its contents.

- The packing must be weighed to establish a 'known weight' for it.
- Go to menu 'Calibration/Scale 1' for the actual scale (in this example scale 1) and set parameter 'Tare Corr.Mode' to Auto+Preset.
- Go to menu 'Preset tare' by pressing F3 / 'P.Tare' button on the screen. Enter the packing weight as the Preset tare value.
- Press the TARE key when the scale is not loaded, or loaded with permanent help equipment only. The Preset tare value will be displayed as negative net weight.
- Put the packing with contents on the scale.
The weight of the contents will be displayed as net weight.

Gross/Net operation

At normal operation the G4 instrument presents a numerical weight value at the display, either gross weight or net weight. When net weight is displayed the text 'Net' is shown on screen.

Toggling between display of gross weight and net weight can be performed by pressing the GROSS/NET key. Note that toggling is done only for the selected scale in case of more than one scale displayed on screen the selected one is indicated with a yellow background on the display.

Gross weight is continuously shown in form of a graphic bar on one and two scale displays. Maximum length of the bar corresponds to the set Capacity of the scale. Net weight is the difference between gross weight and a tare value. For calculation of net weight, the instrument can use either 'Preset' tare, 'Auto' tare, or the sum of them.

Net weight cannot be displayed if the tare value in use is zero (0).

Zero setting

A basic zero setting of the gross weight is performed as part of the calibration for the scale. If changes to the weighing equipment are made later a renewed calibration, or at least the zero setting of a calibration, should be performed.

Minor correction of the zero value may be needed and can rapidly be performed:


When a gross weight close to zero is displayed, pressing the ZERO key will make the gross weight zero.

Pressing the ZERO key will also set the value of 'Auto tare' to zero.

Zero setting with the ZERO key is permitted only if:

- The weight is stable (the text 'Motion' not shown), and
- The accumulated zero correction since last calibration is between -1 % and +3 % of the 'Capacity', over and above the zero offset obtained when the instrument was calibrated last time.

The text 'Zero' will be shown on the display when the displayed weight is a 'good zero', meaning that the weight deviates from zero with less than one quarter of the set 'Resolution'.

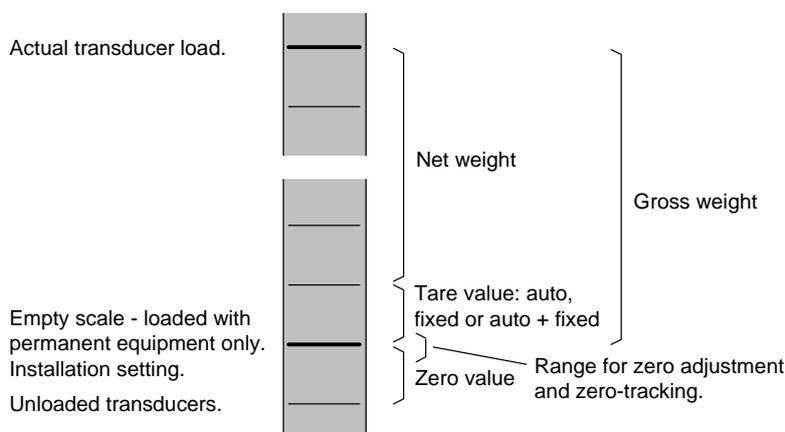

Correlation between gross weight, net weight, and tare value for a scale.

Zero-tracking/Automatic zero setting

In the instrument the functions zero-tracking and automatic zero setting can be enabled. Zero-tracking gives a continuous zero setting by slow changes in zero weight. The automatic zero setting performs zeroing of small negative gross weights. For both functions the following requirements should be met:

- The zero point stays within the permissible range, deviation from calibrated zero less than -1 % to +3 % of Capacity.
- No setpoint function is activated (armed).

Zero-tracking

Zero-tracking is active when, in addition to the common requirements above, the following requirements are met:

- Calibration parameter 'Zero-tracking' is set to On or On+AutoZero.
- The gross weight is 'good zero' (deviation from zero less than one quarter of Resolution).
- The weight is stable (the text Motion not shown).
- The rate of weight change is lower than the 'zero-track.rate', see below.

The set-up parameter 'Zero-track.rate' determines the maximum permissible weight change per minute for the zero-tracking. If parameter 'Resolution' is changed, the value of 'Zero-track rate' will change correspondingly.

Automatic zero setting

Automatic zero setting is active when, in addition to the common requirements above, the following requirements are met:

- Calibration parameter 'Zero-tracking' is set to On+AutoZero.
- The gross weight is negative.
- The actual scale is in gross mode.
- The weight has been stable (the text Motion not shown) for 5 seconds.

Motion

The text 'Motion' may be shown to the right in the display. Motion condition exists if the weight change during a certain measurement period is greater than the window 'Motion Detect Window'. The measuring period is one conversion time ('Update Rate') or at least 200 ms.

After the weight becomes stable, the text 'Motion' will still be shown for a short time, specified in parameter 'No-motion delay', instrument will regard the weight as unstable until the text 'Motion' has disappeared.

When the text 'Motion' is shown, the following activities are affected:

- Zero setting can not be performed.
- Zero-tracking can not be performed.
- Taring can not be obtained (applies if 'Motion check' is 'On').
- Printout of weights is delayed until stable weight is obtained (applies if 'Motion check' is 'On').

Weight printing

General

A printer can be used to print the displayed weight or the displayed flow rate. It can also be used to print batching report if the Scale Batching Program Option is enabled.

The printer must be connected to one of the G4 Instrument serial communication ports and the communication parameters must be correctly set.

For details on printing function and set-up see chapters 'Communication' and 'Set-up'.

Print command

Printing is commanded manually by pushing the print key on the front panel.

Note that pushing the front panel print button will make the displayed value of gross weight, net weight or flow rate for the selected (highlighted) scale to be printed.

There is one communication print command for each scale (1 – 8). For each digital input used as a print command must also the scale number be defined with the corresponding set-up parameter.

Print indication

The print indication text 'Print' is shown where 'Zero' or 'Motion' indications normally appear.

The print indication will appear even if no printer is configured and indicates that the weight is accumulated.

| | | | |
|--|--|-----------------------------|---|
| *DEMO* | | 2006-09-24 19:07 | |
| 1: Baking powder | Gross | Print | |
| 103.2 kg | | | |
| <div style="border: 1px solid black; width: 100%; height: 10px; background-color: black;"></div> | | | |
| Levels | 4: <input checked="" type="checkbox"/> | 5: <input type="checkbox"/> | 6: <input type="checkbox"/> 7: <input type="checkbox"/> |
| Preset Tare: | ----- | | |
| Batch | ----- | P.Tare | Levels ----- |

Print indication

Print restrictions

The displayed weight value (gross or net weight) in the instrument can be printed out on a connected printer, but on certain conditions:

- The displayed weight must be higher than the value of 'Min. Weight Print' in sub menu 'Calibration/Scale X'. No print out will be done if the weight is too low.
- If parameter 'Motion Check' in menu 'Calibration/Scale X' is set to 'On', the displayed value must be stable ('Motion' not shown).
If the weight is not stable ('Motion' shown), printing will be delayed and the text 'Print' will be flashing. When the weight has become stable ('Motion' not shown) printing will be performed.

Weight accumulation

The print button and serial communication printing function is also used to accumulate the displayed weight. See also the description of accumulated weights below under Main menu. Accumulation is done even if no printer is set-up or connected.

Batch report printing


See the separate 'Scale Batching Program Option' 'Technical Manual Supplement' for details regarding batching reports.

Main menu

To reach the main menu, press the 'Info' button on the instrument front panel. Note that the 'Info' button is only functional from the weight display.

Navigating in a menu is done with arrow keys or by tapping on the display on specific choices e.g. 'Parameter set-up'.

To open a sub menu, e.g. Parameter set-up, select the sub menu with arrow keys followed by pressing the 'Enter key', or by tapping on the name.

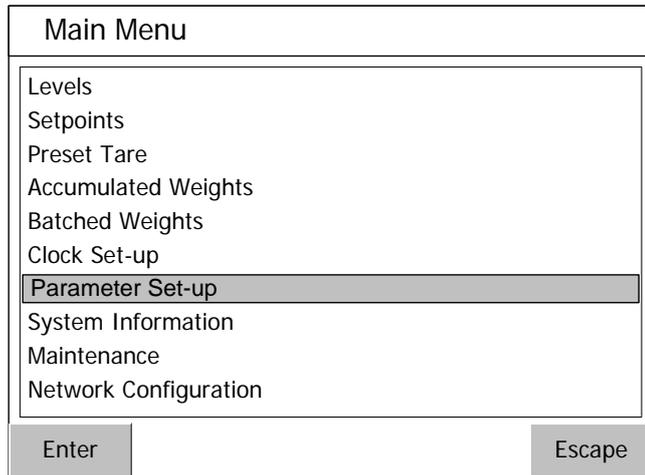

Main menu.

The instrument Main menu can be opened without interrupting the weighing or batching operation.

In the Main menu it is possible to select between the following sub menus:

Levels: Viewing and editing of level value for each configured Level Supervision function. Note that configuration of Level Supervision functionality is done in the 'Parameter Set-up' menu.

Setpoints: Viewing of configured setpoint values. Editing of setpoint value is not possible. Note that configuration of setpoint functionality is done in the 'Parameter Set-up' menu.

Preset Tare: Viewing and editing of preset tares values for scales with tare correction mode set to Preset or Auto + Preset. Set-up of Scale 'Tare Corr. Mode' parameter is done in the 'Parameter Set-up' menu.

Accumulated Weights: This menu shows the accumulated weights for all configured scales. Accumulation of displayed weight (net or gross) takes place when a print command is given either from front panel or via communication. Note that the displayed weight is accumulated.

In the Accumulated Weights menu there is a possibility to zero all values by using the soft key F3 (Zero) or to zero (or edit) one value at a time.

The instrument is capable of storing accumulated weight values up to 10 000 000 000 units with 3 decimals. When the limit is passed 10 000 000 000 will be subtracted from the value.

Batched Weights: Batched Weights are accumulated weights that are automatically calculated when batching. There is one sub menu for each used scale. In each sub menu there is one accumulated value for each used activity (of batching type) and one total i.e. the sum of all activity accumulations. See separate description for 'Scale Batching Program Option' 'Technical manual Supplement'. Note that this menu is only shown if the Scale Batching Program Option is enabled.

In the Batched Weights menu there is a possibility to zero all values, for a scale, by using the soft key F3 (Zero) or to zero (or edit) one value at a time.

The instrument is capable of storing batched weight values up to 10 000 000 000 units with 3 decimals. When the limit is passed 10 000 000 000 will be subtracted from the value.

Clock Set-up: Used to set the instrument clock and date. Time and Date formats are set-up with parameters through 'Parameter set-up' menu.

Parameter Set-up: Access to the G4 instrument parameter set-up menu system. See chapter 'Set-up' for more details on setup.

System Information: Displaying system information for hardware and software in the instrument. Program versions, database version, serial numbers and software versions for all electronic modules can be read here. Info about the Ethernet connection is also available.

Maintenance: Includes a number of functions for maintenance purposes. The available functions are Diagnostics, File Handling, Create Backup, Restore Backup, Set Default Values and Program Upgrade.

See chapter 'Maintenance' for a detailed description of the functions.

Network Configuration: The Network Configuration menu consists of the IP Configuration and the Server Configuration menus. The IP Configuration menu is used to set, manual/auto IP address assignment, IP address etc. The Server Configuration menu is used to enable/disable the FTP Server and the WEB Server of the instrument. In this menu is also the password for the servers set.


Note that Ethernet configuration is not done with set-up parameters and is for that reason not saved with the instrument back-up function.

To return to the weight display press the 'Esc' key on the front panel or the 'Esc' button on screen.

Level supervision

The G4 instrument contains 32 supervision Levels that can be used to supervise defined signals in the instrument. Digital outputs can be connected as outputs for the Levels. For each Level, supervised scale, hystereses and operation mode for the digital output is controlled by set-up parameters.

Functions for Level supervision are defined in menu 'Parameter Set-up' by parameters in the sub menus 'Level Supervision' and 'Outputs'.
See chapter 'Set-up'.

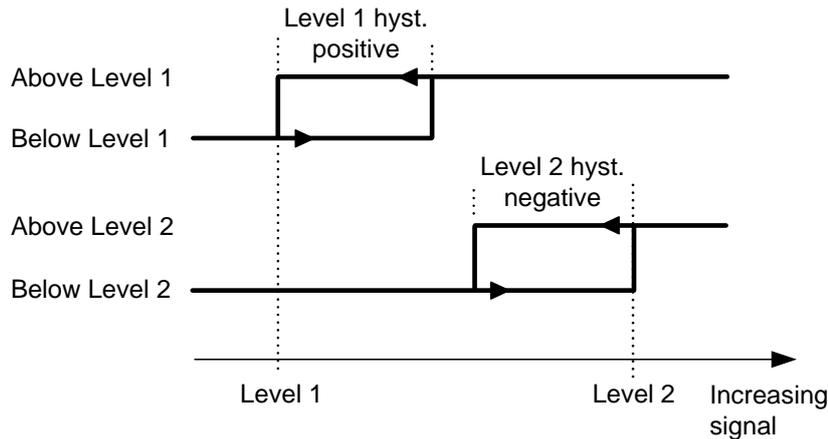

Influence on the level supervision from positive hystereses, for Level 1, and negative hystereses, for Level 2.

'Level X Source'

Set to 'Not in use' will disable level X.

Select 'Net Weight' or 'Gross Weight' to supervise these weight values, independent of which weight that is actually displayed.

Select 'Display Weight' to supervise either gross weight or net weight, depending on which weight that is actually displayed.

'Flow rate' can only be used if the parameter 'Flow Calculation' is activated (On) for a scale in the Parameter Set-up.

Select 'Abs.Net Weight', 'Abs.Gross Weight', 'Abs.Disp.Weight' or 'Abs.Flow Rate' to act on the absolute value of these signals, i.e. the value independent of polarity.

'Level X Scale'

The parameter 'Level X scale' is set to the scale no (1 – 8) that the supervision level shall supervise.

'Level X Output':

Defines how a digital output, if connected to the Level, should operate.

The parameter can be set to make an output active when the signal is above the Level, or when it is below the Level.

'Level X Hystereses':

Defines the width of a hysteresis range for the Level. The definition of a negative hysteresis range starts with a minus sign(-).

Hysteresis is an intentional difference between the switch levels for increasing and decreasing signal level. One switch level is always at the defined Level.

The other switch level is at a higher level by positive hysteresis, at a lower level by negative hysteresis. See figure.

Level status

Actual status of the Levels (input signal above or below Level) can be read via communication and shown at the display (the four first for each scale).

The level status includes the influence from hystereses, but it does not show the status of any digital outputs, connected to the Levels.

Setpoint function

General

The 16 Setpoints can be used for fast, accurate and reliable supervision of weight values. The Setpoint function is of a one shot type, the function is activated by a command from the master computer/PLC and deactivated when the weight has reached the Setpoint value.

The Setpoints can be connected to any digital output in the instrument for flexibility.

The Setpoints can only be controlled by a master computer/PLC via serial communication.

NOTE: To ensure good operation during the time when a setpoint is activated, the zero-tracking function is not working.

Set-up

The selection of the setpoint functions is made in set-up parameters "Setpoint X Source" and "Setpoint X Scale". In these set-ups you can select which scale and what signal (weight value) the setpoint shall act on.

Connection of a setpoint to an output is made in set-up menu "Outputs".

Operation

The wanted setpoints (weight levels) must be loaded into the corresponding Modbus registers.

The setpoint(s) are activated by communication. If a setpoint is connected to an output, then corresponding digital output is activated.

When the selected weight becomes higher than the setpoint the setpoint function is deactivated and the corresponding "Setpoint X cycle done" bit is set. A possible connected digital output is also deactivated at the same time.

The setpoint function, and possible connected digital outputs, can also be deactivated by sending command "Deactivate setpoint X".

NOTE The "Setpoint X cycle done" for a setpoint is reset when the setpoint value is loaded and when the setpoint is activated.

Use of inputs and outputs

Internal I/O's are included on some of the I/O-modules that the G4 instrument can be equipped with. Different module types have different number of inputs and outputs. A DIO8 module have 8 inputs and 8 outputs while the weight conversion modules HS WF2, WF IN and WF IN2 each have 4 inputs and 2 outputs. All input and output functions are controlled by set-up parameters in the instrument.

Digital inputs

The digital inputs can be used for remote operation of the instrument.

Digital outputs

The digital outputs can be used for control of external equipment and for indication of instrument status.

Analog outputs

To produce analog outputs from the G4 instrument, a one channel AOUT1 or a four channel AOUT4 module is used.

The analog output signal will represent a selected signal in the instrument in form of an analog current or voltage signal.

All analog output functions are defined by parameters in sub menu 'Analog outputs', see chapter 'Set-up'.

Filter function

In the instrument the weight value is produced in two forms, unfiltered and filtered. The 'unfiltered' weight is actually also filtered but with a faster filter than the 'filtered' weight value but for simplicity it is called unfiltered.

The unfiltered weight value represents the transducer load with the smallest delay. This means that the instrument will respond rapidly to changing load, but the weight display will be unstable if the load is fluctuating. The filtered weight value will give a smoother weight display, but the response on changing load will be delayed. Weight values are produced within the instrument at the selected 'Update Rate'.

Switching between filtered and unfiltered weight

The instrument automatically switch between unfiltered and filtered weight in order to make the weight display fast when the load on the scale changes, but stable for constant load. The parameter 'Filter window' controls the switching between filtered and unfiltered weight.

The scale will switch to filtered weight when the difference between the filtered weight and unfiltered weight values is smaller than 'Filter window'.

The scale will switch to unfiltered weight if the difference between the filtered weight and unfiltered weight values is larger than 4 times 'Filter window'.

Filter characteristics.

The parameter 'HSWF Update Rate' / 'WFIN Update Rate' selects the update rate and filter characteristics of the weight conversion. The two different types of weight conversion modules have different ranges of settings.

The filter of the G4 Multi Channel Weighing Instrument will very effectively suppress any disturbances at frequencies above the -90 dB frequency.

WF IN / WF IN2 module filter bandwidth

| Update rate | - 3 dB frequency | | - 90 dB frequency | |
|-------------|------------------|------------|-------------------|------------|
| | Filtered | Unfiltered | Filtered | Unfiltered |
| 300 Hz | 14 Hz | 22 Hz | 75 Hz | 150 Hz |
| 150 Hz | 7.6 Hz | 14 Hz | 37 Hz | 75 Hz |
| 75 Hz | 3.9 Hz | 7.6 Hz | 19 Hz | 37 Hz |
| 37 Hz | 2.0 Hz | 3.9 Hz | 9 Hz | 19 Hz |
| 19 Hz | 1.0 Hz | 2.0 Hz | 4.5 Hz | 9 Hz |
| 9.3 Hz | 0.5 Hz | 1.0 Hz | 2.3 Hz | 4.6 Hz |
| 4.6 Hz | 0.25 Hz | 0.5 Hz | 1.2 Hz | 2.3 Hz |
| 2.3 Hz | 0.12 Hz | 0.25 Hz | 0.6 Hz | 1.2 Hz |

HS WF2 module filter bandwidth

| Update rate | - 3 dB frequency | | - 90 dB frequency | |
|-------------|------------------|------------|-------------------|------------|
| | Filtered | Unfiltered | Filtered | Unfiltered |
| 800 Hz | 34 Hz | 48 Hz | 200 Hz | 400 Hz |
| 400 Hz | 19 Hz | 34 Hz | 100 Hz | 200 Hz |
| 200 Hz | 10 Hz | 19 Hz | 50 Hz | 100 Hz |
| 100 Hz | 5.2 Hz | 10 Hz | 25 Hz | 50 Hz |
| 50 Hz | 2.6 Hz | 5.2 Hz | 12 Hz | 25 Hz |
| 25 Hz | 1.3 Hz | 2.6 Hz | 6 Hz | 12 Hz |
| 12.5 Hz | 0.75 Hz | 1.3 Hz | 3 Hz | 6 Hz |

WF IN / WF IN2 Filter rise time

| Update rate | Rise time | |
|-------------|-----------|------------|
| | Filtered | Unfiltered |
| 300 Hz | 0.075 s | 0.04 s |
| 150 Hz | 0.15 s | 0.08 s |
| 75 Hz | 0.30 s | 0.16 s |
| 37 Hz | 0.60 s | 0.32 s |
| 19 Hz | 1.2 s | 0.64 s |
| 9.3 Hz | 2.4 s | 1.3 s |
| 4.6 Hz | 4.7 s | 2.6 s |
| 2.3 Hz | 9.4 s | 5.1 s |

HS WF2 Filter rise time

| Update rate | Rise time | |
|-------------|-----------|------------|
| | Filtered | Unfiltered |
| 800 Hz | 0.028 s | 0.015 s |
| 400 Hz | 0.055 s | 0.030 s |
| 200 Hz | 0.11 s | 0.060 s |
| 100 Hz | 0.22 s | 0.12 s |
| 50 Hz | 0.44 s | 0.24 s |
| 25 Hz | 0.88 s | 0.48 s |
| 12.5 Hz | 1.8 s | 0.96 s |

Rise time is defined as the time from an ideal step input to output reaches 99 % of the input step. Note that in reality no input changes will be an ideal step. Input signals are affected by mechanical time constants and how the weight is applied to the scale.

Flow rate

General

The G4 instrument includes a program option for flow measurement. The option can be activated by an individual code for each instrument. The code can be ordered from your supplier. The program option code should be entered in the 'Program Options' menu. See chapter 'Set-up'.

The flow rate value can be shown on the display, checked by the level supervision, sent to an analog output and it can also be fetched by communication.

Operation

The G4 instrument calculates the flow by measuring the weight change during a selected integration time and dividing by the time.

The flow rate can be displayed as weight change per second, per minute or per hour.

It will display weight or flow value, and switch over between weight and flow is accomplished with the function key 'W/F' or 'F5'.

Switch over can also be accomplished by a digital input or communication command.

Changing and storing

Parameters entered to define flow rate parameters will not be lost if the instrument is switched off.

Parameter editing can be performed in menu 'Param. Set-up/Calibration' where Scale X' is selected, by the panel keys. Note that there are flow rate parameters for each scale in the instrument. Flow calculation is set-up individually for each scale.

Setting of flow rate resolution

Parameter 'Flow rate resolution' defines the decimal point position and resolution for the flow rate value. All set-up parameters using the flow rate unit will be written with the decimal point position selected in this menu. If the last digits of the flow rate value are not stable, a more coarse resolution can be selected to get a stable reading. A more coarse resolution will also result in a shorter derivation time (if 'Auto Derivation Time' is set to 'On').

Setting of flow rate unit

Parameter 'Flow Rate Unit' defines the engineering unit that should be used for the flow rate value and for related set-up parameters.

If the flow rate unit exceeds 4 characters then it will be represented as "/s", "/min", "/h", "*/mi" or "*/h" in the set-up menus.

In the case of "Unit*1000/m" or "Unit*1000/h" then some flow rate units will be preceded by a "k".

Other flow rate units will be converted, according to the table below.

| Measurement unit | Flow rate unit * 1000 |
|------------------|-----------------------|
| kg | t |
| kN | MN |
| kPa | Mpa |
| MPa | GPa |
| l | m ³ |
| kgf | Mgf |
| kN/m | MN/m |
| mV/V | V/V |

Setting of flow rate derivation time

To enable the instrument to make a correct measurement of flow rates, a derivation time must be selected in accordance with the desired accuracy.

If 'Auto Derivation Time' is set to 'On' then the instrument will calculate a derivation time based on the current calibration (including update rate), the 'Flow Rate Resolution' and the 'Flow Rate Unit'. The instrument tries to calculate a derivation time that will give a stable and accurate flow rate value at the current settings (provided that the flow is stable).

A longer filter time and/or a more coarse 'Flow Rate Resolution' will give shorter derivation times. The automatically calculated derivation is limited to its defined max. and min. values.

If 'Auto Derivation Time' is set to 'Off', then the 'Derivation Time' must be entered manually. The instrument will accept any derivation time (within its min. and max. limits) and it is up to the user to select a suitable derivation time for the application. When the scale update rate or the derivation time is changed the derivation time is adjusted, by the instrument, to the nearest possible value depending on the update rate.

Flow rate update time

The flow rate value is updated as shown in the table below. At start-up the accuracy of the flow rate will not gain full precision until after a full derivation time period.

| Number of weight conversions per derivation time period | Flow rate value update interval |
|---|---------------------------------|
| ≤ 100 | Every weight conversion |
| > 100 but ≤ 200 | Every second weight conversion |
| > 200 but ≤ 300 | Every third weight conversion |
| And so on | And so on |

Flow rate value to analog output

The flow rate value can be obtained on a connected analog output. The settings for analog outputs are found in the menu 'Analog outputs' (chapter 'Set-up' in this manual).

Supervision of the flow rate value

It is possible to level supervise the flow rate value and use it in the setpoint function. The settings for level supervision and setpoint functions are found in the menus 'Level 1' to 'Level 32' and 'Setpoints' (chapter 'Set-up' in this manual).

Communication

The flow rate value can be read from a register by using communication. It's also possible to control if flow rate or weight should be shown on the display.

Hints and examples

First of all it is important to have a good weighing application where you use the load cells in a good way to get high resolution and accuracy. It is possible to use long filter time in the instrument to get a higher resolution and accuracy. To get rid of noise it's important to have as high signal from the load cells as possible.

Example:

We assume that you can calibrate the scale to get a stable weight reading with resolution 0.2 kg (use longer filter time if necessary).

The flow rate function measures the weight difference during one derivation time and we assume that we can get a weight error less than one weight division.

- A derivation time of 10 seconds gives a flow rate error of:
 $0.2 / 10 = 0.02 \text{ kg/s (72 kg/h)}$
- A derivation time of 100 seconds gives a flow rate error of:
 $0.2 / 100 = 0.002 \text{ kg/s (7.2 kg/h)}$

In an application where you have a nominal flow rate of 1500 kg/h you will get an error of:

$72 / 1500 = 4.8 \%$ for a derivation time of 10 seconds and

$7.2 / 1500 = 0.48 \%$ for a derivation time of 100 seconds in this example.

If it is possible to calibrate the scale with a better resolution (you still need to have a stable weight) then you can achieve a better flow rate accuracy and/or a shorter derivation time.

NOTE!

The flow rate calculation is not depending on the final selected weight resolution.

6. Communication

General

The G4 Instrument has two serial communication ports, one Ethernet port and an optional fieldbus module.

The serial communication ports can be used for communication with a control unit or for connecting printer(s) to the instrument.

The Ethernet port can be used for communication with a control unit, to connect an external I/O expansion module, and for file transfer to and from an external computer, using ftp (File Transfer Protocol). These functions can be used simultaneously.

The optional fieldbus interface module is used for communication with a control unit.

Serial interface

The instrument is equipped with 2 serial communication ports: COM1, COM2. COM1 is a RS-232 port and COM2 is a RS-485 port

The COM2 serial communication utilises RS-485 for 2-wire or 4-wire. RS-485 is an interface working with differential voltages, giving a noise resistant transmission in a network with several units and long distances. The host computer (master) must have an asynchronous communication port for RS-485, or use a converter for RS-232 to RS-485 conversion or USB to RS-485.

If 2-wire transmission is used, the control unit must be capable of data flow direction control or utilise a converter for automatic data flow direction control. When 4-wire transmission is used, no data flow direction control is needed.

When the RS-232 port is used it's possible to communicate with one instrument directly from a PC with a RS-232 port without using a converter.

Modbus RTU Slave

General

All the G4 units connected to the network can listen to what is transmitted in the network, but only one unit at a time may transmit. A time-sharing principle is needed to allow communication in both directions (half duplex).

All communication in the network must be initiated by the control unit (master). When the instrument is working together with a master the instrument units are all slaves, only allowed to reply to master commands. As the master has addressed a command message to a specific slave unit, it listens for the reply during a specified time, before sending next command message.

If the reply from a slave unit fails it may be due to:

- Mismatch in communication parameters. (baud rate, address, . . .)
- More than one slave unit has been transmitting at the same time.
This can distort the reply message and make it impossible to decode.

See chapter 'Communication – Modbus protocol' section for detailed information of register numbering, register content definition, commands etc.

More information about Modbus RTU can be found at 'www.modbus-ida.com' and many other places.

Setup of Modbus RTU communication

- The instrument will as default be given the address 1. If more than one instrument is used in a network, each G4 instrument must be given a unique address in parameter 'Modbus address' (in 'Parameter set-up', menu 'Communication', sub menu 'Serial Com.').
- Set parameter 'COMx:Mode' to 'Modbus Slave'.
- Select correct baud rate and data format in parameter 'COMx:Baudrate' and 'COMx>Data Format'.
- Select wanted type of float values in parameter 'COMx:Floating Point Format'.
- When longer response times are needed, set 'COMx:Min Reply Time' to a suitable value.

Modbus TCP Slave

General

The Ethernet communication port can be used to communicate with the instrument using the Modbus TCP protocol. The instrument is a Modbus TCP slave and will only respond to incoming messages from a master.

See chapter 'Communication – Modbus protocol' section for detailed information of register numbering, register content definition, commands etc.

More information about Modbus TCP can be found at 'www.modbus-ida.com' and many other places.

Setup of Modbus TCP Slave communication

- Network configuration (IP-address, netmask,...) must be done from menu 'Network Configuration'.
- Enable the Modbus TCP Slave by setting parameter 'Modbus TCP Slave' to 'On' in menu 'Parameter Set-up / Communication / Ethernet / Modbus TCP Slave'.
- Select wanted type of float values in parameter 'Floating Point Format' (also in menu 'Modbus TCP Slave').

External I/O

General

When using the Scale Batching Program Option it is possible to expand the amount of digital I/O by connecting one WAGO_I/O_SYSTEM 750 with up to 128 inputs and 128 outputs. Note that only digital I/O modules may be used with the Scale Batching Program Option.

The I/O system is connected to the G4 CPU module Ethernet port. The external I/O system is intended for the Scale Batching. External I/O may also be used in special programs. See the separate description of the special program. The G4 Instrument and the WAGO I/O system communicate over Ethernet using the Modbus TCP protocol. The G4 CPU module can handle both 10 and 100 Mbit/s networks. It is possible to use switches, hubs etc in the network. Note that the communication performance will be affected by the network speed, network load, scale update rate etc.

There are no settings for the number of I/O installed in the I/O system. The user must make sure that only installed I/O's are used. No error messages will be given for not installed I/O's.

I/O's are automatically numbered from 101 and up. The I/O closest to the Fieldbus coupler will have the lowest numbers. Inserting or removing I/O terminals may rearrange the numbering.

Setup

- Configuration of the G4 Instrument network connection (IP-address, netmask,...) is done from menu 'Network Configuration'.
- Set the IP address and sub net mask of the connected WAGO I/O SYSTEM in the WAGO Fieldbus coupler module. Make sure the address is compatible with the network.
- Enter the selected IP address of the connected WAGO I/O SYSTEM in parameter 'IP Address'. This parameter is found in menu 'Parameter Set-up/Communication/Ethernet/External I/O'.
- Enable the external I/O by setting parameter 'External I/O Mode' to 'WAGO' in menu 'Parameter Set-up/Communication/Ethernet/External I/O'.
- Normally (factory default) is the WAGO fieldbus coupler watchdog configured by the G4 Instrument. By setting parameter 'Configure Wago Watchdog' to 'No' in menu 'Parameter Set-up/Communication/Ethernet/External I/O' the watchdog will not be configured by the G4 Instrument.

Note that incorrect setting of the network parameters may cause disturbances in the network.

Refer to Wago manuals and setup program before installation/configuration of the external I/O system.

Ftp Server

The G4 instrument contains an ftp server that can be used to transfer files between the instrument and an external computer using an ftp client. To connect to the instrument the ftp client must login to the instrument with the user ID 'G4User' and the password '1937' (default password). Note that the password for the ftp server and the web server can be set in the menu 'Server Configuration'. In this menu there are also settings for turning on or off the ftp server and web server. By default both ftp server and web server are turned on.

The ftp handling can be automatic, e.g. to collect log files once every 24 hours or manual.

The ftp client (on an external computer) can access the user area of the instrument flash file system. The user area consists of (by default) the InstrBackup, Misc, Recipes and LogFiles folders.

In the current instrument version the InstrBackup folder is used by default when creating backup files. The LogFiles folder is used for storing Scale batching log files.

Modbus protocol

For communication with a master computer (PLC) the Modbus protocol is used in the instrument. The Modbus protocol is a standard protocol, used for master/slave communication in the industry.

Information is transmitted in blocks of data to minimise polling and response time delays. For example the error register, status register and weight register could be read with one command to the instrument.

When a command that cannot be performed is sent, the instrument responds with an exception code. For a better explanation of the error, a special command error register could be read.

Depending on the type of the communicating equipment (the master), the commands in the application programme (PLC programme, or pc programme) may be different from type to type. However, if the master is not a Modicon PLC system, then the Modbus implementation in the master must have some cross-reference function to transfer the Modbus register and I/O bit numbering to the masters own register and I/O bit numbering. All registers and coils described in this manual use the standard Modbus (Modicon) register and I/O numbering.

See the master's own Modbus driver documentation for how the commands should be activated in the master's application programme.

Most manufacturers of PLC systems and HMI and SCADA software can provide Modbus drivers. Various Modbus drivers for development of Windows programs are also available on the market.

More information about Modbus protocol can be found at 'www.modbus-ida.com' and many other places.

General registers

The G4 instrument has a number of Modicon 'Holding Registers' (registers 4XXXX ...). The Modbus function 03 'Read Holding Registers' should be used to read these registers and the Modbus function 05 'Preset Single Register' or 16 'Preset Multiple Registers' should be used to write to the registers.

See section 'Data representation' for a description of the different data formats used.

Hint: To find out which of the float formats that should be used, read the 'Instrument type' register (44000), which equals '4001' for the instrument.

| Data type: Integer | Data type: float (2 reg./value) | Explanation | R/W |
|-----------------------|------------------------------------|--------------------------------|-----|
| 40001 (1 reg) | 44000 | Instrument type | R |
| 40002 (1 reg) | 44002 | Standard program major version | R |
| 40003 (1 reg) | 44004 | Standard program minor version | R |
| 40004 (1 reg) | 44006 | Special program major version | R |
| 40005 (1 reg) | 44008 | Special program minor version | R |
| 40006 (3 reg) | 44010 | Serial number | R |
| | | | |
| 40030 (1 reg) | 44030 | Command error | R |
| 40031 (1 reg) | 44032 | Instrument state | R |
| 40032 (1 reg) | 44034 | Instrument error | R |
| 40033 (1 reg) | 44036 | Instrument status | R |
| | | | |
| 40034 (1 reg) | 44038 | Scale 1: Error code | R |
| 40035 (1 reg) | 44040 | Scale 1: Status | R |
| 40036 (3 reg) | 44042 | Scale 1: Gross weight | R |
| 40039 (3 reg) | 44044 | Scale 1: Net weight | R |
| 40042 (3 reg) | 44046 | Scale 1: Flow rate | R |
| 40045 (3 reg) | 44048 | Scale 1: Input signal (mV/V) | R |
| | | | |
| 40048 (1 reg) | 44050 | Scale 2: Error code | R |
| 40049 (1 reg) | 44052 | Scale 2: Status | R |
| 40050 (3 reg) | 44054 | Scale 2: Gross weight | R |
| 40053 (3 reg) | 44056 | Scale 2: Net weight | R |
| 40056 (3 reg) | 44058 | Scale 2: Flow rate | R |
| 40059 (3 reg) | 44060 | Scale 2: Input signal (mV/V) | R |
| | | | |

| Data type: Integer | Data type: float (2 reg./value) | Explanation | R/W |
|-------------------------------|--|------------------------------|------------|
| 40062 (1 reg) | 44062 | Scale 3: Error code | R |
| 40063 (1 reg) | 44064 | Scale 3: Status | R |
| 40064 (3 reg) | 44066 | Scale 3: Gross weight | R |
| 40067 (3 reg) | 44068 | Scale 3: Net weight | R |
| 40070 (3 reg) | 44070 | Scale 3: Flow rate | R |
| 40073 (3 reg) | 44072 | Scale 3: Input signal (mV/V) | R |
| | | | |
| 40076 (1 reg) | 44074 | Scale 4: Error code | R |
| 40077 (1 reg) | 44076 | Scale 4: Status | R |
| 40078 (3 reg) | 44078 | Scale 4: Gross weight | R |
| 40081 (3 reg) | 44080 | Scale 4: Net weight | R |
| 40084 (3 reg) | 44082 | Scale 4: Flow rate | R |
| 40087 (3 reg) | 44084 | Scale 4: Input signal (mV/V) | R |
| | | | |
| 40090 (1 reg) | 44086 | Scale 5: Error code | R |
| 40091 (1 reg) | 44088 | Scale 5: Status | R |
| 40092 (3 reg) | 44090 | Scale 5: Gross weight | R |
| 40095 (3 reg) | 44092 | Scale 5: Net weight | R |
| 40098 (3 reg) | 44094 | Scale 5: Flow rate | R |
| 40101 (3 reg) | 44096 | Scale 5: Input signal (mV/V) | R |
| | | | |
| 40104 (1 reg) | 44098 | Scale 6: Error code | R |
| 40105 (1 reg) | 44100 | Scale 6: Status | R |
| 40106 (3 reg) | 44102 | Scale 6: Gross weight | R |
| 40109 (3 reg) | 44104 | Scale 6: Net weight | R |
| 40112 (3 reg) | 44106 | Scale 6: Flow rate | R |
| 40115 (3 reg) | 44108 | Scale 6: Input signal (mV/V) | R |
| | | | |
| 40118 (1 reg) | 44110 | Scale 7: Error code | R |
| 40119 (1 reg) | 44112 | Scale 7: Status | R |
| 40120 (3 reg) | 44114 | Scale 7: Gross weight | R |
| 40123 (3 reg) | 44116 | Scale 7: Net weight | R |
| 40126 (3 reg) | 44118 | Scale 7: Flow rate | R |
| 40129 (3 reg) | 44120 | Scale 7: Input signal (mV/V) | R |

| Data type: Integer | Data type: float (2 reg./value) | Explanation | R/W |
|-----------------------|------------------------------------|------------------------------------|-------|
| | | | |
| 40132 (1 reg) | 44122 | Scale 8: Error code | R |
| 40133 (1 reg) | 44124 | Scale 8: Status | R |
| 40134 (3 reg) | 44126 | Scale 8: Gross weight | R |
| 40137 (3 reg) | 44128 | Scale 8: Net weight | R |
| 40140 (3 reg) | 44130 | Scale 8: Flow rate | R |
| 40143 (3 reg) | 44132 | Scale 8: Input signal (mV/V) | R |
| | | | |
| 40170 (3 reg) | 44150 | Analog output value 1 | R |
| 40173 (3 reg) | 44152 | Analog output value 2 | R |
| 40176 (3 reg) | 44154 | Analog output value 3 | R |
| 40179 (3 reg) | 44156 | Analog output value 4 | R |
| | | | |
| 40182 (1 reg) | 44158 | Status of inputs 11 - 18, 21 - 28 | R |
| 40183 (1 reg) | 44160 | Status of inputs 31 - 38, 41 - 48 | R |
| 40184 (1 reg) | 44162 | Status of inputs 51 - 58, 61 - 68 | R |
| | | | |
| 40185 (1 reg) | 44164 | Status of outputs 11 - 18, 21 - 28 | R |
| 40186 (1 reg) | 44166 | Status of outputs 31 - 38, 41 - 48 | R |
| 40187 (1 reg) | 44168 | Status of outputs 51 - 58, 61 - 68 | R |
| | | | |
| 40188 (1 reg) | 44170 | Level status 1 – 16 | R |
| 40189 (1 reg) | 44172 | Level status 17 – 32 | R |
| | | | |
| 40190 (1 reg) | 44174 | Setpoint status 1 – 8 | R |
| 40191 (1 reg) | 44176 | Setpoint status 9 – 16 | R |
| | | | |
| 40230 (1 reg) | 44200 | Clock: Year | R |
| 40231 (1 reg) | 44202 | Clock: Month | R |
| 40232 (1 reg) | 44204 | Clock: Day | R |
| 40233 (1 reg) | 44206 | Clock: Hour | R |
| 40234 (1 reg) | 44208 | Clock: Minute | R |
| | | | |
| 42000 (1 reg) | 46000 | Command register | R/W * |

| Data type: Integer | Data type: float (2 reg./value) | Explanation | R/W |
|-------------------------------|--|----------------------------|------------|
| | | | |
| 42010 (3 reg) | 46010 | Scale 1: Preset tare value | R/W |
| 42013 (3 reg) | 46012 | Scale 2: Preset tare value | R/W |
| 42016 (3 reg) | 46014 | Scale 3: Preset tare value | R/W |
| 42019 (3 reg) | 46016 | Scale 4: Preset tare value | R/W |
| 42022 (3 reg) | 46018 | Scale 5: Preset tare value | R/W |
| 42025 (3 reg) | 46020 | Scale 6: Preset tare value | R/W |
| 42028 (3 reg) | 46022 | Scale 7: Preset tare value | R/W |
| 42031 (3 reg) | 46024 | Scale 8: Preset tare value | R/W |
| | | | |
| 42034 (3 reg) | 46026 | Level 1 value | R/W |
| 42037 (3 reg) | 46028 | Level 2 value | R/W |
| 42040 (3 reg) | 46030 | Level 3 value | R/W |
| 42043 (3 reg) | 46032 | Level 4 value | R/W |
| 42046 (3 reg) | 46034 | Level 5 value | R/W |
| 42049 (3 reg) | 46036 | Level 6 value | R/W |
| 42052 (3 reg) | 46038 | Level 7 value | R/W |
| 42055 (3 reg) | 46040 | Level 8 value | R/W |
| 42058 (3 reg) | 46042 | Level 9 value | R/W |
| 42061 (3 reg) | 46044 | Level 10 value | R/W |
| 42064 (3 reg) | 46046 | Level 11 value | R/W |
| 42067 (3 reg) | 46048 | Level 12 value | R/W |
| 42070 (3 reg) | 46050 | Level 13 value | R/W |
| 42073 (3 reg) | 46052 | Level 14 value | R/W |
| 42076 (3 reg) | 46054 | Level 15 value | R/W |
| 42079 (3 reg) | 46056 | Level 16 value | R/W |
| 42082 (3 reg) | 46058 | Level 17 value | R/W |
| 42085 (3 reg) | 46060 | Level 18 value | R/W |
| 42088 (3 reg) | 46062 | Level 19 value | R/W |
| 42091 (3 reg) | 46064 | Level 20 value | R/W |
| 42094 (3 reg) | 46066 | Level 21 value | R/W |
| 42097 (3 reg) | 46068 | Level 22 value | R/W |
| 42100 (3 reg) | 46070 | Level 23 value | R/W |
| 42103 (3 reg) | 46072 | Level 24 value | R/W |

| Data type: Integer | Data type: float (2 reg./value) | Explanation | R/W |
|-----------------------|------------------------------------|-------------------|-----|
| 42106 (3 reg) | 46074 | Level 25 value | R/W |
| 42109 (3 reg) | 46076 | Level 26 value | R/W |
| 42112 (3 reg) | 46078 | Level 27 value | R/W |
| 42115 (3 reg) | 46080 | Level 28 value | R/W |
| 42118 (3 reg) | 46082 | Level 29 value | R/W |
| 42121 (3 reg) | 46084 | Level 30 value | R/W |
| 42124 (3 reg) | 46086 | Level 31 value | R/W |
| 42127 (3 reg) | 46088 | Level 32 value | R/W |
| | | | |
| 42130 (3 reg) | 46090 | Setpoint 1 value | R/W |
| 42133 (3 reg) | 46092 | Setpoint 2 value | R/W |
| 42136 (3 reg) | 46094 | Setpoint 3 value | R/W |
| 42139 (3 reg) | 46096 | Setpoint 4 value | R/W |
| 42142 (3 reg) | 46098 | Setpoint 5 value | R/W |
| 42145 (3 reg) | 46100 | Setpoint 6 value | R/W |
| 42148 (3 reg) | 46102 | Setpoint 7 value | R/W |
| 42151 (3 reg) | 46104 | Setpoint 8 value | R/W |
| 42154 (3 reg) | 46106 | Setpoint 9 value | R/W |
| 42157 (3 reg) | 46108 | Setpoint 10 value | R/W |
| 42160 (3 reg) | 46110 | Setpoint 11 value | R/W |
| 42163 (3 reg) | 46112 | Setpoint 12 value | R/W |
| 42166 (3 reg) | 46114 | Setpoint 13 value | R/W |
| 42169 (3 reg) | 46116 | Setpoint 14 value | R/W |
| 42172 (3 reg) | 46118 | Setpoint 15 value | R/W |
| 42175 (3 reg) | 46120 | Setpoint 16 value | R/W |

*/ The read value is always 'zero'.

Important:

'Net weight', 'Gross weight' and 'Flow rate' registers for a scale are only valid when corresponding 'Scale X error code' register equals 0. Therefore it's recommended to read the 'Instrument error' register together with these registers.

Accumulated weight registers

Accumulated weights are updated when a print command is issued. The accumulated values can also be read in the 'Accumulated Weights' menu in the 'Main menu'. In this menu it is also possible to zero or set the values.

There is also a set of registers that contain the Batched Weights, which are accumulated weights automatically calculated during batching. See the separate description 'Scale Batching Option' 'Technical Manual Supplement'.

Data type: Integer

| Explanation | Scale number | | | | | | | | No of reg | R/W |
|-------------|--------------|-------|-------|-------|-------|-------|-------|-------|-----------|-----|
| | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | | |
| LOW | 42250 | 42256 | 42262 | 42268 | 42274 | 42280 | 42286 | 42292 | 3 | R |
| HIGH | 42253 | 42259 | 42265 | 42271 | 42277 | 42283 | 42289 | 42295 | 3 | R |

Data type: Float

| Explanation | Scale number | | | | | | | | No of reg | R/W |
|-------------|--------------|-------|-------|-------|-------|-------|-------|-------|-----------|-----|
| | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | | |
| LOW | 46200 | 46204 | 46208 | 46212 | 46216 | 46220 | 46224 | 46228 | 2 | R |
| HIGH | 46202 | 46206 | 46210 | 46214 | 46218 | 46222 | 46226 | 46230 | 2 | R |

An accumulated weight is represented by two values (HIGH, LOW). To get the resulting value multiply value HIGH by 10000 and add value LOW. LOW is a value between ± 9999.999 with 3 decimals. HIGH is a value without decimals between ± 999999 . To zero accumulated weight, send 0 to both HIGH and LOW.

NOTE! Both HIGH and LOW must be written in ONE Modbus message on order to change the value.

Instrument type

This register holds the type of the instrument. For G4 Multi Channel Weighing Instrument this value is 4001.

Standard program major and minor version

This registers holds the major and minor version for a standard program.

Special program major and minor version

This registers holds the major and minor version for a special program. Both values are 0 for a standard program.

Serial number

This register holds the serial number of the instrument. The value 991000 means 99-1000. This can be used by the master to be sure that an instrument with a specific serial number is used for a special process.

Command error

This register holds the error code when a command has been sent to the instrument. A command that gives a 03 or 07 as exception will have an error code with a better description of the problem in this register. Normally this register should contain '00' which means no error. Error codes 0 to 255 are valid in this register.

Instrument state

This register contains the state of the G4 instrument unit.

| Code | Description |
|------|---|
| 00 | 'Starting up' state. The instrument is starting up after a reset or power on. |
| 01 | 'Wait for start' state. The instrument is waiting for a start command to go in process. |
| 02 | 'Warming up state' The parameter 'Warm up time' is set to a value other than zero, and the instrument is waiting for the warming up time to pass. |
| 03 | 'Normal' state. There are no parameter errors in the system. Note: Weight errors still indicate normal state. |
| 04 | 'Error' state. An error has been detected during start up of the instrument. |
| 05 | 'Fatal error' state. An error has been detected during start up of the instrument. It's not possible to enter any other state from here. |
| 06 | 'Power fail' state. A power fail has been detected and the instrument will respond to communication for a short moment until the power supply reserves are empty (this is normally just a few ms). Weight values should be regarded as invalid. |

Instrument error

This register holds the overall error code for the instrument.
Normally this register should contain '00' which means no error.

Instrument status

This register holds the overall status for the instrument

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Comment |
|--------|------------------|---|
| 0 | Remote operation | '1' = On '0' = Off |
| 1 | Program reset | <p>The bit is set each time the program starts, and it indicates that volatile data is lost.</p> <p>The bit is reset as Instrument status is read, over serial communication (Modbus RTU) or over Ethernet (Modbus TCP), for the first time after reset/power-up. Note that the reply contains the set bit if it was set.</p> <p>Reading Instrument Status via Fieldbus interface will <u>not</u> reset this bit. To reset this bit with fieldbus interface a specific reset command must be used.</p> <p>Care must be taken if more than one interface is used to communicate with the instrument and the Program reset bit is to be used.</p> |
| 2-15 | Not used | |

Note: If this register (bits) is read as float value, see description of Data representation.

Scale X: Error code

This register holds the error code for a scale.

Normally this register should contain '000' which means no error.

Error codes 000 to 255 are valid in this register.

Scale X: Status

Status for a scale.

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Comment |
|--------|--------------------------|--|
| 0 | Net weight > INT size | The net weight in 'scaled integer' format does not fit in one register. (See description of data representation.) |
| 1 | Gross weight > INT size | The gross weight in 'scaled integer' format does not fit in one register. (See description of data representation.) |
| 2 | Flow rate > INT size | The flow rate in 'scaled integer' format does not fit in one register. (See description of data representation.) |
| 3 | Good zero (disp. weight) | |
| 4 | Good zero Gross | |
| 5 | Good zero Net | |
| 6 | Net Mode | '1' = Net mode '0' = Gross mode |
| 7 | Motion | Unstable weight |
| 8 | | |
| 9 | | |
| 10 | | |
| 11 | Flow rate display | Flow rate is shown in the display. |
| 12 | Net weight > 6 digits | The net weight value is out of precision and should normally not be used. |
| 13 | Gross weight > 6 digits | The gross weight value is out of precision and should normally not be used. |
| 14 | | |
| 15 | | |

Note: If this register (bits) is read as float value, see description of Data representation.

Scale X: Gross weight

This register holds the gross weight for a scale. The weight should **not** be read alone because the status and error codes are stored in other registers. The weight is only valid when the register 'Scale X:Error code' equals 00.

Scale X: Net weight

This register holds the net weight for a scale. The weight should **not** be read alone because the status and error codes are stored in other registers. The weight is only valid when the register 'Scale X:Error code' equals 00.

Scale X: Flow rate

This register holds the flow rate for a scale. The flow rate should **not** be read alone because the status and error codes are stored in other registers. The flow rate is only valid when the register 'Scale X:Error code' equals 00.

Scale X: Input signal (mV/V)

This register holds the current input signal in mV/V for a scale. This register could be used for fault finding in the system.

Analog output value 1, 2, 3, 4

These registers hold the values sent to the analog outputs. The registers can be used for fault finding in the system.

Note: The value is rounded to 3 decimals.

Status of inputs 11-18, 21-28

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Bit no | Function |
|--------|-----------------------------|--------|-----------------------------|
| 0 | Digital input 11 activated. | 8 | Digital input 21 activated. |
| 1 | Digital input 12 activated. | 9 | Digital input 22 activated. |
| 2 | Digital input 13 activated. | 10 | Digital input 23 activated. |
| 3 | Digital input 14 activated. | 11 | Digital input 24 activated. |
| 4 | Digital input 15 activated. | 12 | Digital input 25 activated. |
| 5 | Digital input 16 activated. | 13 | Digital input 26 activated. |
| 6 | Digital input 17 activated. | 14 | Digital input 27 activated. |
| 7 | Digital input 18 activated. | 15 | Digital input 28 activated. |

Note: If this register (bits) is read as float value, see description of Data representation.

Status of inputs 31-38, 41-48

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Bit no | Function |
|--------|-----------------------------|--------|-----------------------------|
| 0 | Digital input 31 activated. | 8 | Digital input 41 activated. |
| 1 | Digital input 32 activated. | 9 | Digital input 42 activated. |
| 2 | Digital input 33 activated. | 10 | Digital input 43 activated. |
| 3 | Digital input 34 activated. | 11 | Digital input 44 activated. |
| 4 | Digital input 35 activated. | 12 | Digital input 45 activated. |
| 5 | Digital input 36 activated. | 13 | Digital input 46 activated. |
| 6 | Digital input 37 activated. | 14 | Digital input 47 activated. |
| 7 | Digital input 38 activated. | 15 | Digital input 48 activated. |

Note: If this register (bits) is read as float value, see description of Data representation.

Status of inputs 51-58, 61-68

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Bit no | Function |
|--------|-----------------------------|--------|-----------------------------|
| 0 | Digital input 51 activated. | 8 | Digital input 61 activated. |
| 1 | Digital input 52 activated. | 9 | Digital input 62 activated. |
| 2 | Digital input 53 activated. | 10 | Digital input 63 activated. |
| 3 | Digital input 54 activated. | 11 | Digital input 64 activated. |
| 4 | Digital input 55 activated. | 12 | Digital input 65 activated. |
| 5 | Digital input 56 activated. | 13 | Digital input 66 activated. |
| 6 | Digital input 57 activated. | 14 | Digital input 67 activated. |
| 7 | Digital input 58 activated. | 15 | Digital input 68 activated. |

Note: If this register (bits) is read as float value, see description of Data representation.

Status of outputs 11-18, 21-28

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Bit no | Function |
|--------|------------------------------|--------|------------------------------|
| 0 | Digital output 11 activated. | 8 | Digital output 21 activated. |
| 1 | Digital output 12 activated. | 9 | Digital output 22 activated. |
| 2 | Digital output 13 activated. | 10 | Digital output 23 activated. |
| 3 | Digital output 14 activated. | 11 | Digital output 24 activated. |
| 4 | Digital output 15 activated. | 12 | Digital output 25 activated. |
| 5 | Digital output 16 activated. | 13 | Digital output 26 activated. |
| 6 | Digital output 17 activated. | 14 | Digital output 27 activated. |
| 7 | Digital output 18 activated. | 15 | Digital output 28 activated |

Note: If this register (bits) is read as float value, see description of Data representation.

Status of outputs 31-38, 41-48

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Bit no | Function |
|--------|------------------------------|--------|------------------------------|
| 0 | Digital output 31 activated. | 8 | Digital output 41 activated. |
| 1 | Digital output 32 activated. | 9 | Digital output 42 activated. |
| 2 | Digital output 33 activated. | 10 | Digital output 43 activated. |
| 3 | Digital output 34 activated. | 11 | Digital output 44 activated. |
| 4 | Digital output 35 activated. | 12 | Digital output 45 activated. |
| 5 | Digital output 36 activated. | 13 | Digital output 46 activated. |
| 6 | Digital output 37 activated. | 14 | Digital output 47 activated. |
| 7 | Digital output 38 activated. | 15 | Digital output 48 activated |

Note: If this register (bits) is read as float value, see description of Data representation.

Status of outputs 51-58, 61-68

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Bit no | Function |
|--------|------------------------------|--------|------------------------------|
| 0 | Digital output 51 activated. | 8 | Digital output 61 activated. |
| 1 | Digital output 52 activated. | 9 | Digital output 62 activated. |
| 2 | Digital output 53 activated. | 10 | Digital output 63 activated. |
| 3 | Digital output 54 activated. | 11 | Digital output 64 activated. |
| 4 | Digital output 55 activated. | 12 | Digital output 65 activated. |
| 5 | Digital output 56 activated. | 13 | Digital output 66 activated. |
| 6 | Digital output 57 activated. | 14 | Digital output 67 activated. |
| 7 | Digital output 58 activated. | 15 | Digital output 68 activated |

Note: If this register (bits) is read as float value, see description of Data representation.

Level status 1-16

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Comment |
|--------|----------------|-------------------------------|
| 0 | Above level 1 | The weight is above Level 1. |
| 1 | Above level 2 | The weight is above Level 2. |
| 2 | Above level 3 | The weight is above Level 3. |
| 3 | Above level 4 | The weight is above Level 4. |
| 4 | Above level 5 | The weight is above Level 5. |
| 5 | Above level 6 | The weight is above Level 6. |
| 6 | Above level 7 | The weight is above Level 7. |
| 7 | Above level 8 | The weight is above Level 8. |
| 8 | Above level 9 | The weight is above Level 9. |
| 9 | Above level 10 | The weight is above Level 10. |
| 10 | Above level 11 | The weight is above Level 11. |
| 11 | Above level 12 | The weight is above Level 12. |
| 12 | Above level 13 | The weight is above Level 13. |
| 13 | Above level 14 | The weight is above Level 14. |
| 14 | Above level 15 | The weight is above Level 15. |
| 15 | Above level 16 | The weight is above Level 16. |

Note: If this register (bits) is read as float value, see description of Data representation.

Level status 17-32

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Comment |
|--------|----------------|-------------------------------|
| 0 | Above level 17 | The weight is above Level 17. |
| 1 | Above level 18 | The weight is above Level 18. |
| 2 | Above level 19 | The weight is above Level 19. |
| 3 | Above level 20 | The weight is above Level 20. |
| 4 | Above level 21 | The weight is above Level 21. |
| 5 | Above level 22 | The weight is above Level 22. |
| 6 | Above level 23 | The weight is above Level 23. |
| 7 | Above level 24 | The weight is above Level 24. |
| 8 | Above level 25 | The weight is above Level 25. |
| 9 | Above level 26 | The weight is above Level 26. |
| 10 | Above level 27 | The weight is above Level 27. |
| 11 | Above level 28 | The weight is above Level 28. |
| 12 | Above level 29 | The weight is above Level 29. |
| 13 | Above level 30 | The weight is above Level 30. |
| 14 | Above level 31 | The weight is above Level 31. |
| 15 | Above level 32 | The weight is above Level 32. |

Note: If this register (bits) is read as float value, see description of Data representation.

Setpoint status 1-8

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Comment |
|--------|-----------------------|--|
| 0 | Setpoint 1 activated | See description for setpoint function. |
| 1 | Setpoint 1 cycle done | See description for setpoint function. |
| 2 | Setpoint 2 activated | See description for setpoint function. |
| 3 | Setpoint 2 cycle done | See description for setpoint function. |
| 4 | Setpoint 3 activated | See description for setpoint function. |
| 5 | Setpoint 3 cycle done | See description for setpoint function. |
| 6 | Setpoint 4 activated | See description for setpoint function. |
| 7 | Setpoint 4 cycle done | See description for setpoint function. |
| 8 | Setpoint 5 activated | See description for setpoint function. |
| 9 | Setpoint 5 cycle done | See description for setpoint function. |
| 10 | Setpoint 6 activated | See description for setpoint function. |
| 11 | Setpoint 6 cycle done | See description for setpoint function. |
| 12 | Setpoint 7 activated | See description for setpoint function. |
| 13 | Setpoint 7 cycle done | See description for setpoint function. |
| 14 | Setpoint 8 activated | See description for setpoint function. |
| 15 | Setpoint 8 cycle done | See description for setpoint function. |

Note: If this register (bits) is read as float value, see description of Data representation.

Setpoint status 9-16

Bits set to 1 in this register have the following meaning:

| Bit no | Function | Comment |
|--------|------------------------|--|
| 0 | Setpoint 9 activated | See description for setpoint function. |
| 1 | Setpoint 9 cycle done | See description for setpoint function. |
| 2 | Setpoint 10 activated | See description for setpoint function. |
| 3 | Setpoint 10 cycle done | See description for setpoint function. |
| 4 | Setpoint 11 activated | See description for setpoint function. |
| 5 | Setpoint 11 cycle done | See description for setpoint function. |
| 6 | Setpoint 12 activated | See description for setpoint function. |
| 7 | Setpoint 12 cycle done | See description for setpoint function. |
| 8 | Setpoint 13 activated | See description for setpoint function. |
| 9 | Setpoint 13 cycle done | See description for setpoint function. |
| 10 | Setpoint 14 activated | See description for setpoint function. |
| 11 | Setpoint 14 cycle done | See description for setpoint function. |
| 12 | Setpoint 15 activated | See description for setpoint function. |
| 13 | Setpoint 15 cycle done | See description for setpoint function. |
| 14 | Setpoint 16 activated | See description for setpoint function. |
| 15 | Setpoint 16 cycle done | See description for setpoint function. |

Note: If this register (bits) is read as float value, see description of Data representation.

Clock

These registers are used to read the time and date from the instrument.

Command register

As this register is read, the answer will always contain only zeros.

There are a number of actions that can be activated in the instrument. The value of this register (when different from zero) will activate one of these actions, as described in below.

When an action can not be performed for some reason (wrong state etc.) an exception is given as reply. When an exception with code 03 or 07 is received the command error register could be read to get a better error explanation.

| Cmd | Action activated in instrument | Description |
|-----|--------------------------------|--|
| 0 | No action | |
| 1 | Start operation | When the instrument is in 'Wait for start state', this command can be used to start up the instrument. |
| 2 | Enter Remote operation | This command disables the keys on the instrument. This means that an external computer is controlling the instrument or the instrument is controlled using digital inputs. |
| 3 | Exit Remote operation | This command enables the keys and leaves the remote operation. |
| | | |
| | | |
| 10 | Scale 1: Auto tare | |
| 11 | Scale 1: Set to zero | Used to set the gross weight to zero. |
| 12 | Scale 1: Select gross mode | |
| 13 | Scale 1: Select net mode | |
| 14 | Scale 1: Weight display | Show weight on the display. |
| 15 | Scale 1: Flow rate display | Show flow rate on the display. |
| 16 | Scale 1: Print command | Initiate a weight printout |
| | | |
| 20 | Scale 2: Auto tare | |
| 21 | Scale 2: Set to zero | Used to set the gross weight to zero. |
| 22 | Scale 2: Select gross mode | |
| 23 | Scale 2: Select net mode | |
| 24 | Scale 2: Weight display | Show weight on the display. |
| 25 | Scale 2: Flow rate display | Show flow rate on the display. |
| 26 | Scale 2: Print command | Initiate a weight printout |
| | | |
| 30 | Scale 3: Auto tare | |

| Cmd | Action activated in instrument | Description |
|------------|---------------------------------------|---------------------------------------|
| 31 | Scale 3: Set to zero | Used to set the gross weight to zero. |
| 32 | Scale 3: Select gross mode | |
| 33 | Scale 3: Select net mode | |
| 34 | Scale 3: Weight display | Show weight on the display. |
| 35 | Scale 3: Flow rate display | Show flow rate on the display. |
| 36 | Scale 3: Print command | Initiate a weight printout |
| | | |
| 40 | Scale 4: Auto tare | |
| 41 | Scale 4: Set to zero | Used to set the gross weight to zero. |
| 42 | Scale 4: Select gross mode | |
| 43 | Scale 4: Select net mode | |
| 44 | Scale 4: Weight display | Show weight on the display. |
| 45 | Scale 4: Flow rate display | Show flow rate on the display. |
| 46 | Scale 4: Print command | Initiate a weight printout |
| | | |
| 50 | Scale 5: Auto tare | |
| 51 | Scale 5: Set to zero | Used to set the gross weight to zero. |
| 52 | Scale 5: Select gross mode | |
| 53 | Scale 5: Select net mode | |
| 54 | Scale 5: Weight display | Show weight on the display. |
| 55 | Scale 5: Flow rate display | Show flow rate on the display. |
| 56 | Scale 5: Print command | Initiate a weight printout |
| | | |
| 60 | Scale 6: Auto tare | |
| 61 | Scale 6: Set to zero | Used to set the gross weight to zero. |
| 62 | Scale 6: Select gross mode | |
| 63 | Scale 6: Select net mode | |
| 64 | Scale 6: Weight display | Show weight on the display. |
| 65 | Scale 6: Flow rate display | Show flow rate on the display. |
| 66 | Scale 6: Print command | Initiate a weight printout |
| | | |
| 70 | Scale 7: Auto tare | |
| 71 | Scale 7: Set to zero | Used to set the gross weight to zero. |
| 72 | Scale 7: Select gross mode | |

| Cmd | Action activated in instrument | Description |
|------------|---------------------------------------|---------------------------------------|
| 73 | Scale 7: Select net mode | |
| 74 | Scale 7: Weight display | Show weight on the display. |
| 75 | Scale 7: Flow rate display | Show flow rate on the display. |
| 76 | Scale 7: Print command | Initiate a weight printout |
| | | |
| 80 | Scale 8: Auto tare | |
| 81 | Scale 8: Set to zero | Used to set the gross weight to zero. |
| 82 | Scale 8: Select gross mode | |
| 83 | Scale 8: Select net mode | |
| 84 | Scale 8: Weight display | Show weight on the display. |
| 85 | Scale 8: Flow rate display | Show flow rate on the display. |
| 86 | Scale 8: Print command | Initiate a weight printout |
| | | |
| 100 | Activate setpoint 1 | See description of setpoint function. |
| 101 | Deactivate setpoint 1 | See description of setpoint function. |
| 102 | Activate setpoint 2 | See description of setpoint function. |
| 103 | Deactivate setpoint 2 | See description of setpoint function. |
| 104 | Activate setpoint 3 | See description of setpoint function. |
| 105 | Deactivate setpoint 3 | See description of setpoint function. |
| 106 | Activate setpoint 4 | See description of setpoint function. |
| 107 | Deactivate setpoint 4 | See description of setpoint function. |
| 108 | Activate setpoint 5 | See description of setpoint function. |
| 109 | Deactivate setpoint 5 | See description of setpoint function. |
| 110 | Activate setpoint 6 | See description of setpoint function. |
| 111 | Deactivate setpoint 6 | See description of setpoint function. |
| 112 | Activate setpoint 7 | See description of setpoint function. |
| 113 | Deactivate setpoint 7 | See description of setpoint function. |
| 114 | Activate setpoint 8 | See description of setpoint function. |
| 115 | Deactivate setpoint 8 | See description of setpoint function. |
| 116 | Activate setpoint 9 | See description of setpoint function. |
| 117 | Deactivate setpoint 9 | See description of setpoint function. |
| 118 | Activate setpoint 10 | See description of setpoint function. |
| 119 | Deactivate setpoint 10 | See description of setpoint function. |
| 120 | Activate setpoint 11 | See description of setpoint function. |

| Cmd | Action activated in instrument | Description |
|------------|---------------------------------------|---------------------------------------|
| 121 | Deactivate setpoint 11 | See description of setpoint function. |
| 122 | Activate setpoint 12 | See description of setpoint function. |
| 123 | Deactivate setpoint 12 | See description of setpoint function. |
| 124 | Activate setpoint 13 | See description of setpoint function. |
| 125 | Deactivate setpoint 13 | See description of setpoint function. |
| 126 | Activate setpoint 14 | See description of setpoint function. |
| 127 | Deactivate setpoint 14 | See description of setpoint function. |
| 128 | Activate setpoint 15 | See description of setpoint function. |
| 129 | Deactivate setpoint 15 | See description of setpoint function. |
| 130 | Activate setpoint 16 | See description of setpoint function. |
| 131 | Deactivate setpoint 16 | See description of setpoint function. |
| 132 | Activate setpoint 1-16 | See description of setpoint function. |
| 133 | Deactivate setpoint 1-16 | See description of setpoint function. |

Scale X: Preset tare value

This registers is used to read and write a new preset tare for a scale.

Level X value

These registers are used to read and write levels that are supervised by the instrument.

Setpoint X value

The registers are used to read and write setpoints. See description of setpoint function.

I/O bits (Coils)

The instrument has a number of I/O bits that the master can write to using Modbus function 05 or 15.

Each of these I/O bits are linked to a command in the instrument, which is described previously in this manual.

Set the I/O bit with the same number as the command that should be executed.

The action is activated if the master sets the I/O bit to 'ON'.

If the master sets the I/O bit to 'OFF', this is accepted, but no action is activated.

All I/O bits are WRITE ONLY. This means the master cannot read the I/O bits but only write to them.

Note: If the master tries to write to more than one I/O bit (Modbus function 15) the instrument will act on the lowest I/O bit number only.

Data representation

Data sent to and from the instrument uses 16 bit holding registers (40XXX) and can use different formats for flexibility.

Integer

Unsigned integer (1 modbus register)

Values stored in one modbus register as an unsigned integer (16 bit number without decimals).

Scaled integer (2 modbus registers + 1 modbus register = 3 modbus registers)

Values stored in a special 3 register format. The first two registers are used as a 32 bit long integer value (with sign) and the third register is holding the number of decimals in the value.

Example: 12345678 (32 bit number) in the two first registers and 3 in the third register give the value: 12345.678.

| Register | Hex | Decimal | Description |
|----------|------|---------|---|
| 1 | 00BC | 188 | The 16 most significant bits in the value. |
| 2 | 614E | 24910 | The 16 least significant bits in the value. |
| 3 | 0003 | 3 | The number of decimals. |

Calculations in decimal numbers:

First multiply the most significant register with 2^{16} (65536) and add the least significant register to the value.

$$188 * 2^{16} + 24910 = 12345678$$

Now divide the number to get the right number of decimals. The decimal register was set to 3 in this example, which gives the value $10^3 = 1000$ to divide with.

$$12345678 / 1000 = 12345.678$$

Note: If you want to read weight or flow rate values and your PLC system can't handle 32 bit values, the second register can be used as a 16 bit register with the number of decimals that is indicated in the third register. This will limit the value range to -32768 to +32767. Flags in Status register for corresponding scale indicates when the weights are bigger than a 16 bit integer. These flags must be checked to be sure that the weight or flow value fits in just one register.

Float values

The type of float values used in the communication is selected in the set-up for the different communication interfaces.

Values stored as standard IEEE 32 bit float values. Each value has two registers assigned to it. To read/write a float value an even number of Modbus registers, starting at an even address, must be read/written each time. The float values are stored in two different register orders.

Some devices may transfer the values with the high order bits in the first register and the low order bits in the second register. Other devices may invert the register order.

Modicon float: For true Modicon PLC's.

Float: Many third party controllers that support Modicon protocol use the float format where all bytes are written out in order to one 32 bit register, as opposed to Modicon float which uses 2 consecutive 16 bit registers.

When float registers representing bits are read, the bits set are returned as a float value.

For example if bit 4 is set the value 16.0 is returned as a float value, and if both bit 0 and bit 4 are set the value 17.0 is returned as a float value.

To use the value it's a good choice to convert it to an unsigned integer where the bits can be compared.

Exception responses

When the master sends a query to a slave it expects a normal response (as described earlier). One of the following three events occurs after a query from the master.

1. Normal response.

The slave has received the query without communication error and can handle the query normally. The slave returns a normal response.

2. Communication error.

If the slave does not receive the query due to a communication error, or detects some communication error (parity error or checksum error), **no** response is returned. The master should process a time-out for the query.

3. Command error.

If the slave receives the query without any communication error, but cannot handle the query, e.g. if the command was not valid, the requested register number not valid or instrument in a mode where the command was not allowed, then the slave will return an exception response informing the master of the nature of the error.

The following exception codes are possible.

| Code | Name | Description |
|------|--------------------------|---|
| 01 | Illegal function | Not a valid function code. Valid function codes are 01, 02, 03, 05, 06, 08, 15, 16. |
| 02 | Illegal data address | Not a valid data address. See 'Register description' for a list of allowed registers. |
| 03 | Illegal data value | Value in data query field not valid. To get a better explanation of the error, the 'command error' register could be read. |
| 07 | Negative acknowledgement | The instrument has received the query but cannot perform it. To get a better explanation of the error, the 'command error' register could be read. |

Supported Modbus functions

| Function | Description |
|----------------------------|--|
| 01 Read Coil Status | <p>Reads the state of discrete outputs (0X references, coils). Only implemented because some 'masters' use this function to initiate communication.</p> <p>Coil range: 1 – 16 (Max number of points to read: 16).</p> <p>Response: Zero (OFF) for all requested points.</p> |
| 02 Read Input Status | <p>Reads the state of discrete inputs (1X references). This function is implemented only because some 'masters' use this function to initiate communication.</p> <p>Input range: 1 – 16 (Max number of points to read: 16).</p> <p>Response: Zero (OFF) for all requested points.</p> |
| 03 Read Holding Reg. | <p>Reads the binary contents of holding registers (4X references).</p> <p>Max number of registers to read: 125</p> |
| 05 Force Single Coil | <p>Forces a single coil (0X references) to either ON or OFF.</p> <p>This function is used to activate commands in the instrument.</p> |
| 06 Preset Single Reg. | <p>Presets a value into a single holding register (4X references).</p> |
| 08 Diagnostics | <p>This function can provide a series of different communication tests, depending on a sub function code. The instrument supports only sub function code 00, which is a 'loop-back' test. The same data as received will be sent back to the master.</p> <p>Max number of data bytes: 64</p> |
| 15 Force Multiple Coils | <p>Forces each coil (0X references) in a sequence of coils to either ON or OFF. This function is used to activate commands in the instrument.</p> <p>Max. number of points: 16 (only the first is used).</p> |
| 16 Preset Multiple reg. | <p>Presets values into a sequence of holding registers (4X references).</p> <p>Max number of registers to preset: 125</p> |

Note: No broadcast messages are allowed.

It is possible to send or fetch any number of registers (max 125) or I/O bits (max. 16). If the master tries to read more registers than there are available, the instrument will send dummy values for those registers not available.

Fieldbus interface

The optional fieldbus interface is based on a network communication module from HMS Industrial Networks. Available fieldbusses are Profibus and DeviceNet. With setup parameters the fieldbus interface is configured for the specific needs of an installation. It is possible to setup address, baud rate (if applicable to the actual fieldbus type) and mapping of the memory area in the fieldbus module that is available to the network.

The mapping is divided in one base block for data from the master to the instrument, one base block for data to the master from the instrument and 0 – 12 (selected with a setup parameter) configurable data blocks. The base blocks are mandatory. The data blocks are configurable regarding the content and in some cases also format (floating-point or integer).

The registers mentioned below are Modbus registers as defined in section Communication – Modbus Protocol. Each Modbus register is two bytes wide. This section also describes commands.

The size of the base blocks is 16 bytes from master to instrument and 32 bytes from the instrument to the master. The base blocks contain Instrument Error and Instrument Status. Besides instrument error and status information are the base blocks used for general purpose reading and writing of data and also for issuing commands to the instrument.

The mapping in the master and the instrument must always correspond.

Setup of fieldbus communication

- Complete the set-up of fieldbus communication before connecting it to the network to avoid possible network failure due to mismatch in configuration between network and instrument.
- Select the fieldbus type used in the 'Hardware Configuration' menu.
Note that the instrument will be restarted after changes in the hardware setup.
- Select the appropriate device address for the instrument. Address is setup in menu 'Communication – Fieldbus'.
Note that the address range is depending on type of fieldbus.
- Select baudrate, if applicable, according to the used baudrate in the network. Some fieldbusses may support automatic baud rate setting. Use fixed baudrate setting if there are difficulties to connect to the network or if the network baudrate is known.
- Select the number of data blocks that is needed for the installation. It is possible to use only the "base block" mapping if there is room for all necessary data within the 12 consecutive modbus registers that are defined within the base block (data from the instrument). The starting address of the read area is settable.
- Configure the desired number of data blocks. Note that the data blocks may still be configured as 'Not In Use' in which case the data within the block will be undefined.
- Check that the configuration of the master is compatible with the actual configuration of the instrument.
- Connect to the network.

Data from the fieldbus (Outputs in the master)

General

This 16 bytes block is mandatory, i.e. it is always mapped to the fieldbus in the instrument.

| Byte | Contents |
|------|--|
| 00 | Command |
| 01 | Number of registers to write |
| 02 | Start address, Read/Write _{MSB} |
| 03 | Start address, Read/Write |
| 04 | Write register 1 _{MSB} |
| 05 | Write register 1 |
| 06 | Write register 2 _{MSB} |
| 07 | Write register 2 |
| 08 | Write register 3 _{MSB} |
| 09 | Write register 3 |
| 10 | Write register 4 _{MSB} |
| 11 | Write register 4 |
| 12 | Write register 5 _{MSB} |
| 13 | Write register 5 |
| 14 | Write register 6 _{MSB} |
| 15 | Write register 6 |

Byte 0:

The command byte is used when setting the read window starting address, writing data to the instrument and to issue various scale related commands such as taring, zeroing etc.

Commands:

| | |
|--------------|--|
| 0 | No action |
| 250 (hex FA) | Change read window |
| 251 (hex FB) | Write data |
| 252 (hex FC) | Clear the Program reset bit in the Instrument Status register. |

Plus commands according to the manual, chapter 'Communication – Modbus protocol – Command register'.

Note that a new command is detected when the content of the command register is changed. If the same command is used more than once another command e.g. 0 must be used in between.

The response to a given command is the 'Command acknowledge' and the 'Command error' bytes that are described below in section 'Data to the fieldbus'.

Byte 1:

Used to define the number of registers to write.

Bytes 2 and 3:

Define from which register number to read or write.

Bytes 4 to 15:

Contains the data when writing to the instrument.

Data to the fieldbus (Inputs in the master)

General

Data to the fieldbus are divided into two categories, one is the mandatory “base block” which contain general data and the 12 modbus register used for reading from the instrument. The second part is the up to twelve configurable data blocks.

| Byte | Contents |
|------|--|
| 00 | Instrument error <small>MSB</small> |
| 01 | Instrument error |
| 02 | Instrument Status <small>MSB</small> |
| 03 | Instrument Status |
| 04 | Command acknowledge |
| 05 | Command error |
| 06 | Start address, Read <small>MSB</small> |
| 07 | Start address, Read |
| 08 | Read register 1 <small>MSB</small> |
| 09 | Read register 1 |
| 10 | Read register 2 <small>MSB</small> |
| 11 | Read register 2 |
| 12 | Read register 3 <small>MSB</small> |
| 13 | Read register 3 |
| 14 | Read register 4 <small>MSB</small> |
| 15 | Read register 4 |

| Byte | Contents |
|------|-------------------------------------|
| 16 | Read register 5 <small>MSB</small> |
| 17 | Read register 5 |
| 18 | Read register 6 <small>MSB</small> |
| 19 | Read register 6 |
| 20 | Read register 7 <small>MSB</small> |
| 21 | Read register 7 |
| 22 | Read register 8 <small>MSB</small> |
| 23 | Read register 8 |
| 24 | Read register 9 <small>MSB</small> |
| 25 | Read register 9 |
| 26 | Read register 10 <small>MSB</small> |
| 27 | Read register 10 |
| 28 | Read register 11 <small>MSB</small> |
| 29 | Read register 11 |
| 30 | Read register 12 <small>MSB</small> |
| 31 | Read register 12 |

The first 32 bytes of data from the instrument to the fieldbus are mandatory.

Bytes 0 and 1:

Contains the actual instrument error information (the value 0 means no error). See chapter 'Communication – Modbus protocol – Instrument error'.

Bytes 2 and 3:

The actual status information for the instrument, see chapter 'Communication – Modbus protocol – Instrument status'.

Byte 4:

The 'Command acknowledge'. It will be equal to the command number if the command was successfully executed. If the command failed byte 4 will have the value 240 (hex F0).

Byte 5:

The possible 'Command error' code. The error code is explained in chapter 'Troubleshooting – Error codes'. This byte will be zero if a command is correctly executed.

Bytes 6 and 7:

These two bytes is the starting address of the reading area following in bytes 8 to 31. The address defines the first of the 12 consecutive modbus registers in the read area. See chapter 'Communication – Modbus protocol' for details on modbus register address definitions.

Bytes 8 to 31:

These 24 bytes is the area used when the user wants to read any data that is accessible through modbus registers. The address (number) of the first register is defined in bytes 6 and 7 and the instrument will keep the 24 bytes (12 registers) updated.

Configurable data blocks

| Byte | Contents |
|------|------------------------|
| 32 | Start of data block 1 |
| 48 | Start of data block 2 |
| 64 | Start of data block 3 |
| 80 | Start of data block 4 |
| 96 | Start of data block 5 |
| 112 | Start of data block 6 |
| 128 | Start of data block 7 |
| 144 | Start of data block 8 |
| 160 | Start of data block 9 |
| 176 | Start of data block 10 |
| 192 | Start of data block 11 |
| 208 | Start of data block 12 |

Data Blocks is used to transfer data from the instrument to the master. Up to 12 data blocks can be used. Each block consists of 16 bytes. The data blocks have fixed positions in memory, see list below.

Last byte is no. 223. A total of 224 bytes data can be mapped from the instrument to the master. Of the maximum 224 bytes are 32 bytes the mandatory base block.

Type of data blocks

- Gross Weight data, floating point or integer format
- Net Weight data, floating point or integer format
- Displayed Weight data, floating point or integer format
- Flow Rate data, floating point or integer format
- Input Signal (transducer mV/V) data, floating point or integer format
- Level status, floating point format
- Setpoint status, floating point format
- Input status, floating point format
- Output status, floating point format
- Input and output status, integer format
- Level and setpoint status, integer format
- Analog output value 1 to 4, floating point format
- Analog output value 1 and 2, integer format
- Analog output value 3 and 4, integer format

The offset in the left column, in the following descriptions of the data block types, is the starting byte number (see table above) for the actual data block number.

The Weight data blocks (floating-point and integer formats) below are a common description of the five different types that can be selected: Gross Weight, Net Weight, Disp. Weight, Flow Rate and Input Signal.

See chapter 'Communication – Modbus protocol' for a description of the contents of the different data blocks and the integer and floating-point data formats.

Weight data block (Floating-point format)

| Byte | Contents |
|-------------|------------------------------------|
| Offset + 0 | Scale x: Error code _{MSB} |
| Offset + 1 | Scale x: Error code |
| Offset + 2 | Scale x: Error code |
| Offset + 3 | Scale x: Error code |
| Offset + 4 | Scale x: Status _{MSB} |
| Offset + 5 | Scale x: Status |
| Offset + 6 | Scale x: Status |
| Offset + 7 | Scale x: Status |
| Offset + 8 | Scale x: Data _{MSB} |
| Offset + 9 | Scale x: Data |
| Offset + 10 | Scale x: Data |
| Offset + 11 | Scale x: Data |
| Offset + 12 | Not used |
| Offset + 13 | Not used |
| Offset + 14 | Not used |
| Offset + 15 | Not used |

Note: Scale Data can be (selected by parameter) Gross Weight, Net Weight, Displayed Weight, Flow Rate Value or Input Signal.

X is the selected (by parameter) scale number for the data block.

The table above describes the data block format if the parameter 'Data Block N Format' is set to 'Floating point' where 'N' stands for the index of the Data Block (1 – 12).

Weight data block (Integer format)

| Byte | Content |
|-------------|--|
| Offset + 0 | Scale x: Error code <small>MSB</small> |
| Offset + 1 | Scale x: Error code |
| Offset + 2 | Scale x: Status <small>MSB</small> |
| Offset + 3 | Scale x: Status |
| Offset + 4 | Scale x: Data, int <small>MSB</small> |
| Offset + 5 | Scale x: Data, int |
| Offset + 6 | Scale x: Data, int |
| Offset + 7 | Scale x: Data, int |
| Offset + 8 | Scale x: Data, dec <small>MSB</small> |
| Offset + 9 | Scale x: Data, dec |
| Offset + 10 | Not used |
| Offset + 11 | Not used |
| Offset + 12 | Not used |
| Offset + 13 | Not used |
| Offset + 14 | Not used |
| Offset + 15 | Not used |

Note: Scale Data can be (selected by parameter) Gross Weight, Net Weight, Displayed Weight, Flow Rate Value or Input Signal.

X is the selected (by parameter) scale number for the data block.

The table above describes the data block format if the parameter 'Data Block N Format' is set to 'Integer' where 'N' stands for the index of the Data Block (1 – 12).

Level status (Floating-point format)

| Byte | Content |
|-------------|-------------------------------------|
| Offset + 0 | Level status 1 – 16 _{MSB} |
| Offset + 1 | Level status 1 – 16 |
| Offset + 2 | Level status 1 – 16 |
| Offset + 3 | Level status 1 – 16 |
| Offset + 4 | Level status 17 – 32 _{MSB} |
| Offset + 5 | Level status 17 – 32 |
| Offset + 6 | Level status 17 – 32 |
| Offset + 7 | Level status 17 – 32 |
| Offset + 8 | Not used |
| Offset + 9 | Not used |
| Offset + 10 | Not used |
| Offset + 11 | Not used |
| Offset + 12 | Not used |
| Offset + 13 | Not used |
| Offset + 14 | Not used |
| Offset + 15 | Not used |

Setpoint status (Floating-point format)

| Byte | Content |
|-------------|---------------------------------------|
| Offset + 0 | Setpoint status 1 – 8 _{MSB} |
| Offset + 1 | Setpoint status 1 – 8 |
| Offset + 2 | Setpoint status 1 – 8 |
| Offset + 3 | Setpoint status 1 – 8 |
| Offset + 4 | Setpoint status 9 – 16 _{MSB} |
| Offset + 5 | Setpoint status 9 – 16 |
| Offset + 6 | Setpoint status 9 – 16 |
| Offset + 7 | Setpoint status 9 – 16 |
| Offset + 8 | Not used |
| Offset + 9 | Not used |
| Offset + 10 | Not used |
| Offset + 11 | Not used |
| Offset + 12 | Not used |
| Offset + 13 | Not used |
| Offset + 14 | Not used |
| Offset + 15 | Not used |

Input Status (Floating-point format)

| Byte | Content |
|-------------|--|
| Offset + 0 | Status of inputs 11 – 18, 21 – 28 _{MSB} |
| Offset + 1 | Status of inputs 11 – 18, 21 – 28 |
| Offset + 2 | Status of inputs 11 – 18, 21 – 28 |
| Offset + 3 | Status of inputs 11 – 18, 21 – 28 |
| Offset + 4 | Status of inputs 31 – 38, 41 – 48 _{MSB} |
| Offset + 5 | Status of inputs 31 – 38, 41 – 48 |
| Offset + 6 | Status of inputs 31 – 38, 41 – 48 |
| Offset + 7 | Status of inputs 31 – 38, 41 – 48 |
| Offset + 8 | Status of inputs 51 – 58, 61 – 68 _{MSB} |
| Offset + 9 | Status of inputs 51 – 58, 61 – 68 |
| Offset + 10 | Status of inputs 51 – 58, 61 – 68 |
| Offset + 11 | Status of inputs 51 – 58, 61 – 68 |
| Offset + 12 | Not used |
| Offset + 13 | Not used |
| Offset + 14 | Not used |
| Offset + 15 | Not used |

Output Status (Floating-point format)

| Byte | Content |
|-------------|---|
| Offset + 0 | Status of outputs 11 – 18, 21 – 28 _{MSB} |
| Offset + 1 | Status of outputs 11 – 18, 21 – 28 |
| Offset + 2 | Status of outputs 11 – 18, 21 – 28 |
| Offset + 3 | Status of outputs 11 – 18, 21 – 28 |
| Offset + 4 | Status of outputs 31 – 38, 41 – 48 _{MSB} |
| Offset + 5 | Status of outputs 31 – 38, 41 – 48 |
| Offset + 6 | Status of outputs 31 – 38, 41 – 48 |
| Offset + 7 | Status of outputs 31 – 38, 41 – 48 |
| Offset + 8 | Status of outputs 51 – 58, 61 – 68 _{MSB} |
| Offset + 9 | Status of outputs 51 – 58, 61 – 68 |
| Offset + 10 | Status of outputs 51 – 58, 61 – 68 |
| Offset + 11 | Status of outputs 51 – 58, 61 – 68 |
| Offset + 12 | Not used |
| Offset + 13 | Not used |
| Offset + 14 | Not used |
| Offset + 15 | Not used |

Inp./Outp Stat (Integer format)

| Byte | Content |
|-------------|---|
| Offset + 0 | Status of inputs 11 – 18, 21 – 28 <small>MSB</small> |
| Offset + 1 | Status of inputs 11 – 18, 21 – 28 |
| Offset + 2 | Status of inputs 31 – 38, 41 – 48 <small>MSB</small> |
| Offset + 3 | Status of inputs 31 – 38, 41 – 48 |
| Offset + 4 | Status of inputs 51 – 58, 61 – 68 <small>MSB</small> |
| Offset + 5 | Status of inputs 51 – 58, 61 – 68 |
| Offset + 6 | Not used |
| Offset + 7 | Not used |
| Offset + 8 | Status of outputs 11 – 18, 21 – 28 <small>MSB</small> |
| Offset + 9 | Status of outputs 11 – 18, 21 – 28 |
| Offset + 10 | Status of outputs 31 – 38, 41 – 48 <small>MSB</small> |
| Offset + 11 | Status of outputs 31 – 38, 41 – 48 |
| Offset + 12 | Status of outputs 51 – 58, 61 – 68 <small>MSB</small> |
| Offset + 13 | Status of outputs 51 – 58, 61 – 68 |
| Offset + 14 | Not used |
| Offset + 15 | Not used |

Lev./Setp. Stat (Integer format)

| Byte | Content |
|-------------|---|
| Offset + 0 | Level status 1 – 16 <small>MSB</small> |
| Offset + 1 | Level status 1 – 16 |
| Offset + 2 | Level status 17 – 32 <small>MSB</small> |
| Offset + 3 | Level status 17 – 32 |
| Offset + 4 | Setpoint status 1 – 8 <small>MSB</small> |
| Offset + 5 | Setpoint status 1 – 8 |
| Offset + 6 | Setpoint status 9 – 16 <small>MSB</small> |
| Offset + 7 | Setpoint status 9 – 16 |
| Offset + 8 | Not used |
| Offset + 9 | Not used |
| Offset + 10 | Not used |
| Offset + 11 | Not used |
| Offset + 12 | Not used |
| Offset + 13 | Not used |
| Offset + 14 | Not used |
| Offset + 15 | Not used |

AOUT1-4 Value (Floating-point format)

| Byte | Content |
|-------------|--|
| Offset + 0 | Analog output value 1 <small>MSB</small> |
| Offset + 1 | Analog output value 1 |
| Offset + 2 | Analog output value 1 |
| Offset + 3 | Analog output value 1 |
| Offset + 4 | Analog output value 2 <small>MSB</small> |
| Offset + 5 | Analog output value 2 |
| Offset + 6 | Analog output value 2 |
| Offset + 7 | Analog output value 2 |
| Offset + 8 | Analog output value 3 <small>MSB</small> |
| Offset + 9 | Analog output value 3 |
| Offset + 10 | Analog output value 3 |
| Offset + 11 | Analog output value 3 |
| Offset + 12 | Analog output value 4 <small>MSB</small> |
| Offset + 13 | Analog output value 4 |
| Offset + 14 | Analog output value 4 |
| Offset + 15 | Analog output value 4 |

AOUT1-2 Value (Integer format)

| Byte | Content |
|-------------|---|
| Offset + 0 | Analog output value 1, int <small>MSB</small> |
| Offset + 1 | Analog output value 1, int |
| Offset + 2 | Analog output value 1, int |
| Offset + 3 | Analog output value 1, int |
| Offset + 4 | Analog output value 1, dec <small>MSB</small> |
| Offset + 5 | Analog output value 1, dec |
| Offset + 6 | Not used |
| Offset + 7 | Not used |
| Offset + 8 | Analog output value 2, int <small>MSB</small> |
| Offset + 9 | Analog output value 2, int |
| Offset + 10 | Analog output value 2, int |
| Offset + 11 | Analog output value 2, int |
| Offset + 12 | Analog output value 2, dec <small>MSB</small> |
| Offset + 13 | Analog output value 2, dec |
| Offset + 14 | Not used |
| Offset + 15 | Not used |

AOUT3-4 Value (Integer format)

| Byte | Content |
|-------------|---|
| Offset + 0 | Analog output value 3, int _{MSB} |
| Offset + 1 | Analog output value 3, int |
| Offset + 2 | Analog output value 3, int |
| Offset + 3 | Analog output value 3, int |
| Offset + 4 | Analog output value 3, dec _{MSB} |
| Offset + 5 | Analog output value 3, dec |
| Offset + 6 | Not used |
| Offset + 7 | Not used |
| Offset + 8 | Analog output value 4, int _{MSB} |
| Offset + 9 | Analog output value 4, int |
| Offset + 10 | Analog output value 4, int |
| Offset + 11 | Analog output value 4, int |
| Offset + 12 | Analog output value 4, dec _{MSB} |
| Offset + 13 | Analog output value 4, dec |
| Offset + 14 | Not used |
| Offset + 15 | Not used |

Examples

Example 1: Setting 'Level 1 Value' to 123.5 (Writing to float value register).

1. Make sure that the previous command was not 251.
Set command byte (00) to 0 if previous command was 251.
2. Set number of registers (2) to write in byte 01.
3. Set start address (46026) in bytes 02 and 03.
See chapter 'Communication – Modbus protocol – General registers'.
4. Set the following four bytes (04 – 07) to the value to write (123.5).
5. Enter the command (251) in byte 00.

| Byte | Description | Dec | Hex |
|---------|------------------------------------|-------|-------------|
| 00 | Command | 251 | FB |
| 01 | Number of registers to write | 2 | 02 |
| 02 – 03 | Start address | 46026 | B3 CA |
| 04 – 07 | Value to write in register 1 and 2 | 123.5 | 42 F7 00 00 |
| 08 – 15 | Write registers 3 – 6. | — | — |

Example 2: Setting 'Setpoint 14 value' to 123.5 (Writing to integer value register).

1. Make sure that the previous command was not 251.
Set command byte (00) to 0 if previous command was 251.
2. Set number of registers (3) to write in byte 01.
3. Set start address (42169) in bytes 02 and 03.
See chapter 'Communication – Modbus protocol – General registers'.
4. Set the following four bytes (04 – 07) to the value to write 123.50,
i.e. 12350 and two decimals.
5. Set bytes 08 and 09 to number of decimals. In this example is 2 decimals used.
6. Enter the command (251) in byte 00.

| Byte | Description | Dec | Hex |
|---------|------------------------------------|-------|-------------|
| 00 | Command | 251 | FB |
| 01 | Number of registers to write | 3 | 03 |
| 02 – 03 | Start address | 42169 | A4 B9 |
| 04 – 07 | Value to write in register 1 and 2 | 12350 | 00 00 30 3E |
| 08 – 09 | Value to write to register 3 | 2 | 00 02 |
| 10 – 15 | Write registers 4 – 6. | — | — |

Example 3: Set read window to read from Scale 4 floating point data (registers 44074 to 44085). Note that the number of registers read is always 12.

1. Make sure that the previous command was not 250.
Set command byte (00) to 0 if previous command was 250.
2. Set start address (44074) in bytes 02 and 03.
See chapter 'Communication – Modbus protocol – General registers'.
3. Enter the command (250) in byte 00.

| Byte | Description | Dec | Hex |
|---------|------------------------------|-------|-------|
| 00 | Command | 250 | FA |
| 01 | Number of registers to write | — | — |
| 02 – 03 | Start address | 44074 | AC 2A |
| 04 – 15 | Write registers 1 – 6. | — | — |

Example 4: Reset the 'Program reset' bit in 'Instrument status'.

1. Make sure that the previous command was not 252.
2. Enter the command (252) in byte 00.

| Byte | Description | Dec | Hex |
|---------|------------------------------|-----|-----|
| 00 | Command | 252 | FC |
| 01 | Number of registers to write | — | — |
| 02 – 03 | Start address | — | — |
| 04 – 15 | Write registers 1 – 6. | — | — |

Example 5: Other commands like Taring, Zeroing etc.

See chapter 'Communication – Modbus protocol – Command register' for a list of available commands.

1. Make sure that the previous command was not the desired command.
2. Enter the desired command in byte 00.

| Byte | Description | Dec | Hex |
|---------|------------------------------|-----|-----|
| 00 | Command | XXX | XX |
| 01 | Number of registers to write | — | — |
| 02 – 03 | Start address | — | — |
| 04 – 15 | Write registers 1 – 6. | — | — |

Note that a dash in Dec. or Hex columns above indicates that the value is unimportant and not used for the function described.

Weight printing

The print function is designed to work best with a 40-character printer. Displayed weight or flow rate and batching reports can be printed.

The printing functionality in the G4 Instrument uses the multilingual character set known as Microsoft OEM code page 437 (US), MS-DOS code page 437, IBM character set No. 437, etc. Details on this character set can be found e.g. on the Internet.

With the Scale Batching Program Option enabled it is possible to also print batching reports. See the 'Scale Batching Program Option' 'Technical Manual Supplement' for a description of function and set-up.

Setup of printer

'COMx:Mode': Set to 'Printer' to activate the printing function in the G4 Instrument. If both serial ports are set to 'Printer' a print out will be done simultaneously on both ports. The setting may differ between the two ports.

'COMx:Baudrate': As selected on the printer.

'COMx>Data Format': As selected on the printer.

'COMx:Print Pos. 1':

'COMx:Print Pos. 2':

'COMx:Print Pos. 3':

'COMx:Print Pos. 4': A print out consists of up to 4 fields with configurable information. Each field is 20 characters long. The fields can be either: 'Not in use', 'Display Weight', 'Preset Tare', 'Date/Time', 'Scale Name' or 'Instrument Name'.

| | |
|--------------|--------------|
| Print Pos. 1 | Print Pos. 2 |
| Print Pos. 3 | Print Pos. 4 |

Printer field layout.

If both positions on a row are set to 'Not in use' the row is omitted.

'COMx:Linefeeds': After each printout of displayed weight the number of linefeeds defined in this parameter is added.

Print examples

Print Pos. 1 = Date/Time

Print Pos. 2 = Scale Name

Print Pos. 3 = Not in use

Print Pos. 4 = Display Weight

Linefeeds = 2

Scale 1 Name = Ice cream

Scale 2 Name = Chocolate

| | | |
|------------------|------------------------------|-----------------------------------|
| 2008-03-12 17:11 | Ice cream 1:G 037.9 kg | (Scale 1, gross weight displayed) |
| 2008-03-12 19:33 | Chocolate 2:N 002.4 kg | (Scale 2, net weight displayed) |
| 2008-03-12 19:42 | Ice cream 1: 012.0 kg/min | (Scale 1, flow rate displayed) |

7. Remote Access

General

Using a PC with a Web Browser, like MS Internet Explorer, it is possible to get access to the instrument set-up and maintenance functions. The PC can be connected to the same network as the instrument, or directly with an Ethernet crossover cable.

Before connecting any instrument to an existing network it should be configured according to the network requirements. Note that the 'Network Configuration' menu is only available with the local user interface on the instrument and not via remote access. The 'Network Configuration' menu is found in 'Main Menu'. Under 'Network Configuration' menu is the 'Server Config' menu found where the Web Server can be enabled (default) or disabled. Also the password can be set here.

The remote access interface of the G4 instrument is intended to facilitate the set-up and maintenance work with the instrument. During e.g. commissioning it will make it possible to have the PC close to the equipment when the instrument is placed away from the equipment. It is possible to access several instruments that are connected to the same network from one location for set-up, diagnostics etc. It is also possible to access instruments over Internet for e.g. remote diagnostics provided that the network allows remote access e.g. using VPN (Virtual Private Network). This requires specific security measures that is the responsibility of the user/network administrator.

Note that the remote access is not intended as an operator interface. If a remote operator interface is desired the Modbus TCP (Ethernet), Modbus RTU (serial com.) and the Fieldbus interfaces are recommended.

Browser requirements

The Remote Access interface has been tested primarily with MS Internet Explorer 7 and Mozilla Firefox browsers. It will probably work with many other browsers but browsers tend to behave differently and some functionality may work or look differently in other browsers. If any problems are encountered please try Internet Explorer.


JavaScript must be enabled for the remote access to work. It is also required that the browser supports frames.

The web pages are designed to fulfill HTML 4.01 either Transitional or Frameset.

Using the Remote Access

To navigate in the menu system a mouse, touch pad, pointing stick etc. must be used. The keyboard cannot be used for navigation. Hovering with the mouse pointer over a selection in a menu will highlight the item and clicking will open the next menu level or allow for a parameter to be edited. The keyboard is only used when entering values like numbers or texts. The mouse is used to select between parameter choices during set-up.

When moving back (up) in the menu system use the 'Escape' button on the screen and not the back button of the browser. This is because browsers commonly caches pages in the PC. Since the pages from the Instrument are dynamic i.e. have a content that is depending on the actual settings a cached page cannot be used. The instrument also keeps track of the currently displayed page (current state) of the menu system and does not allow for multiple pages being displayed simultaneously on different browsers or tabs. If there is any problem with a page or a page is suspected to be cached and not fresh from the instrument just refresh the page by clicking the refresh button or F5. This will refresh the entire page.

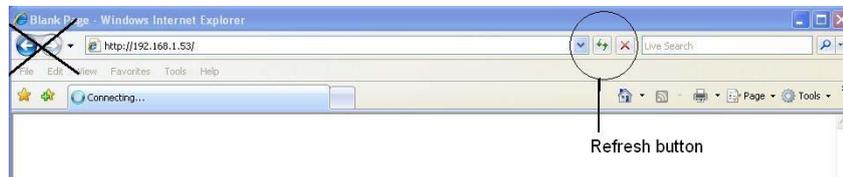

Refresh button, back and forward buttons not used


Security

The internal Web Server and Ftp Server use basic authentication that will keep the user ID and password hidden from the average computer user. It will however not provide a secure connection, no encryption etc. It is possible with some simple equipment and knowledge to find out the user ID and password. It is therefore strongly suggested that the set-up and operator locks, in the instrument, are used. It is also recommended to use the login protection on the used PC and also log out while not in use.

Using the instrument connected to the Internet will require specific security measures that are the responsibility of the user/network administrator.

Remote Access Login and Logout


Entering the IP Address of the desired instrument in the address field of the browser will have the instrument Web Server presenting the login form, see the picture below.

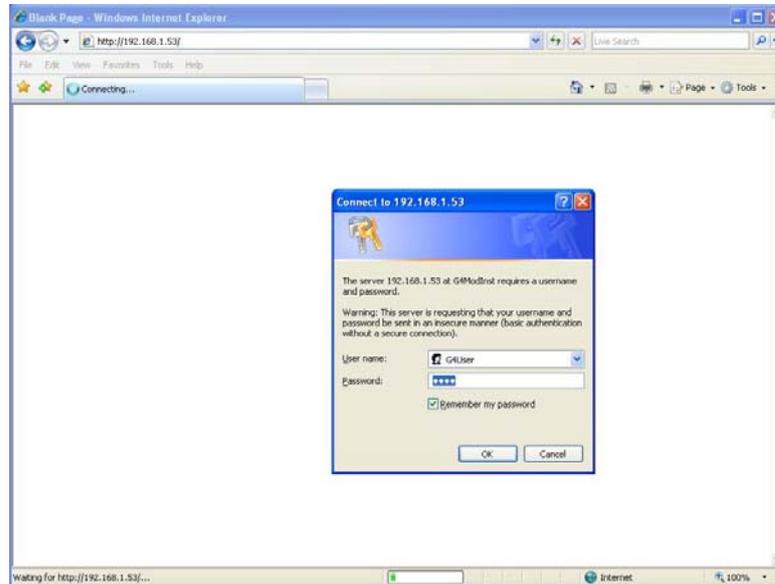

Login form


The user ID is always 'G4User' (case sensitive) and the password is by default '1937'. It is possible to change the password in the 'Main Menu / Network Configuration / Server Configuration' menu. Note that the same password (and user ID) also applies to the Ftp Server.

If the wrong password is entered the Access Denied page will displayed. Usually this will happen after three failed login attempts or if the Cancel button is clicked. By clicking the Refresh text or by clicking the refresh button on the browser the login form will be displayed again. Clicking the Close text will close the browser (not possible on every browser). See the picture below.

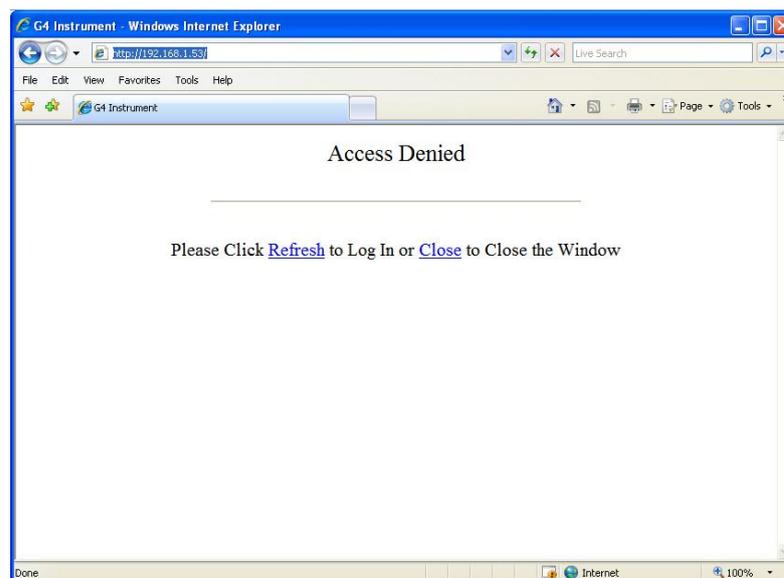


Access denied screen

When the correct login credentials are entered the entry screen will be displayed. This picture will show the Instrument Name (if set) or possible start up errors (serious and fatal errors). Any errors shown here must normally be corrected from the instrument and not through remote access. If the start mode of the instrument is 'Command' this will be shown on the entry screen. Note that the start command must be given from the instrument front panel or by communication, not from the Remote Access. It is possible to access the menu system even if the instrument is waiting for a manual start command.

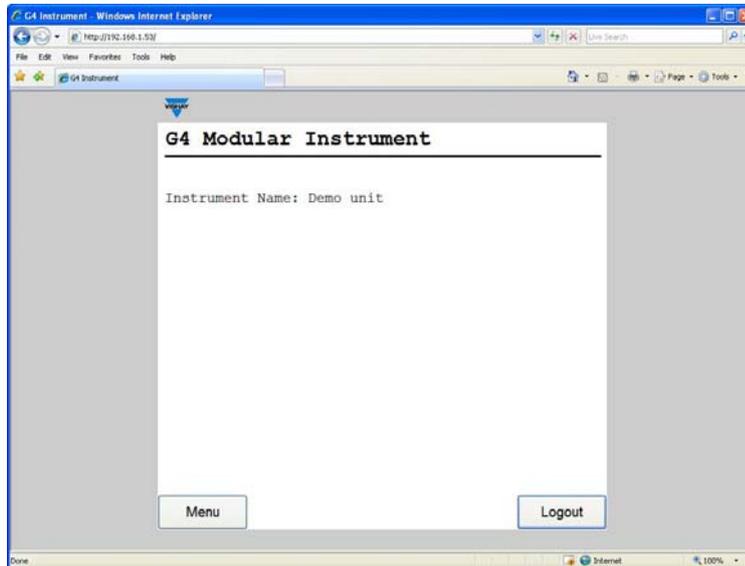

Entry screen

Two buttons are available on the Entry Screen. One is the 'Menu' button, which will give access to the menu system of the instrument. Clicking the 'Menu' button is equivalent to pressing the 'Info' button on the instrument front panel. The other button on the Entry Screen is the 'Logout' button. Clicking the 'Logout' button will logout the user and display the picture shown below.

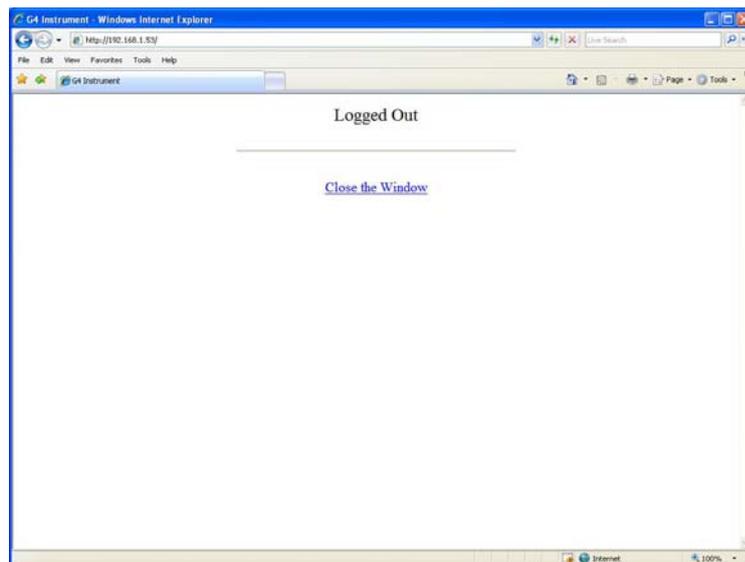


Logged out screen

Clicking the 'Close the Window' text will close the browser (if allowed by the browser). Note that the browser may save the login credentials which then are proposed as default next time the user tries to login to the same unit.

When a remote access session is finished the user should log out from the entry screen before closing the browser. Also see 'Remote / Local Access' below.

If one user is using the Remote Access when another user tries to login he will be presented an override picture provided login is accepted. To continue and logout the current user click the 'Yes' text (link). Click the 'No' text (link) to avoid overriding the current user and close the browser.

The overriding user will continue at the same position in the menu system as the old user was. The override function is intended to give a new user a warning not to interfere with another Remote Access user unconscious. Note that if a user has been idle for 30 min he will be logged out automatically. Next user to log in will continue from the same position in the menu system.

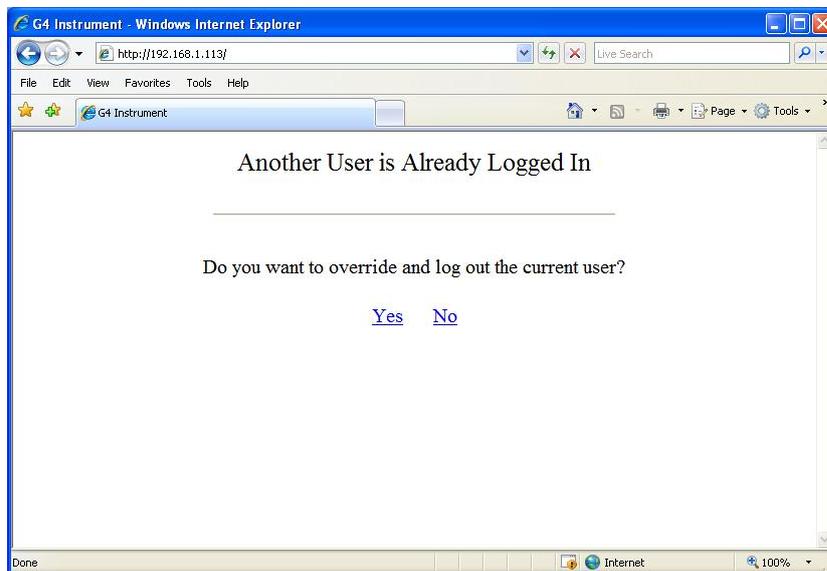

Override screen

Remote / Local Access

It is possible to access the menu system both locally and remotely simultaneously. It is however not possible to edit from more than one interface at a time. The first to start edit any parameter will get exclusive access to parameter editing. This also applies to e.g. maintenance functions. To release the exclusive access the user must navigate out of the menu system i.e. exit the 'Main Menu' level.

When a remote access session is finished the user should log out from the entry screen before closing the browser, unless intending to continue, to avoid holding the exclusive access rights, which will block a local user from editing parameters or using some maintenance functions. Note that the blocking also will occur in the opposite direction.

To resolve such a blocking situation without being able to access the blocking interface it is possible to restart the instrument using the 'Instrument Restart' function that can be found in the 'Maintenance' menu. This function must be used with caution since it will interrupt all instrument functions while restarting the instrument. Also note that if the 'Start Mode' is set to 'Command' the instrument will wait at start-up for a start command from the instrument front panel or via communication.

There are a few differences between local and remote access. From the Remote Access Interface it is not possible to do Program Upgrade (Maintenance) or Network Configuration (Main Menu). All other functionality is available.

Remote Set-up

All operating functions in the G4 Instrument are controlled by parameters. The parameter values are permanently stored in the instrument and will not be lost when the unit is switched off. At delivery the parameters are factory-set to default values, giving the instrument an initial standard function.

The actual setting of the parameter values can be read and edited during normal measuring operation in sub menu 'Parameter Set-up'. When Scale Batching (a program option) is active, on any scale, it will not be possible to edit parameters except for a limited number of batching parameters that still can be edited.

Editing of parameter values can be performed from a browser when connected and logged in to the instrument. After editing hardware parameters the instrument will be restarted.

In the instrument there are two levels of security locks provided to protect from unauthorized access to instrument functions and editing of parameters and values. The locks are opened by four-digit codes.

Warning: *Changes done during editing of set-up parameters will affect the behavior of the instrument immediately. The user must take all necessary precautions to prevent any undesired effects in the process monitored or controlled by the G4 instrument or a connected control system.*

It is strongly recommended to activate the set-up lock in the instrument to prevent any unauthorized changes of set-up parameters.

It's a good practice to make a backup of the set-up after changes have been done. See section 'Maintenance' in this chapter for more information on backup and restore.

When the G4 Instrument is first taken into service, setting of a few parameters will quickly adapt the instrument to the transducers and give desired weighing function. The 'Quick Set-up' is described in a separate publication:

**G4 Multi Channel Weighing Instrument
Operating instructions, Quick installation
PM/DT/HE Types**

If the Scale Batching Program Option is used please refer to the separate batching manual for details on function and set-up:

**G4 Multi Channel Weighing Instrument
Scale Batching Program Option
Technical Manual Supplement
PM/DT/HE/RM Types**

Note that these two publications do not describe the set-up procedure using the Remote Access. The Remote Access Interface is normally simple to use for anyone who have used the front panel set-up procedure.


Set-up Parameters

For a description of the menu structure and the set-up parameters available with the Remote Access Interface as well as locally on the instrument see chapters 'Set-up/Menu Structure' and 'Set-up/Parameters' in this manual.

Main Menu

To reach the main menu the user first has to connect to the instrument by entering the IP Address and then (if required) entering the login user ID (G4User) and the password (default 1937, possible to change). This will display the Entry Screen and by clicking the 'Menu' button the Main Menu will be displayed.

To open a menu, e.g. Parameter Set-up, simply click on the desired menu.

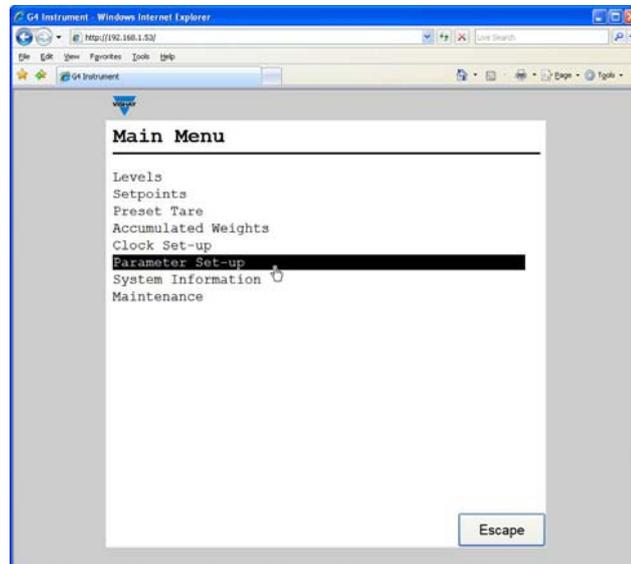


Main menu screen

Parameter Set-up menu

If there isn't room for all parameters on screen, it is possible to scroll through the list with the scroll bar at the right of the screen.

Click the 'Escape' button (on the screen) to return to the Main Menu. The 'Escape' button is always used to cancel editing or moving backwards in the menu structure.

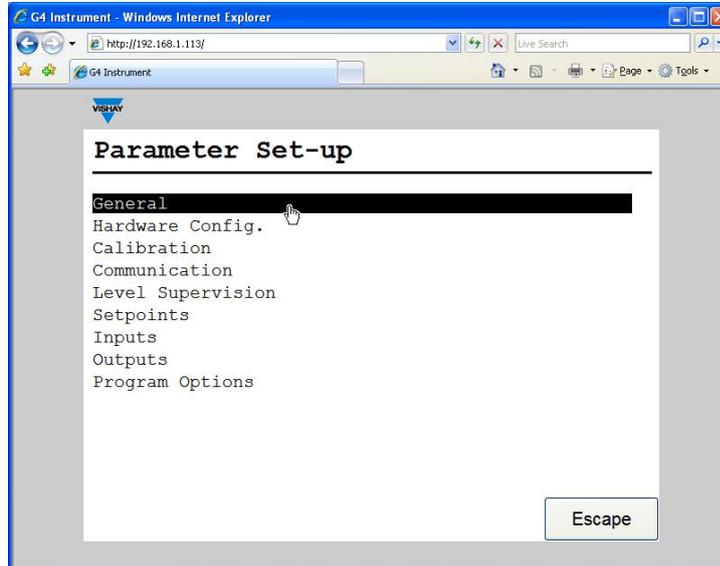


Parameter set-up screen

Parameter editing

This example shows the 'General' parameter menu but editing is done similar throughout the menu system.


To edit a parameter, simply click on it.

If all items in the menu don't fit on the screen, it is possible to scroll through the list of parameters using the scroll bar at the right of the screen. Click the 'Escape' key to return to the Parameter set-up menu.

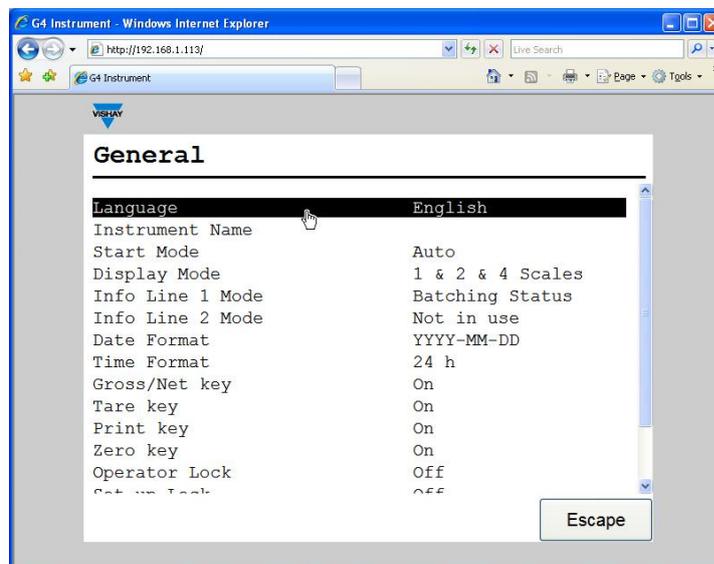

General parameters screen


When editing a choice parameter e.g. language as in the figure, a list of available choices is shown on screen with the current selection is shown in bold. To change the current selection click on the desired selection. To abort editing and keep the previous setting, click the 'Escape' button on the screen. When a selection is made in the editing (new or current) the editing screen is closed and the previous menu is shown.

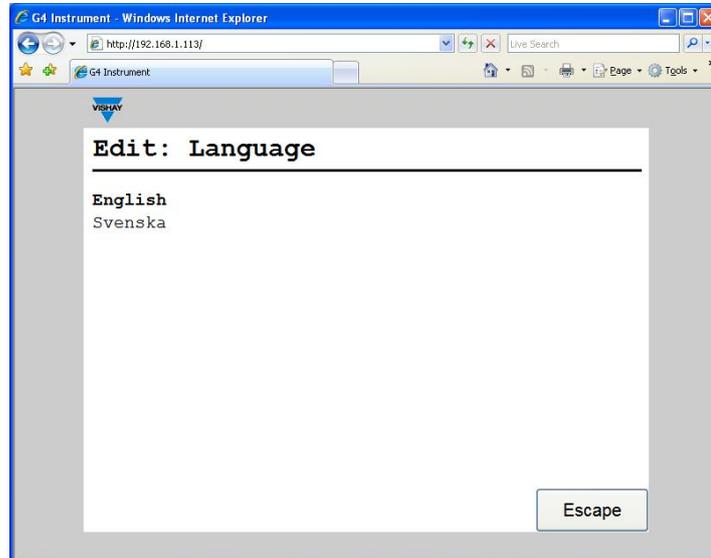

Editing an choice parameter

When editing a numerical parameter e.g. a level hystereses setting as in the figure, the new value should be typed with the keyboard numerical keys. To confirm the new value click the 'Enter' button on the screen.

To abort editing and keep the previous setting, click the 'Escape' button.

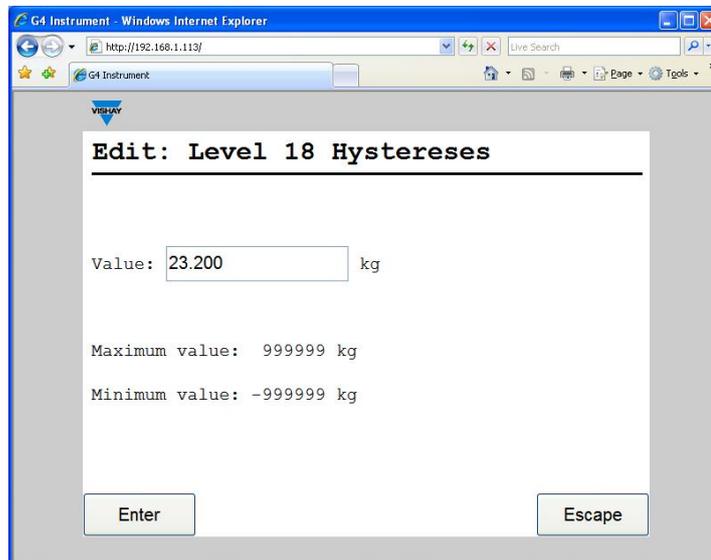

Editing a value parameter

Remote Access Maintenance

General

The Maintenance menu includes a number functions used for diagnostics and maintenance purposes. The Maintenance menu is found under the Main menu.

All maintenance functions of the instrument are available from the Remote Access Interface except the 'Program Upgrade'. Upgrading the program in the instrument must be done directly on the instrument itself. The communication screen only show actual settings of the communication interfaces and not indicating active communication as the display on the instrument.


Diagnostics

The diagnostics functions cover Scales, Communication, Fieldbus, Digital Inputs, Digital Outputs and Analog Outputs. It is possible to read data and status for the different functions and also in some cases (Digital and Analog outputs) change the output data. If the normal operation has been interrupted (a value or output changed) in a diagnostics menu then the operator will be asked if the diagnostics mode shall be reset when the menu is left. Outputs are always set to normal mode after instrument restart and power up.

Scales

Shows detailed information about all Scales. For each scale is the live gross weight, the live input signal and the current zero correction value displayed.

Note that the live gross weight is shown with one decimal more than selected in the set-up of the scale. At least one decimal is always shown. The input signal is always shown with 5 decimals and the zero correction value is shown as percent of scale capacity with 2 decimals.

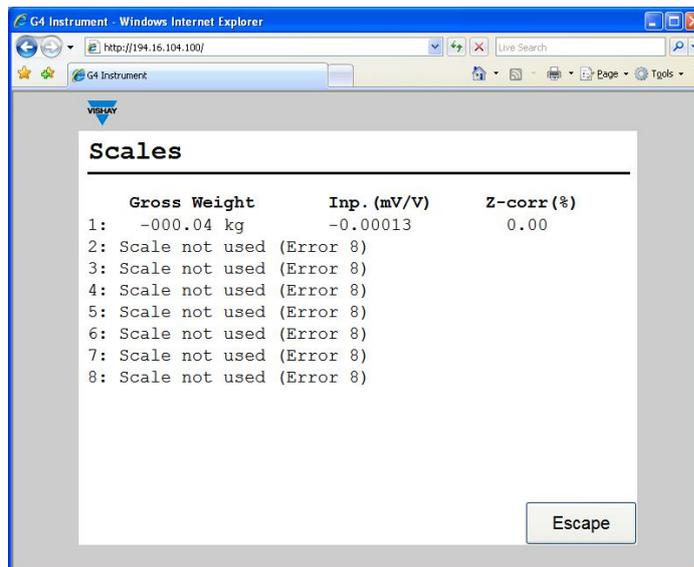

| | Gross Weight | Inp. (mV/V) | Z-corr (%) |
|----|--------------------------|-------------|------------|
| 1: | -000.04 kg | -0.00013 | 0.00 |
| 2: | Scale not used (Error 8) | | |
| 3: | Scale not used (Error 8) | | |
| 4: | Scale not used (Error 8) | | |
| 5: | Scale not used (Error 8) | | |
| 6: | Scale not used (Error 8) | | |
| 7: | Scale not used (Error 8) | | |
| 8: | Scale not used (Error 8) | | |

Scales diagnostics.

The zero correction is set when the scale is zeroed using the front panel zero button or with zeroing command on communication. The zero tracking and the Auto Zero functions also work on the zero correction value. The zero correction value is reset (set to 0) when starting a new calibration, when selecting default set-up or when upgrading (changing) the program.

Unused scales and scales with an error will display an error message instead of the gross weight, input signal and zero correction value.


The values on screen are automatically updated every 2 seconds.

Communication

Shows status for the two serial ports, the External I/O and the Modbus TCP Slave.

The serial ports COM1 and COM2 can be 'Not In Use', 'Modbus RTU Slave' or 'Printer'. In the example below 'COM1:' is not used and 'COM2:' is in Modbus RTU Slave mode with address 1, 115200 baud, 8 data bits, no parity and 1 stop bit.

The communications screen is not updated automatically. Click the 'Update' button to refresh the page.

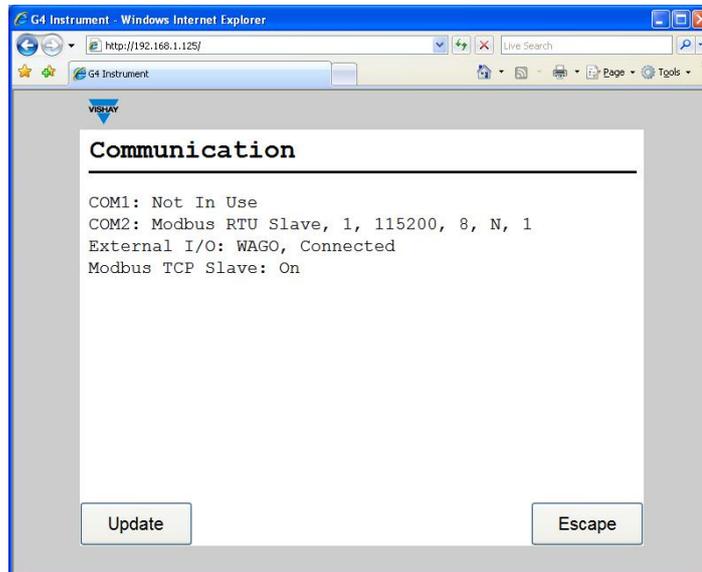

Communication diagnostics.

For the External I/O the following information might be displayed:

External I/O: Off

The parameter controlling external I/O is set to Off. I.e. the external I/O is not used.

External I/O: WAGO, Connected

The communication works correctly with the connected WAGO I/O system.

External I/O: WAGO, Connected (Com.Err.)

The G4 and the WAGO I/O system are connected but there is an undefined communication error. This problem may be temporary or persistent. To solve the problem: Check WAGO Fieldbus Coupler status indication LED's. Cycle power to WAGO.

External I/O: WAGO, Not connected

The G4 is correctly initialized but there is no communication with a WAGO I/O

system. To solve the problem: Check connection, WAGO power, WAGO and G4 Instrument configuration etc.

External I/O: WAGO, Faulty

There is an internal fatal error regarding external I/O. To solve the problem: Disconnect WAGO and cycle G4 Instrument power. Contact supplier if the error persists.

External I/O: WAGO, Init. Error

This is an internal error that might be persistent. To solve the problem: Disconnect WAGO and cycle G4 Instrument power. Cycle power to WAGO and G4 Instrument. Contact supplier if the error persists.

The Modbus TCP Slave is either On or Off.

Fieldbus

Shows the fieldbus type, address and status of the optional Fieldbus interface.

It also gives the possibility to study the contents in selected parts of the instrument memory (data to and from the fieldbus master). The function is very useful for advanced fault finding in case of problems with the fieldbus communication.


The contents of the output memory (data **to** the fieldbus master) are displayed in hexadecimal form at the six lines of the display. On each line eight byte values are displayed, preceded by 'o' for output and the address of the first byte.

The contents of the input memory (data **from** the fieldbus master) are displayed in hexadecimal form at the six lines of the display. On each line eight byte values are displayed, preceded by 'i' for input and the address of the first byte.

Buttons 'Prev.' and 'Next' are used to step in the memory.

Use button 'Input'/'Output' to change between display of output and input memory.

See chapter 'Communication' section 'Fieldbus interface' for details on fieldbus data mapping. Data on the screen is updated automatically every 2 seconds.

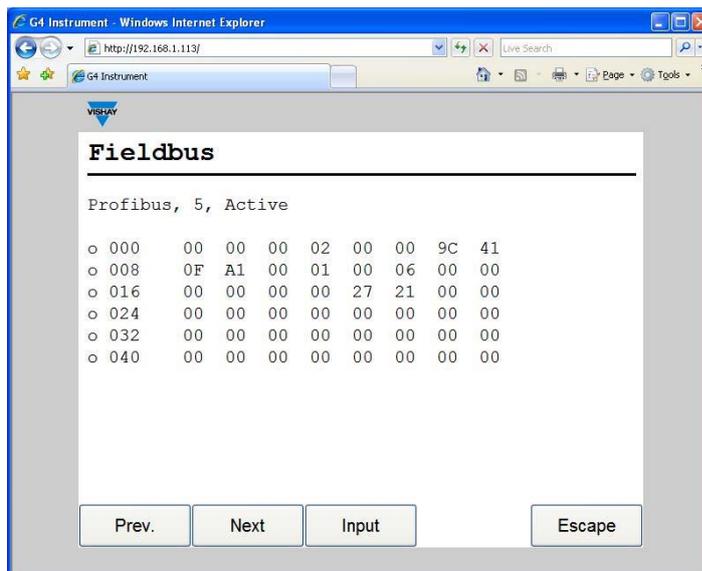

Fieldbus diagnostics.

Digital Inputs

Shows the status of all installed internal and external digital inputs.

Internal digital inputs are numbered 11 – 68. Each row corresponds to a slot. Only the currently available inputs in each slot are shown.


External I/O inputs are numbered from 101 to 228. All 128 inputs are shown regardless of how many inputs that are physically installed. Inputs are numbered with 101 closest to the Fieldbus Coupler and successive inputs are numbered consecutively regardless of type of I/O module (2, 4, 8 channels, etc).

The first field on each line is the input numbers for the line and the following digits indicates status of the inputs. A '0' indicates that the input is passive and a '1' means that the input is active.

If external I/O is enabled there will be three additional pages that can be shown by pressing the 'Prev./'Next' buttons or arrow left/right buttons. The 'Prev.' and 'Next' buttons will only be shown if external I/O is enabled.

If there are a communication error or other error regarding the external I/O dashes will replace the digits indicating external input status.

The screen is automatically updated every 2 seconds.

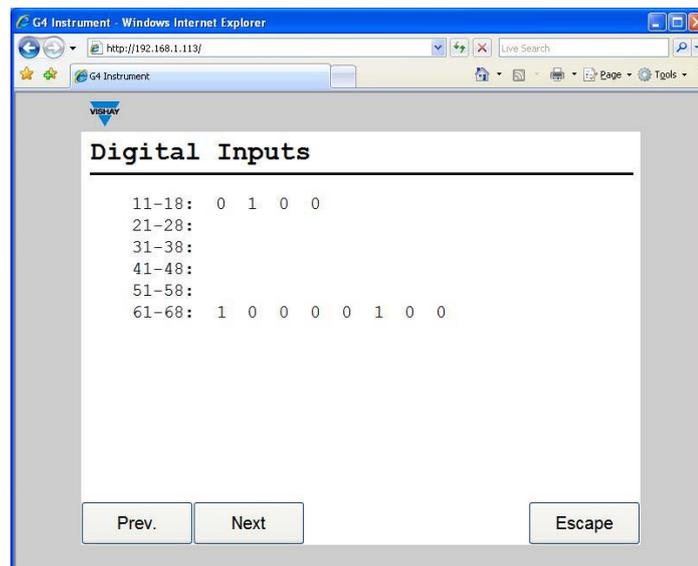

Digital Inputs diagnostics.

Digital Outputs

Shows the status of all installed internal and external digital outputs. It is also possible to change the status of the digital outputs.

Internal digital outputs are numbered 11 – 68. Each row corresponds to a slot. Only the currently available outputs in each slot are shown.

External I/O outputs are numbered from 101 to 228. All 128 outputs are shown regardless of how many outputs that are physically installed. Outputs are numbered with 101 closest to the Fieldbus Coupler and successive outputs are numbered consecutively regardless of type of I/O module (2, 4, 8 channels, relays etc).

The first field on each line is the outputs numbers for the line and the following digits indicates status of the outputs. A '0' indicates that the output is passive and a '1' means that the output is active.


If external I/O is enabled there will be three additional pages that can be shown by clicking the 'Prev./'Next' buttons. The 'Prev.' and 'Next' buttons will only be shown if external I/O is enabled.

If there are a communication error or other error regarding the external I/O dashes will replace the digits indicating external output status.

An output is selected by clicking with the mouse on the desired output. A dashed frame around the digit in the symbol indicates a selected output.

Press 'Toggle' to force the selected output. The first time the button is clicked will set the output in diagnostics mode keeping the current state. Each time the 'Toggle' button is clicked while in diagnostics mode will toggle the output. To restore the output to normal operation click 'Normal' button. An output in diagnostics mode (manually forced to a state) is marked with a grey background.

The screen is automatically updated every 2 seconds.

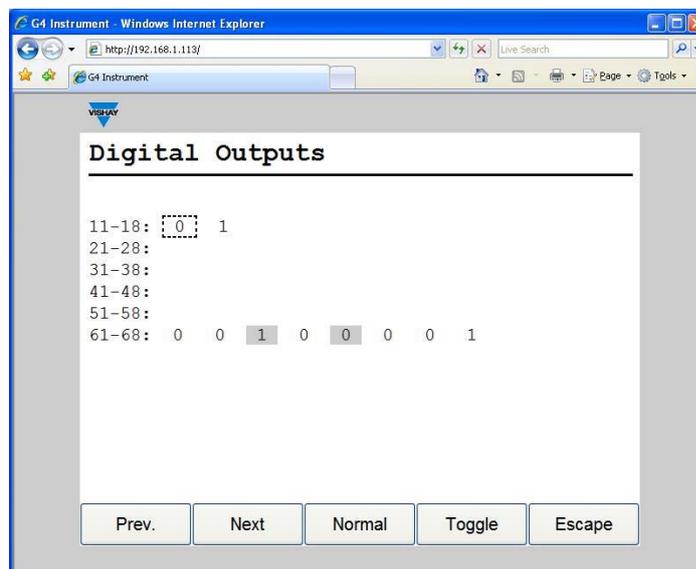

Digital Outputs diagnostics.


Analog Outputs

Shows the output value or a possible error message for installed analog outputs.

It is also possible to override the normal operation and set the output value for each analog output. To change an output value click the button marked with the output number and enter wanted value. To restore an output to normal operation, click the corresponding button 'AOUT1' – 'AOUT4' and then click the button 'Normal'.

A '(D)' at the end of a line indicates that the output is manually set (in diagnose mode).

The screen is automatically updated every 2 seconds.

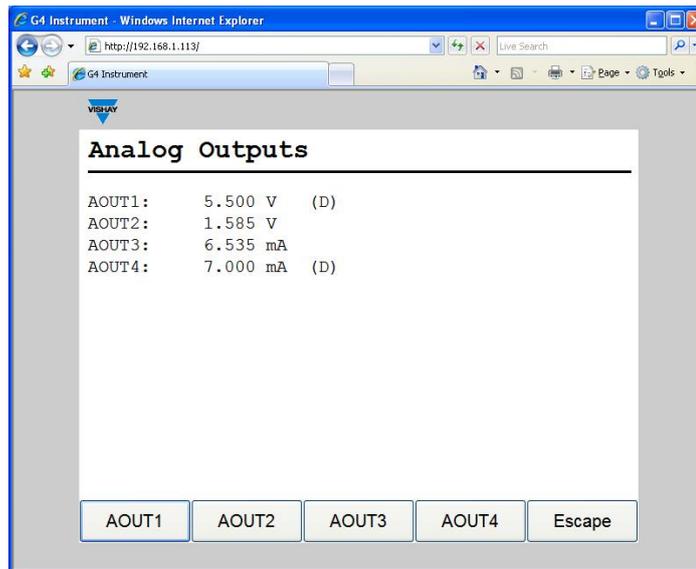

Analog Outputs diagnostics.

File Handling

File handling is used for copying, moving, renaming and deleting files.


Files can be copied and moved between the instrument and the PC.

The file handling will use the browser internal ftp support. When selecting the File Handling a screen will show the text 'Click here to open FTP in a new window'. This is a link that will open an ftp client in a new window. From here it's possible to navigate the instrument file system and copy files to and from the instrument. Different browsers will have different capabilities and behavior. Consult the documentation for the actual browser used.

It is also possible to e.g. use Microsoft Windows Explorer to perform Ftp file transfer.

Another option is to use a dedicated ftp client for file handling/transfer.

It will always be required to login to the ftp server of the instrument. Anonymous ftp is not allowed.

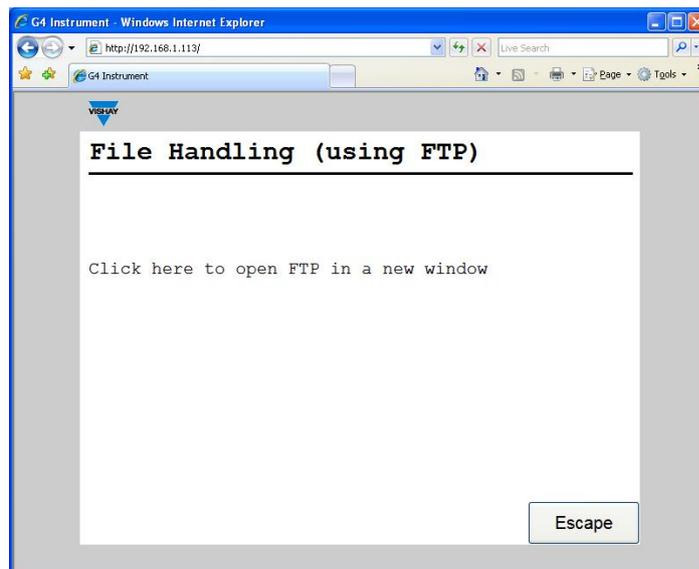

File Handling menu

The file handling has access to the 'user tree' directory structure in the instrument. The default folders are 'InstrBackup', 'LogFiles', 'Misc' and 'Recipes'. The folder 'InstrBackup' is used as default when creating or restoring backup and the folder 'LogFiles' is used to store various types of log files.

If there are problems with file copy or file move it might be because of insufficient memory in the instrument. Try removing unnecessary files in the user tree.

Create Backup

Parameter values are stored in a file that can be used to restore to same or other instruments of the same type. The back-up file will be saved on the PC. The file name can be edited. Note that additional information, which is saved in the backup file, can be added before the backup file is created.

Using the Create backup requires either a Set-up Code or an Operator Code if a lock is activated.

After entering a possible Code the Optional Information screen is displayed. Here it is possible to add more and/or change the default information.

When satisfied with the Optional Information the user should click the 'Backup' button to continue. The user will then be shown a warning message that says that the backup procedure can take more than a minute to perform.

Clicking the 'Yes' button will start the backup procedure. During this time the browser will indicate "Waiting for answer" or similar. When the backup is done a file open/save popup window will appear. Select save and a file save window will be shown where the desired location to save the backup file can be chosen. It will also be possible to change the default file name here.

Click the 'No' button to leave the backup screen.

Restore Backup

Restoring a previously stored parameter backup to the instrument. Any additional information in the backup file is displayed before a backup file is restored. Backup files are fetched from the PC.

Using the Restore Backup requires either a Set-up Code or an Operator Code if a lock is activated.

After entering a possible Code a file selection screen is displayed. Clicking the 'Browse...' button will display a file selection popup window. Chose the desired backup file and click the 'Open' button. The chosen file name is shown on the screen. Click 'Next' button to continue the restore procedure.

After a short delay the optional information for the selected backup file is displayed. Verify that the backup file is the desired and click the 'Restore' button. The user will then be shown a warning message that says that the restore procedure will take a long time to perform.

Click the 'Yes' button to perform the restore. The connection with the instrument will be lost. When the restore is finished within the instrument it will automatically restart. Thereafter it will be possible to reconnect to the instrument e.g. by refreshing the page.

Set Default

Restore of the instrument settings to the default values that can be found in the Technical manual. Note that default values may differ from the setting that where in the instrument at delivery.

All Zero correction values, Levels, Setpoints, Accumulated weights, Batched weight etc. will be set to zero when executing a default set-up.

Using the Set Default requires either a Set-up Code or an Operator Code if a lock is activated.

After entering a possible Code a warning message is displayed. Click the 'Yes' button to perform the default set-up. The default set-up procedure will take some time and the connection with the instrument will be lost. When the default set-up is finished the instrument it will automatically restart. Thereafter it will be possible to reconnect to the instrument e.g. by refreshing the page.

Program Upgrade

Not available with the Remote Access Interface.

Instrument Restart

With the Instrument Restart function it is possible to force the instrument to make complete restart (corresponding to a power down – power up cycle). This must be used with great caution especially if done from a remote position. The user must make sure that no hazardous situation will occur.

To use the Instrument Restart function requires either a Set-up Code or an Operator Code if a lock is activated.

Note that the Instrument Restart function can be used even if a local user has exclusive access to parameter editing or maintenance functions. The purpose of this is to be able to resolve a blocking between local and remote user.

When the user have selected the Instrument Restart function and entered a possible Code he will be asked: "Restart Instrument?" If clicking Yes a warning message is displayed. Clicking Yes will make the instrument restart.

When the instrument is restarting the browser will lose the connection with the instrument. The browser will display an error message that the connection has failed. A restart will normally take about one minute. When the instrument has restarted it will be possible to reconnect to the instrument e.g. by refreshing the page.

8. Maintenance

General

This chapter describes the maintenance functions when handled from the local display.

The Maintenance menu includes a number functions used for diagnostics, maintenance and program upgrade purposes. The Maintenance menu is found under the Main menu.

Diagnostics

The diagnostics functions cover Scales, Communication, Fieldbus, Digital Inputs, Digital Outputs and Analog Outputs. It is possible to read data and status for the different functions and also in some cases (Digital and Analog outputs) change the output data. If the normal operation has been interrupted (a value or output changed) in a diagnostics menu then the operator will be asked if the diagnostics mode shall be reset when the menu is left. Outputs are always set to normal mode after instrument restart and power up.

Scales

Shows detailed information about all Scales. For each scale is the live gross weight, the live input signal and the current zero correction value displayed.

Note that the live gross weight is shown with one decimal more than selected in the set-up of the scale. At least one decimal is always shown. The input signal is always shown with 5 decimals and the zero correction value is shown as percent of scale capacity with 2 decimals.

The zero correction is set when the scale is zeroed using the front panel zero button or with zeroing command on communication. The zero tracking and the Auto Zero functions also work on the zero correction value. The zero correction value is reset (set to 0) when starting a new calibration, when selecting default set-up or when upgrading (changing) the program.

Unused scales and scales with an error will display an error message instead of the gross weight, input signal and zero correction value.

| Scales | | | |
|--------|--------------------------|------------|-----------|
| | Gross Weight | Inp.(mV/V) | Z-corr(%) |
| 1: | 000.23 kg | 0.00043 | 0.07 |
| 2: | 098.23 kg | 0.70406 | 1.22 |
| 3: | 134.01 kg | 2.00302 | -0.77 |
| 4: | 00.701 kg | 0.05401 | 0.82 |
| 5: | 876.23 kg | 1.94329 | 0.61 |
| 6: | Scale not used (Error 8) | | |
| 7: | Scale not used (Error 8) | | |
| 8: | Scale not used (Error 8) | | |

Escape


Scales diagnostics.

Communication

Shows status for the two serial ports, the External I/O and the Modbus TCP Slave.

When a correct message is received on COM1, COM2 or if there are printout data in the printer buffer, the corresponding header text will blink.

The serial ports COM1 and COM2 can be 'Not In Use', 'Modbus RTU Slave' or 'Printer'. In the example below 'COM1:' is not used and 'COM2:' is in Modbus RTU Slave mode with address 1, 115200 baud, 8 data bits, no parity and 1 stop bit.

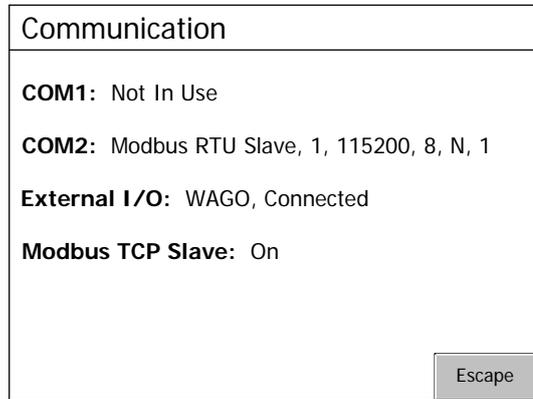

Communication diagnostics.

For the External I/O the following information might be displayed:

External I/O: Off

The parameter controlling external I/O is set to Off. I.e. the external I/O is not used.

External I/O: WAGO, Connected

The communication works correctly with the connected WAGO I/O system.

External I/O: WAGO, Connected (Com.Err.)

The G4 and the WAGO I/O system are connected but there is an undefined communication error. This problem may be temporary or persistent. To solve the problem: Check WAGO Fieldbus Coupler status indication LED's. Cycle power to WAGO.

External I/O: WAGO, Not connected

The G4 is correctly initialized but there is no communication with a WAGO I/O system. To solve the problem: Check connection, WAGO power, WAGO and G4 Instrument configuration etc.

External I/O: WAGO, Faulty

There is an internal fatal error regarding external I/O. To solve the problem: Disconnect WAGO and cycle G4 Instrument power. Contact supplier if the error persists.

External I/O: WAGO, Init. Error

This is an internal error that might be persistent. To solve the problem: Disconnect WAGO and cycle G4 Instrument power. Cycle power to WAGO and G4 Instrument. Contact supplier if the error persists.

The Modbus TCP Slave is either On or Off. When a correct message is received the header will blink

Fieldbus

Shows the fieldbus type, address and status of the optional Fieldbus interface.

It also gives the possibility to study the contents in selected parts of the instrument memory (data to and from the fieldbus master). The function is very useful for advanced fault finding in case of problems with the fieldbus communication.

The contents of the output memory (data **to** the fieldbus master) are displayed in hexadecimal form at the six lines of the display. On each line eight byte values are displayed, preceded by 'o' for output and the address of the first byte.

The contents of the input memory (data **from** the fieldbus master) are displayed in hexadecimal form at the six lines of the display. On each line eight byte values are displayed, preceded by 'i' for input and the address of the first byte.

Keys F1 (Prev.) and F2 (Next) are used to step in the memory.

Use key F3 (Input/Output) to change between display of output and input memory.

See chapter 'Communication' section 'Fieldbus interface' for details on fieldbus data mapping.

| Fieldbus | |
|---------------------|-------------------------|
| Profibus, 5, Active | |
| o 000 | 00 00 00 00 00 00 9C 41 |
| o 008 | 0F A2 00 65 00 00 00 00 |
| o 016 | 27 0F 00 0C 35 20 00 00 |
| o 024 | 00 00 00 00 00 00 00 00 |
| o 032 | 00 00 00 00 00 00 00 00 |
| o 040 | 00 00 00 00 00 00 00 00 |
| Prev. | Next |
| Input | Escape |

Fieldbus diagnostics.

Digital Inputs

Shows the status of all installed internal and external digital inputs.

Internal digital inputs are numbered 11 – 68. Each row corresponds to a slot. Only the currently available inputs in each slot are shown.

External I/O inputs are numbered from 101 to 228. All 128 inputs are shown regardless of how many inputs that are physically installed. Inputs are numbered with 101 closest to the Fieldbus Coupler and successive inputs are numbered consecutively regardless of type of I/O module (2, 4, 8 channels, etc).

The first field on each line is the input numbers for the line and the following digits indicates status of the inputs. A '0' indicates that the input is passive and a '1' means that the input is active.

If external I/O is enabled there will be three additional pages that can be shown by pressing the Prev./Next buttons or arrow left/right buttons. The Prev. and Next buttons will only be show if external I/O is enabled.

If there are a communication error or other error regarding the external I/O dashes will replace the digits indicating external input status.

| Digital Inputs | | | |
|----------------|------|---------|-------|
| 11-18: | 0 | 1 | 0 0 |
| 21-28: | | | |
| 31-38: | | | |
| 41-48: | | | |
| 51-58: | | | |
| 61-68: | 1 | 0 0 0 0 | 1 0 0 |
| Prev. | Next | Escape | |

Digital Inputs diagnostics.

Analog Outputs

Shows the output value or a possible error message for installed analog outputs.

It is also possible to override the normal operation and set the output value for each analog output. To change an output value press the function key marked with the output number and enter wanted value. To restore an output to normal operation, press the proper function key and the select the function key F3 (Normal).

A '(D)' at the end of a line indicates that the output is manually set (in diagnose mode).

| Analog Outputs | | | | |
|----------------|----------|-------|-------|--------|
| AOUT1: | 5.500 V | (D) | | |
| AOUT2: | 1.583 V | | | |
| AOUT3: | 8.271 mA | | | |
| AOUT4: | 7.000 mA | (D) | | |
| AOUT1 | AOUT2 | AOUT3 | AOUT4 | Escape |

Analog Outputs diagnostics.

File Handling

File handling is used for copying, moving (renaming) and deleting files.

Files can be copied and moved between folders in the instrument and between a USB memory and the instrument (both to and from the USB memory). File can be renamed while copying or moving.

It is possible to delete files stored in the instrument and on a USB memory.

The file handling has access to the 'user tree' directory structure in the instrument. The default folders are 'InstrBackup', 'LogFiles', 'Misc' and 'Recipes'. The folder 'InstrBackup' is used as default when creating or restoring backup and the folder 'LogFiles' is used to store various types of log files.

If there are problems with file copy or file move it might be because of insufficient memory. Try removing unnecessary files in the user tree.

Create Backup

Parameter values are stored in a file that can be used to restore to same or other instruments of the same type. The user can select to save the back-up file either in the instrument or on a connected USB memory. The file name can be edited. Note that additional information, which is saved in the backup file, can be given before the backup file is created.

Restore Backup

Restoring a previously stored parameter backup to the instrument. Any additional information in the backup file is displayed before a backup file is restored. Backup files can be fetched from internal memory or from a USB memory.

Set Default

Restore of the instrument settings to the default values that can be found in the Technical manual. Note that default values may differ from the setting that were in the instrument at delivery.

All Zero correction values, Levels, Setpoints, Accumulated weights, Batched weight etc. will be set to zero when executing a default set-up.

Program Upgrade

Upgrading the program with a different version.

Upgrading is normally done from a USB memory. When upgrading the user is asked to select the version to upgrade to by selecting a file (Upgrade.txt) that is situated within the folder containing all files and folders necessary for program upgrade. When upgrading is done (a success message is displayed) the instrument will be restarted. Note that it may take a long time, more than 15 minutes, for the instrument to restart after upgrading.

In case of failure when upgrading an error message will be displayed and the user will be given a possibility to recover from the failed upgrade. Corrupt files or malfunctioning USB memory are possible causes of upgrade failure.

Note that the folder containing the program upgrade must not be tampered with but always handled as a whole. Any changes are likely to make the upgrade worthless and making the instrument defective.

All Zero correction values, Levels, Setpoints, Accumulated weights, Batched weight etc. will be set to zero when a successful program upgrade is performed.

Note that several MB of free internal flash disc memory is required to be able to perform a program upgrade. If the upgrade fails, due to file copy error, try to free some space in the 'user tree' area by using the 'File Handling' maintenance function to remove unnecessary files. It is also possible to use an ftp (File Transfer Protocol) client to access the user area from an external computer over an Ethernet connection. See chapter 'Communication – Ftp Server'.

Instrument Restart

With the Instrument Restart function it is possible to force the instrument to make complete restart (corresponding to a power down – power up cycle). This must be used with great caution. The user must make sure that no hazardous situation will occur.

To use the Instrument Restart function requires either a Set-up Code or an Operator Code if a lock is activated.

Note that the Instrument Restart function can be used even if a remote user has exclusive access to parameter editing or maintenance functions. The purpose of this is to be able to resolve a blocking between local and remote user.

When the user have selected the Instrument Restart function and entered a possible Code he will be asked: "Restart the Instrument?" If pressing the Yes button a warning message is displayed. Clicking Yes will make the instrument restart.

After some time, approximately one minute the instrument will be in operation again.

9. Troubleshooting

General

During installation and maintenance of the G4 Instrument, the sub menus 'System Information' and 'Maintenance / Diagnostics' can be useful for solving possible problems related to I/O modules, Ethernet, Serial Communication etc.

The instrument reports detected errors on the display. Error codes can also be read via communication.

When an error is detected for a scale, all digital outputs are set passive and the analog outputs are set to 0 V or 0 mA for outputs configured for that scale.

The output signal 'In Process' is set passive if an error is detected.

The optional fieldbus interface adapters have LED's for indication of status.

Error codes

This part provides explanations of the error codes.

Some errors are displayed on the instrument display, containing a description of the error and the error code.

Reading error codes is done by Modbus and by the optional Fieldbus. Error code registers are 'Instrument error', 'Command error' and 'Scale 1: Error code' to 'Scale 8: Error code' (see chapter 'Communication').

The error codes are divided in four groups, depending on their origin:

- **Weight errors** occur when transducer signals or weight values go out of given ranges.
- **Start-up errors** occur only during start-up.
- **General errors** usually occur due to faulty entries from the front panel, alternatively invalid data or not allowed commands from the control unit.
- **Set-up errors** can only occur during instrument set-up.

On the following pages a summary of all error codes is given (note that code 000 always means 'no error').

Note that there are some error codes of internal type not described below. If an error code is displayed that is not listed below try restarting the instrument and if the error persists please contact your supplier.

Weight errors

The indication is either temporary or stays on until the cause is cured.

| Error code | Explanation |
|---------------------|--|
| 000 | No error. The instrument is in 'normal state' and no error is detected. |
| 003 | Instrument not in normal state. Weight is not valid. |
| 004 | Overload Overload means that the weight exceeds the highest allowed limit that is specified in the set-up parameters 'Overload check' and 'Overload limit'. |
| 005 | Over range Overrange means that the input signal from the transducer exceeds the operating range. |
| 006 | Underload Underload means that the weight is below the lowest allowed limit that is specified in the set-up parameters 'Overload check' and 'Overload limit'. |
| 007 | Under range Underrange means that the input signal from the transducer is below the operation range. |
| 010 | Excitation short-circuit Either a short-circuit in the excitation circuit or too many transducers connected. (A fault in a transducer or inside the instrument is also possible.) Check transducer connections. See chapter 'Installation'. |
| 011 | Sense voltage error The sense voltage is out of range. Check transducer connections. See chapter 'Installation'. |
| 012 | Transducer signal error The input signal is out of range, for example due to a faulty or missing transducer connection. (A fault in a transducer or inside the instrument is also possible.) Check transducer connections. See chapter 'Installation'. |
| 014 | Invalid input signal Invalid input signal is reported while the instrument is waiting for sufficient conversion data to calculate a valid weight value. This indication is reported during power-up and after changing the HSWF / WFIN Update Rate settings since input value might be momentarily unreliable. |
| 020, 191 | Too many digits The actual weight value with the configured number of decimals is exceeding 6 digits. |

Start-up errors

These error codes can only appear during start-up.

| Error code | Explanation |
|------------|--|
| 081 | <p>Set-up data error Indicates faulty set-up. Enter set-up mode, perform the necessary editing and save the new parameter settings or use the “Set Default values” function (Maintenance menu).</p> |
| 082 | <p>Set-up and installed I/O modules do not match The I/O-modules in the instrument doesn't correspond to the set-up. Correct the set-up or change modules.</p> |
| 083 | <p>Wrong type of Fieldbus Module The fieldbus module in the instrument doesn't correspond to the set-up. Correct the set-up or change module.</p> |
| 084 | <p>No Fieldbus Module There is no fieldbus module installed in the instrument but the set-up indicates there should be a fieldbus module. Correct the set-up or install the desired module.</p> |
| 085 | <p>Fieldbus Module Error There is some kind of error when configuring the fieldbus module. Check the status LED's on the module, check that the set-up corresponds to the network configuration, baud rate, addresses etc.</p> |
| 090 | <p>Failed to start the real time system Some error occurred when the real time dll was accessed during start up. Restart the instrument and if the error persists contact your supplier.</p> |
| 091 | <p>Database error An error occurred when the program tried to access the internal parameter database. To correct the problem first restart the instrument. If the error persists the database file can be deleted. The instrument will create a new database with default settings during restart. Upgrading the program (also reinstalling the present version) will also force a new database with default settings to be created. If the error still persists contact your supplier.</p> |

General errors

These errors generally occur due to faulty entries from the front panel, alternatively invalid data or not allowed commands from the control unit.

| Error code | Explanation |
|------------------|---|
| 008 | Scale not used The scale that is not configured (used) in the instrument. |
| 060 - 063 | AOUT ch X termination error There is a termination error on an analog output channel. Too low impedance on a voltage output or too high impedance on a current output may cause this error. |
| 070 | I/O module communication error There is an internal error in the communication between the CPU module and one or more of the I/O modules. Restart the instrument and contact the supplier if the error persists. |
| 071 - 074 | I/O module reset There has been an internal reset within an I/O module. Restart the instrument and contact the supplier if the error persists. |
| 076 | Power Fail detected The instrument have detected that the supply voltage is too low and enters a power fail state. Weight values etc. are invalid in this state. Power fail state last a short moment until power is completely lost. If this state continues more than a moment it might be due to a low input voltage (below specifications). |
| 100 | Instrument in wrong state The transmitted command is not applicable to the present instrument mode. |
| 101 | Too high value! Value over allowed range. Compare with restrictions for the parameter. |
| 102 | Too low value! Value under allowed range. Compare with restrictions for the parameter. |
| 103 | Illegal start address. Illegal modbus start address, when writing data to the G4 instrument. |
| 104 | Illegal number of registers. Illegal number of modbus registers, when writing data to G4 instrument. |
| 105 | Faulty value Value not accepted when entering a parameter from front panel or illegal data in modbus registers, when writing data to the G4 instrument. |
| 106 | Previous command not ready The previous command is not finished. Wait until pending command is finished and send the command again. This error code will only be given via communication. |
| 110 | Unstable weight. Zero setting always requires a stable weight on the scale. If motion check is set to ON, also taring and printing of weight values require a stable weight on the scale. Consequently, if you try to transmit a command for zero setting, taring, or printing of weight value without awaiting a stable weight you will receive this error code. |

| Error code | Explanation |
|------------|--|
| 111 | <p>Taring not allowed (negative gross weight). Taring is not allowed at negative gross weight if parameter 'Overload check' is set to Unipolar.</p> |
| 112 | <p>Instrument in net mode. Zero setting requires that the instrument is in gross mode. However, if you try to transmit a zero setting command while the scale is in net mode you'll receive this error code.</p> |
| 113 | <p>Outside zero setting limits. Adjustment of the zero setting during operation is only possible if the accumulated correction required is within -1% to +3% of the capacity set-up. Consequently, if you transmit a zero setting command while the required adjustment is outside allowed range you will receive this error code.</p> |
| 114 | <p>Setpoint(s) not in use. Activation/Deactivation of setpoint(s) cannot be done, as at least one of the setpoint sources is/are set to 'not in use'.</p> |
| 115 | <p>Weight below min weight for printing The weight is below the lowest allowed for printing. The low limit is set by parameter 'Min. Weight Print'. See chapter 'Set-up'.</p> |
| 116 | <p>Net mode not allowed. Net weight cannot be shown when the tare value equals 0.</p> |
| 117 | <p>Flow display not allowed. Flow rate is not enabled for the actual scale.</p> |
| 118 | <p>Zero setting not allowed. Zero setting is not allowed when the calibration menu is displayed for the actual scale.</p> |
| 122 | <p>Printer buffer overflow. Communication print command error response. Given when the printer buffer for a used port is full. The current communication set-up and possibly the printer cannot handle the amount of print commands that been issued (during a limited time) over communication, print button and digital inputs totally.</p> |
| 123 | <p>Printing error. Communication print command error response. There is an undefined internal error regarding printer handling. Try the command again or restart the instrument. Contact your supplier if the error persists.</p> |
| 124 | <p>Program option not enabled A command that applies to a program option that is not enabled, was given. The command is not executed.</p> |
| 125 | <p>Wrong batching state A batching command was given while the scale was in a batching state not allowing this command. The command was not executed.</p> |
| 126 | <p>Not allowed during batching The parameter or Preset Tare that the user tried to edit is not allowed to be change during batching.</p> |

| Error code | Explanation |
|------------|--|
| 127 | <p>Command not allowed during batching The given command is not allowed during batching. E.g. it is not allowed to tare, change between gross and net display etc during batching.</p> |
| 128 | <p>No batching activities in use It is not possible to start batching without any activities configured.</p> |
| 129 | <p>Command not allowed during set-up It is not allowed to start batching when parameter set-up is in progress. It is possible to edit some batching parameters without preventing batch start. These parameters can also be edited during batching. See separate 'Scale Batching Program Option' 'Technical Manual Supplement' for a detailed description. When the user leaves the menu system it will be possible to start batching again.</p> |
| 131 | <p>Faulty configuration of internal batching input (slot 1) A batching activity input signal is configured to use an input from slot 1. This input is not configured as a 'Batch Activity' or is physically not present (no module in the slot, no inputs on the module, or input number higher than the number of inputs actually on the module). This is checked at batch start.</p> |
| 132 | <p>Faulty configuration of internal batching input (slot 2) See error code 131 above.</p> |
| 133 | <p>Faulty configuration of internal batching input (slot 3) See error code 131 above.</p> |
| 134 | <p>Faulty configuration of internal batching input (slot 4) See error code 131 above.</p> |
| 135 | <p>Faulty configuration of internal batching input (slot 5) See error code 131 above.</p> |
| 136 | <p>Faulty configuration of internal batching input (slot 6) See error code 131 above.</p> |
| 137 | <p>Faulty configuration of internal batching output (slot 1) A batching activity output is configured to use an output from slot 1. This output is not configured as a 'Batch Activity' or is physically not present (no module in the slot, no outputs on the module, or output number higher than the number of outputs actually on the module). This is checked at batch start.</p> |
| 138 | <p>Faulty configuration of internal batching output (slot 2) See error code 137 above.</p> |
| 139 | <p>Faulty configuration of internal batching output (slot 3) See error code 137 above.</p> |
| 140 | <p>Faulty configuration of internal batching output (slot 4) See error code 137 above.</p> |
| 141 | <p>Faulty configuration of internal batching output (slot 5) See error code 137 above.</p> |
| 142 | <p>Faulty configuration of internal batching output (slot 6) See error code 137 above.</p> |

| Error code | Explanation |
|------------|--|
| 143 | Multiple use of internal batching output Two or more scales are using the same internal output. An internal output may be used by more than one activity but only by one scale. This is checked at batch start. |
| 144 | Multiple use of external batching output Two or more scales are using the same external output. An external output may be used by more than one activity but only by one scale. This is checked at batch start. |
| 240 | Fieldbus command error. Command error response on fieldbus connection. Indicates that the command sent to the G4 instrument via the fieldbus connection could not be executed. |
| 249 | Internal Timeout A timeout occurred when the program tried to access some internal resources. If this error occurs when a command is sent to the instrument, try the command again. Restart the instrument or contact the supplier if the error persists. |

Set-up errors

These errors occur only during instrument set-up from the front panel.

Certain errors depend on more than one set-up parameter and it is the operator's responsibility to locate and correct all faulty set-up parameters.

| Error code | Explanation |
|------------|--|
| 151 | <p>Weight error The weight is not valid during calibration. Check the live weight and input signal at the bottom of the display in calibration menus.</p> |
| 152 | <p>Unstable transducer signal used This is not an error but only a warning. The weight was not stable during calibration which might reduce the accuracy of the calibration. Wait a little longer and try again. If the problem persists, check the mechanical and electrical stability of the installation, check the live weight and input signal at the bottom of the display in calibration menus.</p> |
| 153 | <p>Capacity/Resolution > 6 digits The Capacity value has more than the permitted 6 digits. Select a combination of Resolution and Capacity that will result in max. 6 digits plus decimal point.</p> |
| 155 | <p>Illegal calibration direction All weights with corresponding mV/V values must be increasing for increasing calibration point number.</p> |
| 156 | <p>Calibration not finished (all calibration points not stored) This warning is given if the user is leaving the calibration menu when a dead weight calibration is started but not all calibration points are stored. The user will have the possibility to continue calibration, leave the menu and discard all calibration changes or leave the calibration menu and keep the calibration changes done so far. Note that leaving an unfinished calibration might give a faulty calibration of the scale.</p> |
| 157 | <p>The flow rate derivation time is changed by the instrument This is a warning that the flow rate derivation time has been changed automatically. It can be changed if Filter Update Rate is changed or if Auto Derivation Time is On also when changing parameters 'Flow Rate Unit' or 'Flow rate resolution'.</p> |
| 158 | <p>Wrong program option code. The entered program option code is not valid. Check that the code is correctly entered, that the code is intended for the used CPU S/N (See menu System Info) and that the used program version is correct (i.e. a program that includes the program option desired, see menu System Info).</p> |
| 159 | <p>Not allowed to turn the program option Off. It is not allowed to turn off the program option in the current situation.</p> |
| 160 | <p>Not allowed to change set-up parameter It is not allowed to change this parameter in the current situation. This may be due to e.g. that calibration is in progress, due to some settings etc. Check the description of the current parameter.</p> |

| Error code | Explanation |
|------------|--|
| 190 | <p>Zero track rate too high The zero-track rate is too high. Select a lower zero track rate.</p> |
| 192 | <p>Too high transducer signal in calibration point 2 The mV/V signal in calibration point two is too high (often due to a previous, strange data sheet calibration).</p> |
| 193 | <p>Too high transducer signal in calibration point 2 The mV/V signal in calibration point 2 is too high, due to strange data sheet calibration. The conversion factor, rated load etc. does not correspond to each other.</p> |
| 194 | <p>Illegal calibration direction All weights with corresponding mV/V values must be increasing for increasing calibration point number.</p> |
| 195 | <p>Illegal I/O module configuration The I/O-module set-up (Hardware Configuration menu) is not consistent with the allowed number of modules of the different types or the allowed combinations of modules.</p> |
| 196 | <p>Illegal scale number configuration Each scale number must only be used once. I.e. each measuring input must have a unique scale number. See menu 'Hardware Configuration'.</p> |

Declaration of Conformity

We Vishay Nobel AB
Box 423, S-691 27 KARLSKOGA
SWEDEN

declare under our sole responsibility that the products

Process control equipment consisting of following instruments:

G4 Desktop instrument, type G4-DT-FB-S1-S2-S3-S4-S5-S6-P.

G4 Harsh environment instrument, type G4-HE-FB-S1-S2-S3-S4-S5-S6-P.

G4 Panel mount instrument, type G4-PM-FB-S1-S2-S3-S4-S5-S6-P.

G4 Rail mount instrument, type G4-RM-FB-S1-S2-S3-V.

 
to which this declaration relates is in conformity with the
following standards or other normative documents.

The essential requirements in the EMC Directive 89/336/EEC
with amend. 92/31/EEC and 93/68/EEC.

EN 61 326:1997, EN 61 326 A3:2003

Low voltage directive 2006/95/EC : EN/IEC 61010-1:2001 ed.2
CE marked 2006

KARLSKOGA October. 15 2007



Lars Nilsson, Managing Director

Document no. 35144
Article no. 600 852 R8
© Vishay Nobel AB, 2011-05-11
Subject to changes without notice.

Vishay Nobel AB
Box 423, SE-691 27 Karlskoga, Sweden
Phone +46 586 63000 · Fax +46 586 63099
pw.se@vishaypg.com
www.weighingsolutions.com

Vishay BLH
3 Edgewater Drive, Norwood, MA 02726, USA
Phone: 781-298-2200 Fax: 781-762-3988
pw.us@vishaypg.com
www.weighingsolutions.com